

OIL ANALYSIS REPORT

OIL ANAL 1313 HEF OIL

SMART OIL Machine Id HERTZ VD029322 - OREILLY AUTO

Component

Compressor Fluid

SMARTOIL 6000 (--- GAL)

Sample Rating Trend N Septo23



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		1		Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK05982487		
Sample Date		Client Info		30 Sep 2023		
Machine Age	hrs	Client Info		1333		
Oil Age	hrs	Client Info		1333		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	4		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	4		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m	20	0		
Phosphorus	ppm	ASTM D5185m		52		
Zinc	ppm	ASTM D5185m		4		
Sulfur	ppm	ASTM D5185m		333		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.17		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
12·16·37\ Rov: 1				Contact/Locati	on, MADDANT	V LICHEDOLIA



OIL ANALYSIS REPORT

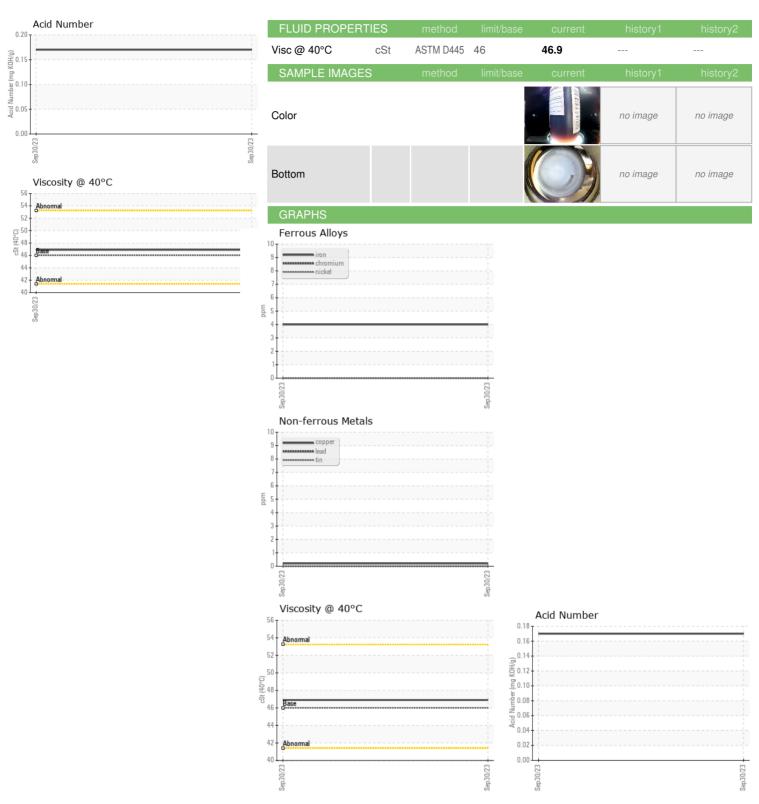





Laboratory Sample No. Lab Number

Unique Number : 10699782

: UHK05982487 : 05982487 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Oct 2023

Diagnosed : 20 Oct 2023 Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HERTZ KOMPRESSOREN USA INC

3320 SERVICE ST CHARLOTTE, NC US 28206

Contact: WARRANTY

warranty@hertz-kompressoren.us T: (704)579-5900

Contact/Location: WARRANTY - UCHERCHA

F: (704)579-5997