


Area
[R23286 YANNUZI]
 Machine Id
VOLVO PENTA TAD572VE 700533379
 Component
Diesel Fuel
 Fluid
NOT GIVEN (--- GAL)

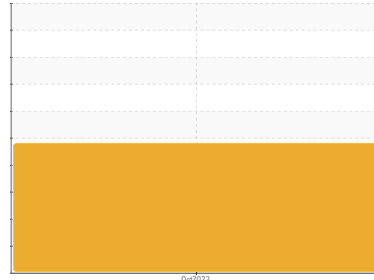

DIAGNOSIS

Recommendation
 This is a baseline read-out on the submitted sample. We advise that you follow the water drain-off procedure for this component.

Corrosion
 All metal levels are normal indicating no corrosion in the system.

Contaminants
 Excessive free water present.

Fuel Condition
 The condition of the fuel is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			VCP441968	---	---
Sample Date	Client Info			05 Oct 2023	---	---
Machine Age	hrs	Client Info		3679	---	---
Sample Status				SEVERE	---	---



PHYSICAL PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		2.46	---	---

SULFUR CONTENT		method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		5	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	<1	---	---
Sodium	ppm	ASTM D5185m	<0.1	2	---	---
Potassium	ppm	ASTM D5185m	<0.1	<1	---	---
Water	%	ASTM D6304	<0.05	0.007	---	---
ppm Water	ppm	ASTM D6304	<500	79.9	---	---





HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0	---	---
Nickel	ppm	ASTM D5185m	<0.1	0	---	---
Lead	ppm	ASTM D5185m	<0.1	0	---	---
Vanadium	ppm	ASTM D5185m	<0.1	0	---	---
Iron	ppm	ASTM D5185m	<0.1	0	---	---
Calcium	ppm	ASTM D5185m	<0.1	0	---	---
Magnesium	ppm	ASTM D5185m	<0.1	<1	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	0	---	---
Zinc	ppm	ASTM D5185m	<0.1	0	---	---

SAMPLE IMAGES

		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image

FUEL REPORT

GRAPHS

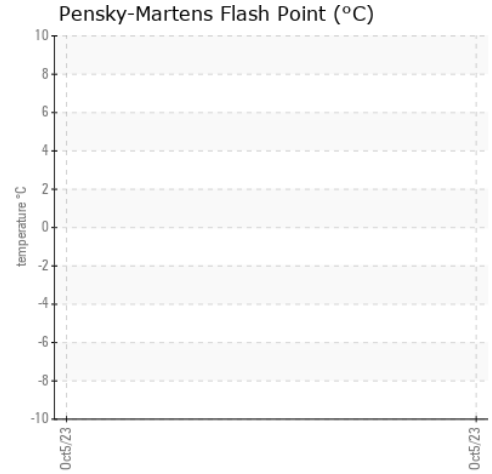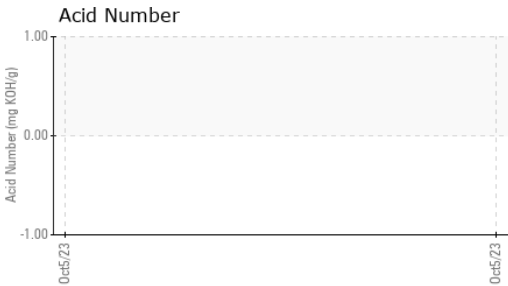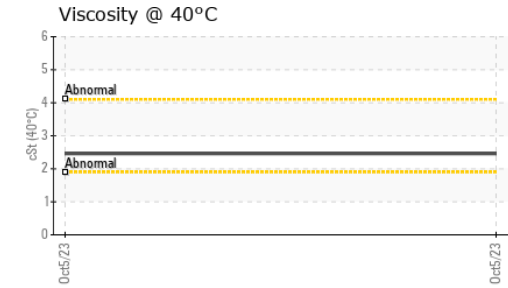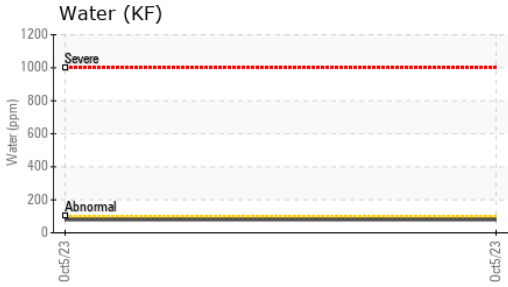

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VCP441968 **Received** : 18 Oct 2023
Lab Number : **05982682** **Diagnosed** : 24 Oct 2023
Unique Number : 10699977 **Diagnostician** : Jonathan Hester
Test Package : MOB 1 (Additional Tests: Bacteria, KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HOFFMAN EQUIPMENT INC
 300 S RANDOLPHVILLE RD
 PISCATAWAY, NJ
 US 08854

Contact: IOANA BODOCHI
 ioana.bodochi@hoffmanequip.com

T: (732)968-8371
 F: (732)968-8371