

OIL ANALYSIS REPORT

CONSTRUCTORS, INC **KOMATSU-CUMMINS DIESEL 111031**

Left Final Drive

MOBIL MOBILTRANS AST 30 (--- GAL)

Sample Rating Trend



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The condition of the oil is acceptable for the time in service.

				Oct2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		SBP0004919		
Sample Date		Client Info		26 Oct 2023		
Machine Age	hrs	Client Info		5227		
Oil Age	hrs	Client Info		1008		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	254		
Chromium	ppm	ASTM D5185m	>10	3		
Nickel	ppm	ASTM D5185m	>10	2		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		37		
Barium	ppm	ASTM D5185m		20		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		3		
Magnesium	ppm	ASTM D5185m		26		
Calcium	ppm	ASTM D5185m		2962		
Phosphorus	ppm	ASTM D5185m		1021		
Zinc	ppm	ASTM D5185m		1255		
Sulfur	ppm	ASTM D5185m		7077		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	22		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
					,	, , , , , , , , , , , , , , , , , , , ,

Visc @ 40°C





OIL ANALYSIS REPORT

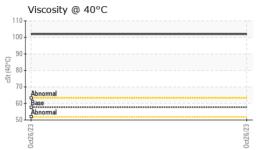




GRAPHS

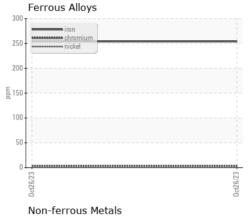

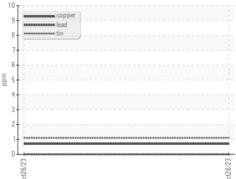

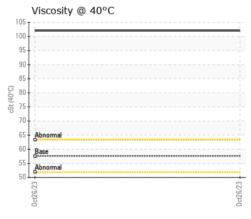



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10722225

: SBP0004919 : 05993865 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 30 Oct 2023 Diagnosed : 01 Nov 2023

Diagnostician : Sean Felton

Contact: Jack Linhart jackl@constructorslincoln.com

Constructors Inc. - 603659

T: (402)434-2157

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) 1815 Y Street

Lincoln, NE

US 68508