




PROBLEM SUMMARY

Area
PRESS
Machine Id
PRESS PILOT


Component
Tank Hydraulic System
Fluid
CHEVRON RANDO HD 46 (22000 GAL)

Sample Rating Trend

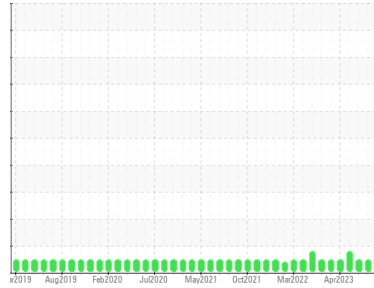

COMPONENT CONDITION SUMMARY

▲ Particle Trend

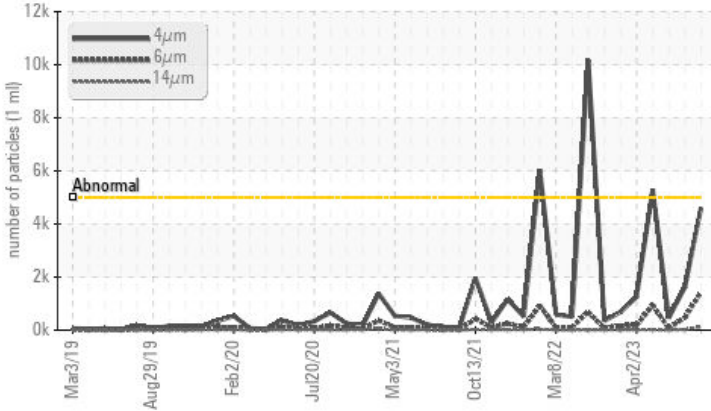

RECOMMENDATION

No corrective action is recommended at this time.
Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ATTENTION	NORMAL	NORMAL
Particles >6µm	ASTM D7647 >1300	▲ 1420	479	69
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 19/18/14	18/16/11	16/13/10

Customer Id: ALLMONSAF
Sample No.: WC0854964
Lab Number: 05994295
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

20 Sep 2023 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



13 Sep 2023 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



21 Jun 2023 Diag: Jonathan Hester

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

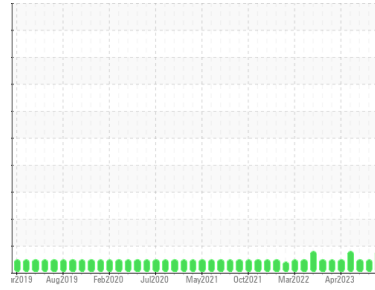

ISO



Area
PRESS
Machine Id
PRESS PILOT

Component
Tank Hydraulic System
Fluid
CHEVRON RANDO HD 46 (22000 GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0854964	WC0829295	WC0826331
Sample Date	Client Info		25 Oct 2023	20 Sep 2023	13 Sep 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ATTENTION	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	2	2	3
Chromium	ppm	ASTM D5185m >20	<1	0	<1
Nickel	ppm	ASTM D5185m >20	<1	0	0
Titanium	ppm	ASTM D5185m	<1	0	<1
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >20	<1	0	<1
Lead	ppm	ASTM D5185m >20	0	0	0
Copper	ppm	ASTM D5185m >20	2	2	4
Tin	ppm	ASTM D5185m >20	1	0	1
Vanadium	ppm	ASTM D5185m	0	0	<1
Cadmium	ppm	ASTM D5185m	0	0	<1

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m	19	0	0
Molybdenum	ppm	ASTM D5185m	<1	<1	<1
Manganese	ppm	ASTM D5185m	<1	0	<1
Magnesium	ppm	ASTM D5185m	0	<1	<1
Calcium	ppm	ASTM D5185m	28	29	29
Phosphorus	ppm	ASTM D5185m	338	309	345
Zinc	ppm	ASTM D5185m	340	341	367
Sulfur	ppm	ASTM D5185m	1005	785	1043

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	0	0	<1
Sodium	ppm	ASTM D5185m	3	0	1
Potassium	ppm	ASTM D5185m >20	0	<1	2

FLUID CLEANLINESS


	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	4606	1616	459
Particles >6µm	ASTM D7647	>1300	▲ 1420	479	69
Particles >14µm	ASTM D7647	>160	115	19	7
Particles >21µm	ASTM D7647	>40	32	4	1
Particles >38µm	ASTM D7647	>10	1	0	0
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 19/18/14	18/16/11	16/13/10

FLUID DEGRADATION


	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.34	0.33	0.32

OIL ANALYSIS REPORT


▲ Particle Trend

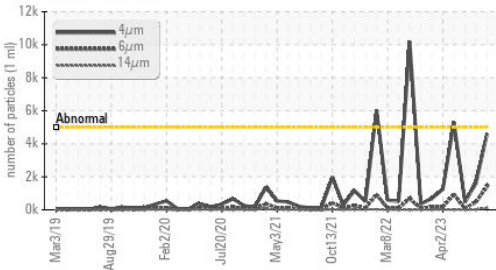


▲ Particle Trend

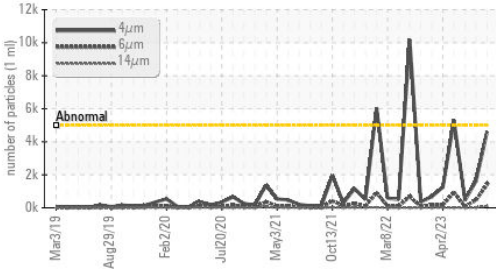

Acid Number

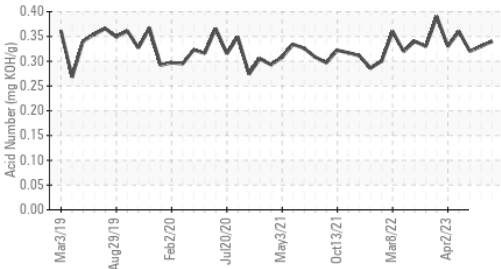


Viscosity @ 40°C

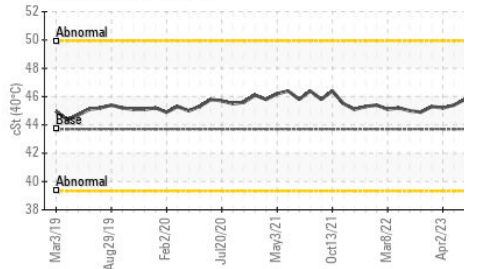






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	43.7	45.1	45.2

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

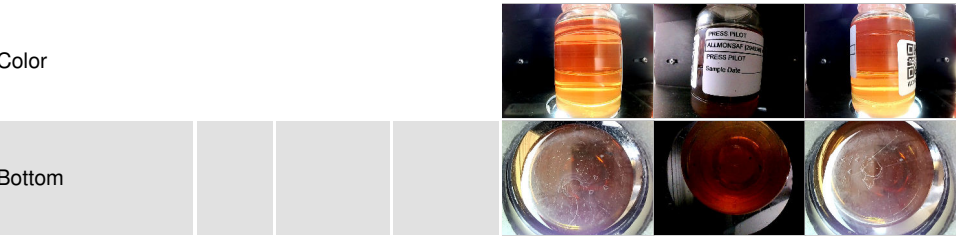

GRAPHS

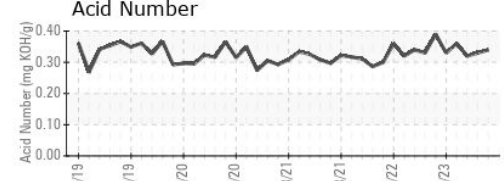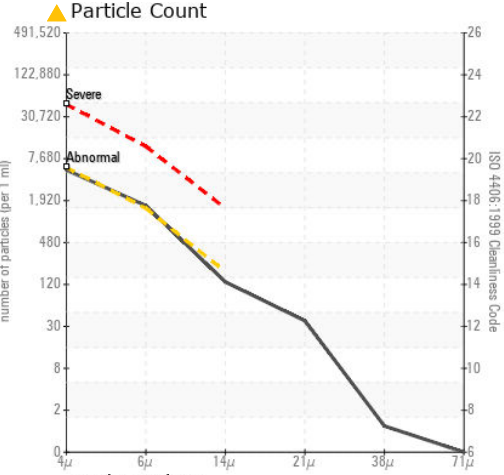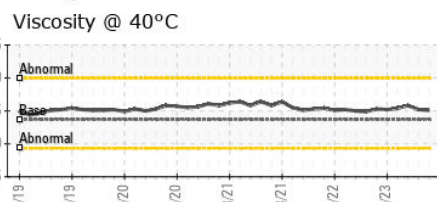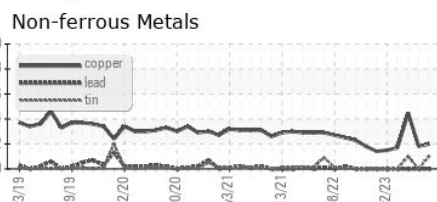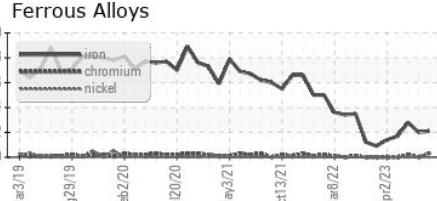

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0854964 **Received** : 31 Oct 2023
Lab Number : 05994295 **Diagnosed** : 01 Nov 2023
Unique Number : 10722655 **Diagnostician** : Don Baldrige
Test Package : IND 2

ALLVAC SAF CONDITIONING
 3750 ALLOY WAY
 MONROE, NC
 US 28110
 Contact: MIKE TODD
 mike.todd@atimetals.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: