


# **OIL ANALYSIS REPORT**

Sample Rating Trend



NORMAL

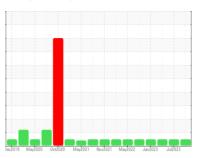

# LIM4\_U46 LIM4\_U46\_M46

Lube System

**ROYAL PURPLE SYNFILM GT 32 (20 GAL)** 

### DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil.

# Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Ju-2019 May2020 Oct2020 May2021 May2021 May2022 Jan2023 Ju2023						
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0029414	RP0021255	RP0029443
Sample Date		Client Info		24 Oct 2023	18 Jul 2023	18 May 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	<1	<1
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	0	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	<1	<1
Lead	ppm	ASTM D5185m	>20	12	9	8
Copper	ppm	ASTM D5185m	>20	11	10	9
Tin	ppm	ASTM D5185m	>20	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		40	51	44
Calcium	ppm	ASTM D5185m		0	1	0
Phosphorus	ppm	ASTM D5185m		0	2	5
Zinc	ppm	ASTM D5185m		<1	0	0
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	2
Sodium	ppm	ASTM D5185m		2	1	2
Potassium	ppm	ASTM D5185m	>20	1	0	2
Water	%	ASTM D6304	>0.05	0.018	0.016	0.012
ppm Water	ppm	ASTM D6304	>500	185.8	163.9	128.0
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.34	0.35	0.28
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.05	NEG	NEG	NEG
		43.41		11=6	MIDDELLAND	CDIVALEENIEL


scalar \*Visual

NDREW WYDERKALENELIM

**NEG** 



# **OIL ANALYSIS REPORT**

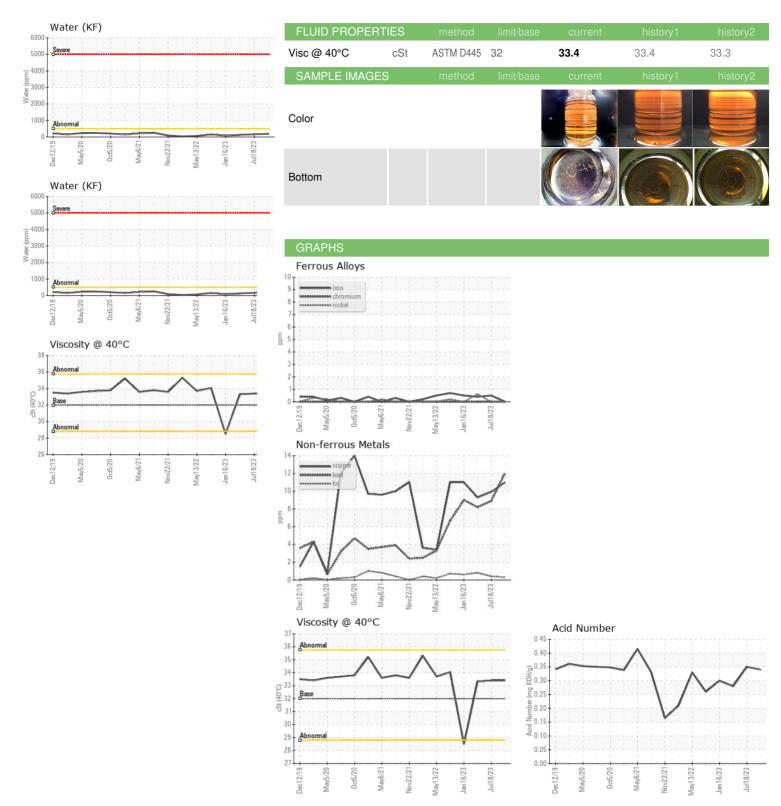





Laboratory Sample No. Lab Number **Unique Number** Test Package : PLANT

: 05995061 : 10723421

: RP0029414

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 31 Oct 2023 : 02 Nov 2023 Diagnosed Diagnostician : Don Baldridge

**ENERGY TRANSFER - LIMA** 1520 BUCKEYE RD

LIMA, OH US 45804

Contact: ANDREW WYDERKA

andrew.wyderka@energytransfer.com T: (419)618-1505

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: