

# **OIL ANALYSIS REPORT**


## Sample Rating Trend





# COLORADO/443/EG - LOADER 45.41L [COLORADO^443^EG - LOADER] Component Rear Differential

**MOBIL MOBILFLUID 424 (--- GAL)** 

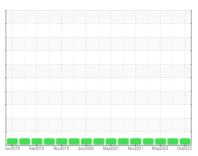



## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

## **Fluid Condition**


The condition of the oil is acceptable for the time in service.

24 ( GAL)		Jun2018 Fel	2019 Nov2019 Jun202	20 May2021 Nov2021 May2	022 Oct2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0859714	WC0718264	WC0672459
Sample Date		Client Info		27 Oct 2023	14 Nov 2022	09 May 2022
Machine Age	hrs	Client Info		7244	6738	6222
Oil Age	hrs	Client Info		0	516	0
Oil Changed		Client Info		Changed	Not Changd	Changed
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	79	38	47
Chromium	ppm	ASTM D5185m	>3	<1	<1	<1
Nickel	ppm	ASTM D5185m	>3	<1	0	0
Titanium	ppm	ASTM D5185m	>2	0	0	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>30	1	2	2
Lead	ppm	ASTM D5185m	>13	<1	<1	<1
Copper	ppm	ASTM D5185m	>103	2	<1	<1
Tin	ppm	ASTM D5185m	>5	<1	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		122	108	117
Barium	ppm	ASTM D5185m		0	2	0
Molybdenum	ppm	ASTM D5185m		7	4	3
Manganese	ppm	ASTM D5185m		1	<1	1
Magnesium	ppm	ASTM D5185m		15	16	22
Calcium	ppm	ASTM D5185m		3596	3659	3866
Phosphorus	ppm	ASTM D5185m		1152	1158	1265
Zinc	ppm	ASTM D5185m		1577	1458	1573
Sulfur	ppm	ASTM D5185m		5339	5030	4773
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>100	15	11	16
Sodium	ppm	ASTM D5185m		7	4	7
Potassium	ppm	ASTM D5185m	>20	0	2	2
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	MODER	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
	_					

cSt





## **OIL ANALYSIS REPORT**

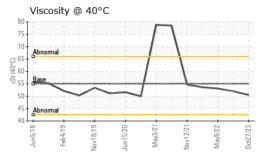


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

## **GRAPHS**

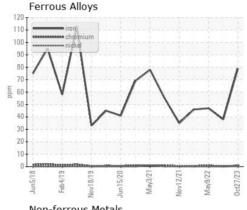

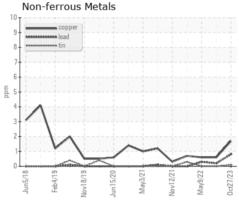

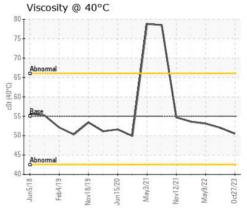





Laboratory Sample No. Lab Number Unique Number : 10723495 Test Package : CONST

: WC0859714 : 05995135

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 31 Oct 2023 Diagnosed : 02 Nov 2023

Diagnostician : Sean Felton

SHERWOOD CONSTRUCTION CO INC

3219 WEST MAY ST WICHITA, KS US 67213 Contact: DOUG KING

doug.king@sherwood.net T: (316)617-3161

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: