


OIL ANALYSIS REPORT

MISSION BELL [9264]

GEA COMP 8 - MISSION BELL (S/N R0567)

Refrigeration Compressor

APCCO ISO 68 (--- GAL)

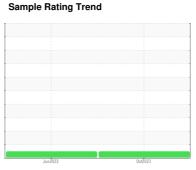



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

OAMBLE INFORM	ATION		12 24 //		111	1.1.1
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0851636	WC0653509	
Sample Date		Client Info		25 Oct 2023	20 Jun 2022	
Machine Age	hrs	Client Info		10110	6646	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		Filtered	Not Changd	
Sample Status				NORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	11	5	
Chromium	ppm	ASTM D5185m	>2	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>3	0	<1	
Lead	ppm	ASTM D5185m	>2	0	<1	
Copper	ppm	ASTM D5185m	>8	<1	<1	
Tin	ppm	ASTM D5185m	>4	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	2	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	0	
Magnesium	ppm	ASTM D5185m		0	0	
Calcium	ppm	ASTM D5185m		0	0	
Phosphorus	ppm	ASTM D5185m		0	4	
Zinc	ppm	ASTM D5185m		0	0	
Sulfur	ppm	ASTM D5185m		82	191	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1	<1	
Sodium	ppm	ASTM D5185m		<1	0	
Potassium	ppm	ASTM D5185m	>20	<1	0	
Water	%	ASTM D6304	>0.01	0.00	0.003	
ppm Water	ppm	ASTM D6304	>100	0.00	33.0	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


Acid Number (AN) mg KOH/g ASTM D974

0.014

0.014



OIL ANALYSIS REPORT

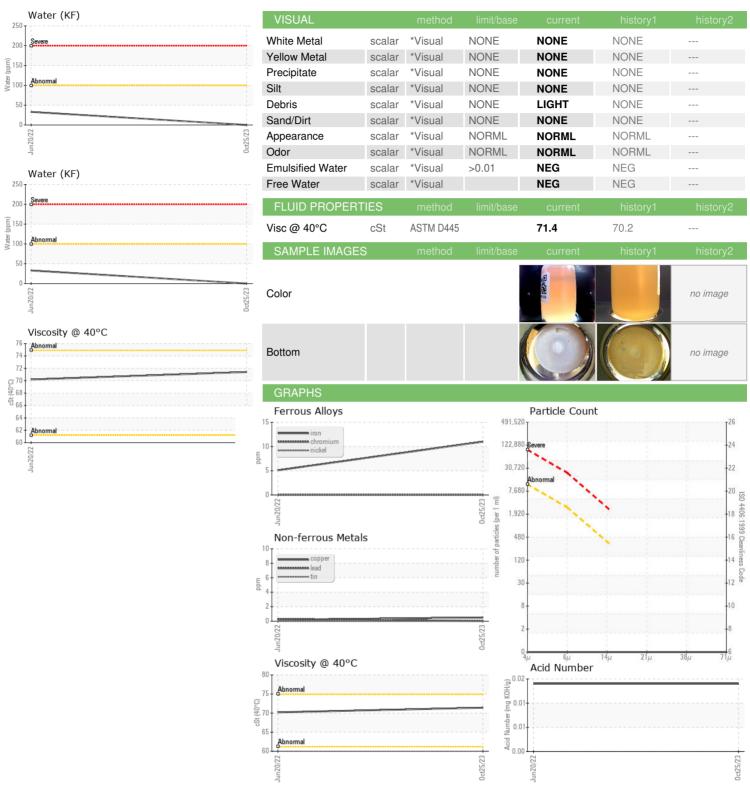





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

Test Package : PLANT

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0851636 : 01 Nov 2023 Received : 05995671 Diagnosed : 03 Nov 2023 : 10724031 Diagnostician

: Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

SCHRADER MECHANICAL

1015 BLACK DIAMOND WAY LODI PROVINCE, CA

US 95240 Contact: Schrader Mechanical

amanda.h@smiwest.com

T: (209)369-6888 F: x: