


OIL ANALYSIS REPORT

CHEMLUBE 630 [1669889] Machine Id L6-ML-BMA-DOS-VACP - PFNONWOVENS

Component

Pump

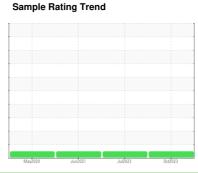



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Insufficient sample was received to conduct all the routine laboratory tests. There is no indication of any contamination in the oil.


Fluid Condition


The condition of the oil is acceptable for the time in service.

		May202	0 Jun2021	Jul2022 0	ct2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05997459	UCH05676310	UCH05282701
Sample Date		Client Info		13 Oct 2023	27 Jul 2022	09 Jun 2021
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	8	6	7
Chromium	ppm	ASTM D5185m	>5	<1	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m	>3	0	0	<1
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>7	<1	0	0
Lead	ppm	ASTM D5185m	>12	0	0	0
Copper	ppm	ASTM D5185m		6	4	4
Tin	ppm	ASTM D5185m	>9	0	0	0
Antimony	ppm	ASTM D5185m	75			0
Vanadium		ASTM D5185m		0	0	0
	ppm	ASTM D5185m		0	0	0
Cadmium	ppm					-
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	4.1	4	4	6
Barium	ppm	ASTM D5185m	0.1	2	0	1
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0.7	0	<1	<1
Magnesium	ppm	ASTM D5185m	0	<1	<1	<1
Calcium	ppm	ASTM D5185m	0	2	0	1
Phosphorus	ppm	ASTM D5185m	1600	1059	1219	1136
Zinc	ppm	ASTM D5185m	0	5	2	0
Sulfur	ppm	ASTM D5185m	354	6510	6539	5818
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	4	5	6
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	4	3	1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.102		0.34	0.330
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	N HWINGARTER	
	Journ					0==0





OIL ANALYSIS REPORT

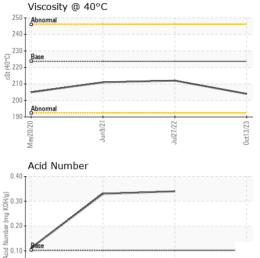


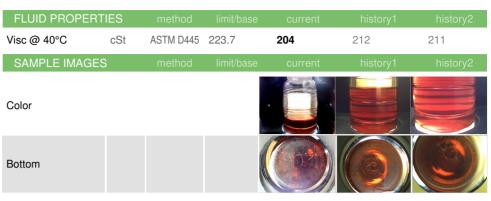



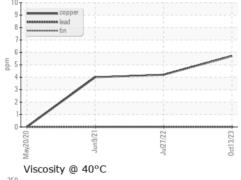

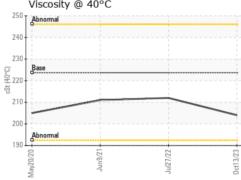

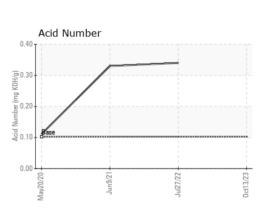





Certificate L2367

Laboratory Sample No. Lab Number Test Package : IND 2

: 05997459 Unique Number : 10725819

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH05997459 Received

: 02 Nov 2023 : 07 Nov 2023 Diagnosed Diagnostician : Jonathan Hester **CORROSION PRODUCTS & EQUIPMENT**

940 POINTVIEW AVE EPHRATA, PA

US 17522 Contact: RYAN HUNGARTER

rhungarter@corrosion-products.com T: (717)961-1998

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: