




PROBLEM SUMMARY

Sample Rating Trend

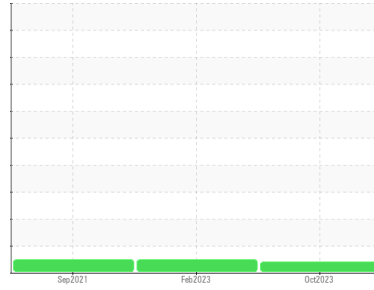

VIS DEBRIS



Area
INTERSTITIAL - PUMP ROOM
 Machine Id
B64247 - 5B (S/N 083012-1015943-001-24146-000)
 Component
Hydraulic Power Pack
 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	NORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE

Customer Id: HORMCC
 Sample No.: WC0850234
 Lab Number: 05997921
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

26 Feb 2023 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



01 Sep 2021 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. Viscosity of sample indicates oil is within ISO 46 range, advise investigate. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

Area
INTERSTITIAL - PUMP ROOM
 Machine Id
B64247 - 5B (S/N 083012-1015943-001-24146-000)
 Component
Hydraulic Power Pack
 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

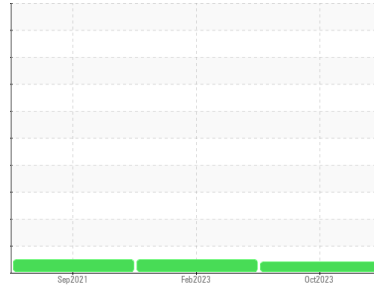

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0850234	WC0781554	WC0603981
Sample Date	Client Info		17 Oct 2023	26 Feb 2023	01 Sep 2021
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	0	3	5
Chromium	ppm	ASTM D5185m >20	0	0	0
Nickel	ppm	ASTM D5185m >20	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >20	0	0	4
Lead	ppm	ASTM D5185m >20	<1	0	0
Copper	ppm	ASTM D5185m >20	0	0	<1
Tin	ppm	ASTM D5185m >20	0	0	0
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 5	0	0	1
Barium	ppm	ASTM D5185m 5	0	0	0
Molybdenum	ppm	ASTM D5185m 5	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m 25	<1	0	<1
Calcium	ppm	ASTM D5185m 200	99	54	83
Phosphorus	ppm	ASTM D5185m 300	458	411	497
Zinc	ppm	ASTM D5185m 370	511	255	473
Sulfur	ppm	ASTM D5185m 2500	4752	2923	3949

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	1	2	1
Sodium	ppm	ASTM D5185m	<1	2	1
Potassium	ppm	ASTM D5185m >20	0	0	0

FLUID CLEANLINESS



	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	---	1715	1382
Particles >6µm	ASTM D7647	>1300	---	428	322
Particles >14µm	ASTM D7647	>160	---	31	25
Particles >21µm	ASTM D7647	>40	---	5	4
Particles >38µm	ASTM D7647	>10	---	0	0
Particles >71µm	ASTM D7647	>3	---	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	---	18/16/12	18/16/12

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.57	0.74	0.48	0.527




OIL ANALYSIS REPORT

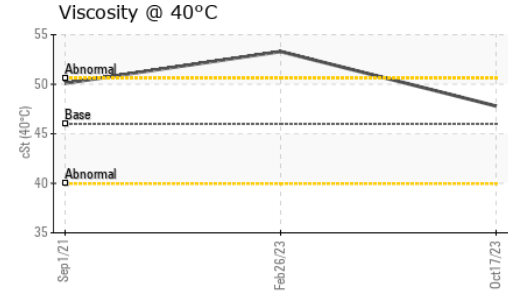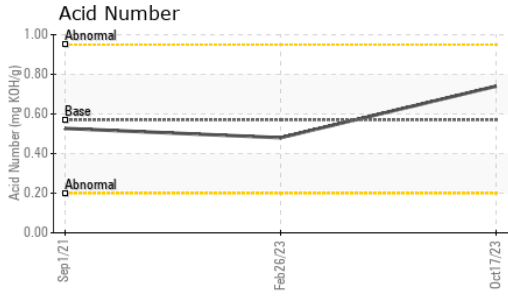





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	▲ MODER	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	47.8	53.3	50.1

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

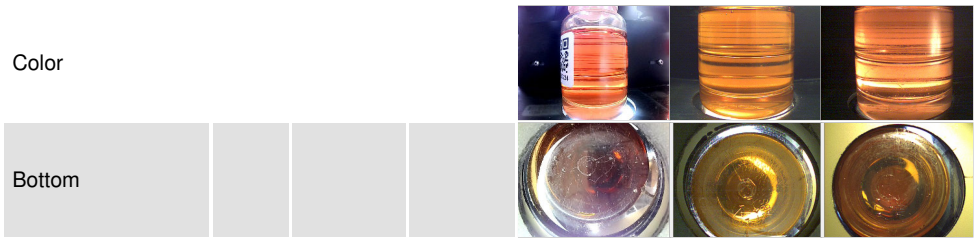

GRAPHS

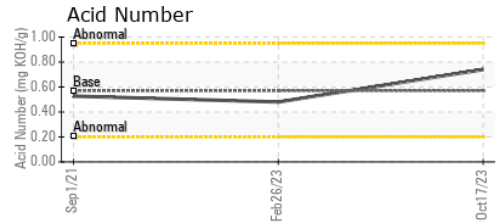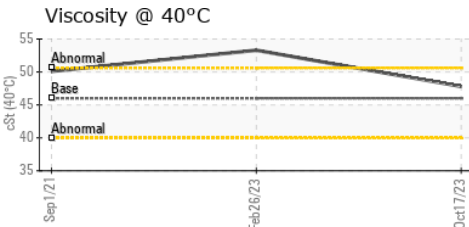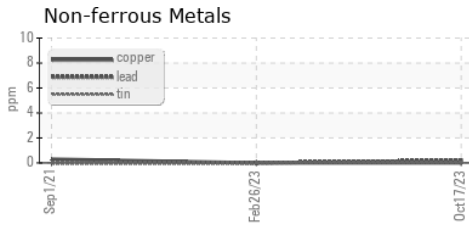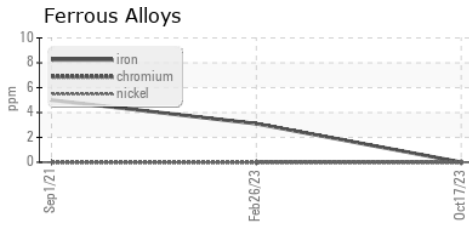

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0850234 **Received** : 03 Nov 2023
Lab Number : 05997921 **Diagnosed** : 06 Nov 2023
Unique Number : 10726281 **Diagnostician** : Don Baldrige
Test Package : IND 2

HORMEL - FONTANINI FOODS
 8751 W 50TH ST
 MCCOOK, IL
 US 60525
 Contact: PARTH AKOLIYA
 PBAKOLIYA@HORMAL.COM
 T: (708)485-4800
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)