



PROBLEM SUMMARY

Sample Rating Trend



ISO




Machine Id
4AE5 4AE5

Component
Hydraulic System

Fluid
MOBIL DTE OIL EXTRA HEAVY (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

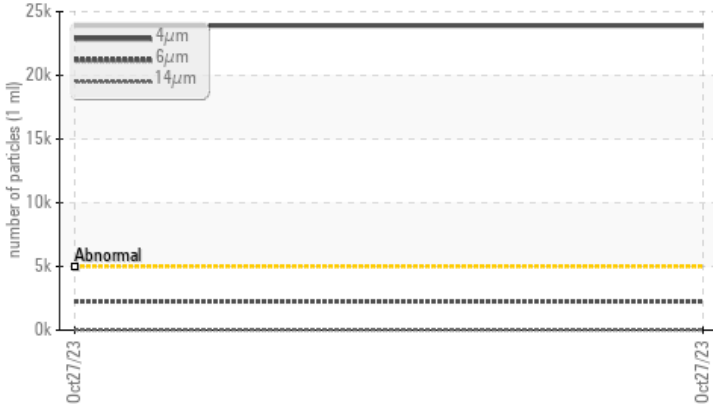

RECOMMENDATION

No corrective action is recommended at this time.
Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	---	---
Particles >4µm	ASTM D7647	>5000	▲ 23899	---	---
Particles >6µm	ASTM D7647	>1300	▲ 2260	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 22/18/12	---	---

Customer Id: TESAUSTLC
Sample No.: TLC0001300
Lab Number: 05998170
Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT


Particle Trend




PQ

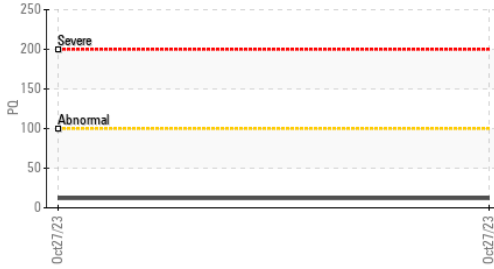


Acid Number

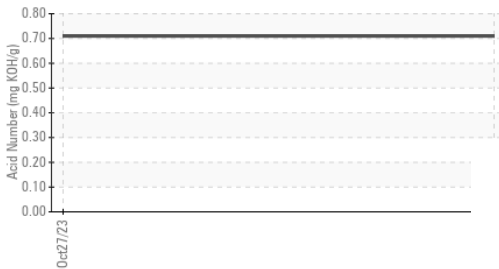

Viscosity @ 40°C

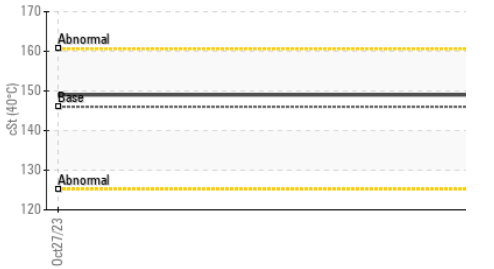

PQ

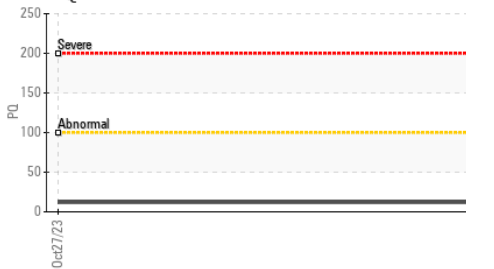


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 146	149	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

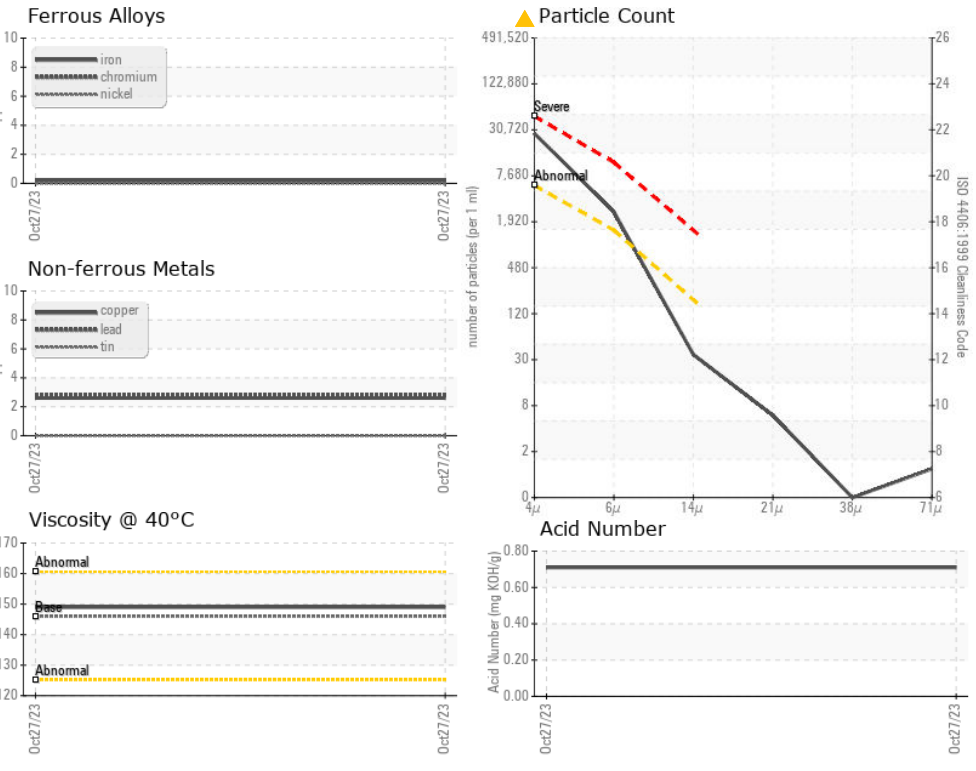

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
 Sample No. : TLC0001300 Received : 03 Nov 2023
 Lab Number : 05998170 Diagnosed : 08 Nov 2023
 Unique Number : 10726530 Diagnostician : Jonathan Hester
 Test Package : PLANT

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

TESLA
 1 Tesla Road, BIW E58
 Austin, TX
 US 78725
 Contact: Dave Mitchell
 davmitchell@tesla.com
 T: (260)226-1968
 F: