

PROBLEM SUMMARY

ADV

Sample Rating Trend




Separation
Machine Id
2401-B

Component **Agitator Gearbox**

MOBIL MOBILGEAR 600 XP ISO 150 (--- GAL)

COMPONENT CONDITION SUMMARY

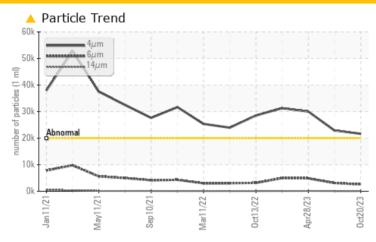

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC T	EST RESULTS				
Sample Status			ATTENTION	ATTENTION	ATTENTION
Particles >4µm	ASTM D7647	>20000	<u> </u>	<u>22871</u>	▲ 30003
Oil Cleanliness	ISO 4406 (c)	>21/19/16	22/19/13	<u>^</u> 22/19/13	22/19/14

Customer Id: AJIRAL Sample No.: WC0845099 Lab Number: 05998427 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

14 Jul 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



28 Apr 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



03 Feb 2023 Diag: Doug Bogart

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

Area
Separation 2401-B

Agitator Gearbox

MOBIL MOBILGEAR 600 XP ISO 150 (--- GAL)

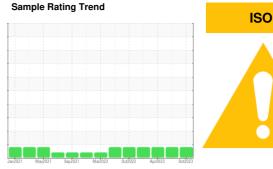

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 6 microns in size) present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

AL)		Jan 2021	May2021 Sep2021	Mar2022 Oct2022 Apr2023	Oct2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0845099	WC0810787	WC0784170
Sample Date		Client Info		20 Oct 2023	14 Jul 2023	28 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>150	0	1	<1
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	0	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>50	0	0	0
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		15	20	18
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		0	0	<1
Calcium	ppm	ASTM D5185m		0	<1	0
Phosphorus	ppm	ASTM D5185m		285	350	308
Zinc	ppm	ASTM D5185m		4	3	6
Sulfur	ppm	ASTM D5185m		14614	20774	18641
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	0	<1	<1
Sodium	ppm	ASTM D5185m		<1	0	0
Potassium	ppm	ASTM D5185m	>20	0	1	2
Water	%	ASTM D6304	>0.1	0.010	0.007	0.007
ppm Water	ppm	ASTM D6304	>1000	105.0	71.3	77.9
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>20000	21656	<u>22871</u>	▲ 30003
Particles >6μm		ASTM D7647	>5000	2572	3104	4858
Particles >14μm		ASTM D7647	>640	65	58	129
Particles >21µm		ASTM D7647	>160	15	9	28
Particles >38μm		ASTM D7647	>40	1	1	2
Particles >71µm		ASTM D7647	>10	0	0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16	22/19/13	<u>^</u> 22/19/13	<u>22/19/14</u>
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.76	0.77	0.74



OIL ANALYSIS REPORT

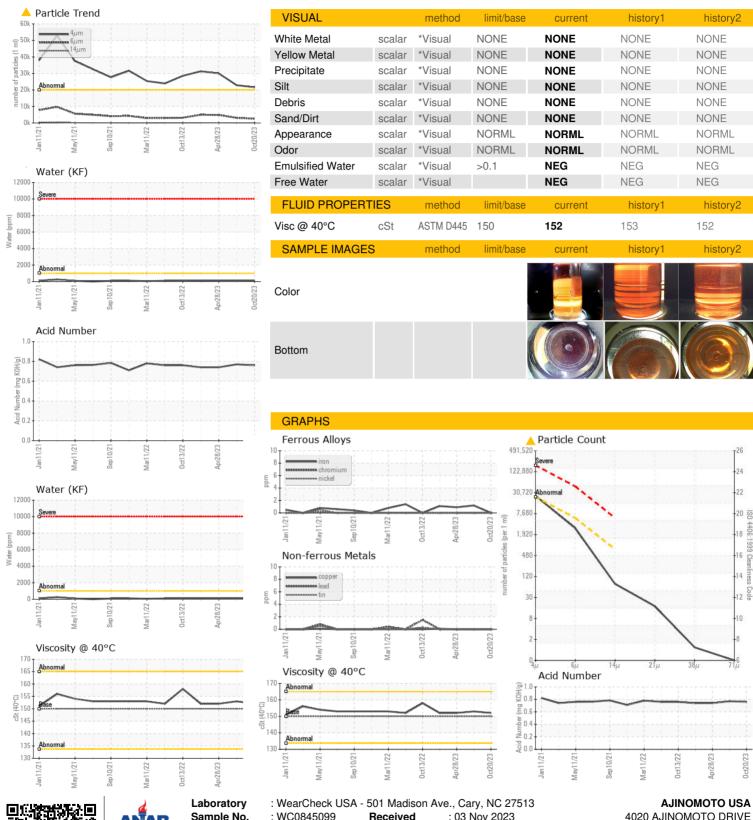





Certificate L2367

Sample No. Lab Number **Unique Number**

: WC0845099 : 05998427

: 10726787 Test Package : PLANT

: 03 Nov 2023 Received Diagnosed

: 07 Nov 2023 Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) 4020 AJINOMOTO DRIVE RALEIGH, NC

US 27610 Contact: Michael Thompson thompsonm@ajiusa.com

T: (919)723-2142

F: