


OIL ANALYSIS REPORT

Area CHEMLUBE 629 [1672939]

L7-SLIT-REW-CDRM - PFNONWOVENS

Component

Slave Gearbox

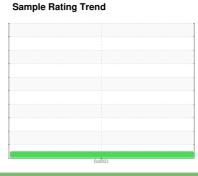



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				0ct2023		
SAMPLE INFORM	/ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05998497		
Sample Date		Client Info		03 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed	0	Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	184		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	0		
				-		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		-		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	3.1	33		
Barium	ppm	ASTM D5185m		5		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.7	1		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	8		
Phosphorus	ppm	ASTM D5185m	1642	279		
Zinc	ppm	ASTM D5185m	0	49		
Sulfur	ppm	ASTM D5185m	377	12818		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.154	1.13		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	MODER		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual	~U.L	NEG		
1 100 Water	Juanan	Visual		ITLU		



OIL ANALYSIS REPORT

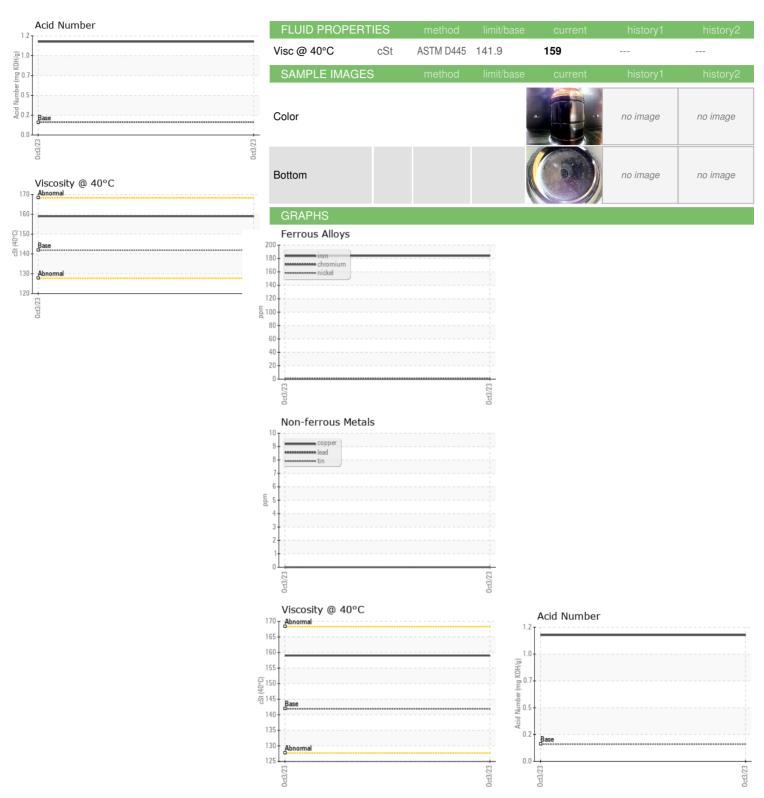





Certificate L2367

Laboratory Sample No. Lab Number

Unique Number : 10726857 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH05998497 : 05998497

Received : 03 Nov 2023 Diagnosed Diagnostician : Wes Davis

: 06 Nov 2023

To discuss this sample report, contact Customer Service at 1-800-237-1369.

US 17522 Contact: RYAN HUNGARTER rhungarter@corrosion-products.com T: (717)961-1998

Contact/Location: RYAN HUNGARTER - UCPROWES

CORROSION PRODUCTS & EQUIPMENT

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F:

EPHRATA, PA

940 POINTVIEW AVE