

FUEL REPORT

[3096784] Machine Id 60.ODGBC E050728206

Component
Diesel Fuel

NOT GIVEN (--- GAL)

Sample Rating Trend



				Oct2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		DC0031448		
Sample Date		Client Info		25 Oct 2023		
Machine Age	hrs	Client Info		0		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L3.0		
Visc @ 40°C	cSt	ASTM D445		2.46		
SULFUR CONTER	٧T	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		7		
Sulfur (UVF)	ppm	ASTM D5453		8		
IGNITION QUALIT	Υ	method	limit/base	current	history1	history2
API Gravity		ASTM D7777		36.9		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	<1		
Potassium	ppm	ASTM D5185m	< 0.1	<1		
Water	%	ASTM D6304	< 0.05	0.003		
ppm Water	ppm	ASTM D6304	< 500	31.9		
% Gasoline	%	*In-House	< 0.50	0.0		
% Biodiesel	%	*In-House	<20.0	0.0		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	< 0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	< 0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	0		
Magnesium	ppm	ASTM D5185m	< 0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	0		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	;	method	limit/base	current	history1	history2
Color				MAC MAZE	no image	no image

DIAGNOSIS

Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 ultra-low-sulfur diesel fuel.

Corrosion

All metal levels are normal indicating no corrosion in the system.

Contaminants

The water content is negligible. There is no bacteria or fungus (yeast and/or mold) indicated in the sample. There is no indication of any contamination in the fuel.

Fuel Condition

Sulfur value derived by ASTM D5453 method for ULSD validation. Sulfur level is acceptable for ULSD specification.


Bottom

no image

no image



FUEL REPORT

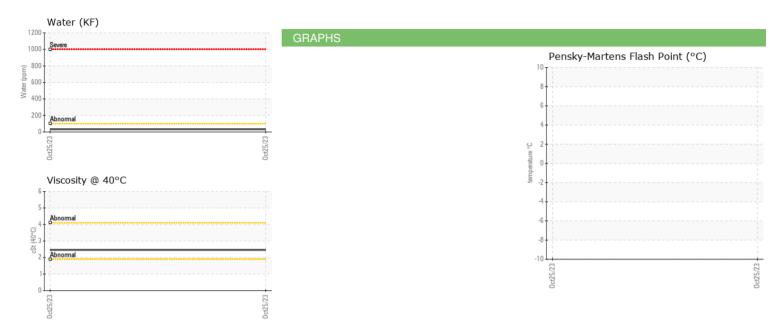



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10727859

: DC0031448 : 05999499

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received Diagnosed

: 06 Nov 2023 : 15 Nov 2023 Diagnostician : Doug Bogart

KELLY GENERATOR & EQUIPMENT INC 1955 DALE LN OWINGS, MD

US 20736 Contact: LESLIE SNURR LSNURR@KGE.COM T: (410)257-5225

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Test Package: DF-5 (Additional Tests: API, Cetane, Fuel, Screen)

F: (410)257-5227