




PROBLEM SUMMARY


Area
Recovery
 Machine Id
Alfa Laval FHG26BC01 Centrifuge
 Component
Gearbox
 Fluid
MOBIL MOBILGEAR 600 XP 320 (4 GAL)

Sample Rating Trend

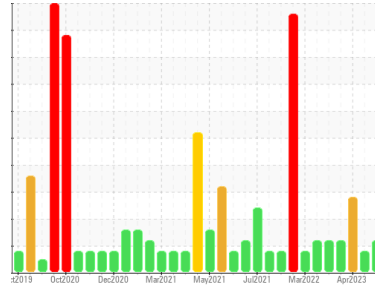

COMPONENT CONDITION SUMMARY

▲ Particle Trend

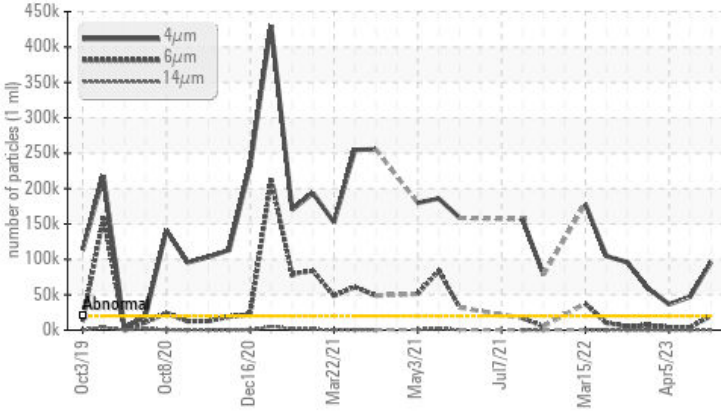

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	ATTENTION
Particles >4µm	ASTM D7647	>20000	▲ 96133	▲ 47027	▲ 36543
Particles >6µm	ASTM D7647	>5000	▲ 20627	3940	4036
Oil Cleanliness	ISO 4406 (c)	>21/19/16	▲ 24/22/16	▲ 23/19/14	▲ 22/19/12

Customer Id: NOVFRANC
 Sample No.: WC0847260
 Lab Number: 06000485
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

08 Aug 2023 Diag: Jonathan Hester

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



05 Apr 2023 Diag: Doug Bogart

VISCOSITY



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The oil viscosity is lower than typical, possibly indicating the addition of lighter grade oil. This plus the additive levels indicates the addition of a different brand, or type of oil. Confirm oil type. The AN level is acceptable for this fluid.

view report



04 Jan 2023 Diag: Jonathan Hester

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

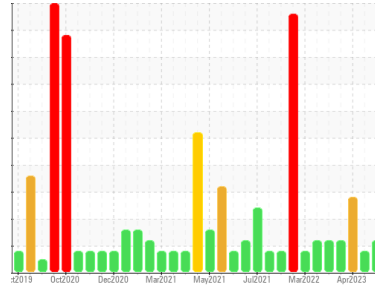

ISO



Area
Recovery
 Machine Id
Alfa Laval FHG26BC01 Centrifuge
 Component
Gearbox
 Fluid
MOBIL MOBILGEAR 600 XP 320 (4 GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0847260	WC0808209	WC0774927
Sample Date	Client Info		03 Nov 2023	08 Aug 2023	05 Apr 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	ABNORMAL	ATTENTION

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>200	2	5	1
Chromium	ppm	ASTM D5185m	>15	0	0	0
Nickel	ppm	ASTM D5185m	>15	1	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		<1	0	0
Aluminum	ppm	ASTM D5185m	>25	<1	2	1
Lead	ppm	ASTM D5185m	>100	<1	0	0
Copper	ppm	ASTM D5185m	>200	7	6	8
Tin	ppm	ASTM D5185m	>25	0	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		<1	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m		0	10	▲ 65
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	1	14
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		0	18	▲ 94
Calcium	ppm	ASTM D5185m		9	45	▲ 291
Phosphorus	ppm	ASTM D5185m		247	341	437
Zinc	ppm	ASTM D5185m		0	24	▲ 209
Sulfur	ppm	ASTM D5185m		13010	18214	14330

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m	>50	<1	<1	2
Sodium	ppm	ASTM D5185m		1	<1	2
Potassium	ppm	ASTM D5185m	>20	<1	0	0
Water	%	ASTM D6304	>0.2	0.074	0.007	0.013
ppm Water	ppm	ASTM D6304	>2000	742.0	76.5	130.9


FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>20000	▲ 96133	▲ 47027	▲ 36543
Particles >6µm	ASTM D7647	>5000	▲ 20627	3940	4036
Particles >14µm	ASTM D7647	>640	417	82	35
Particles >21µm	ASTM D7647	>160	55	19	4
Particles >38µm	ASTM D7647	>40	0	1	0
Particles >71µm	ASTM D7647	>10	0	0	0
Oil Cleanliness	ISO 4406 (c)	>21/19/16	▲ 24/22/16	▲ 23/19/14	▲ 22/19/12


FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045		0.73	0.52	0.73


Particle Trend

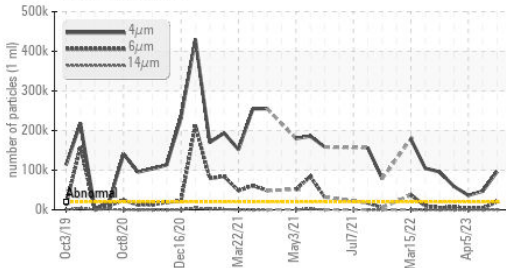


Water (KF)

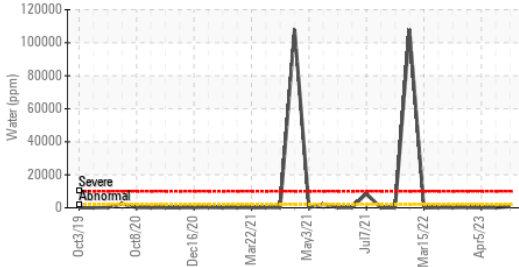


Acid Number

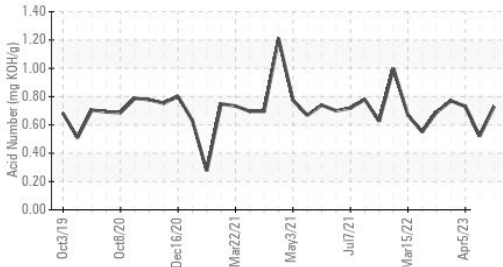

Water (KF)

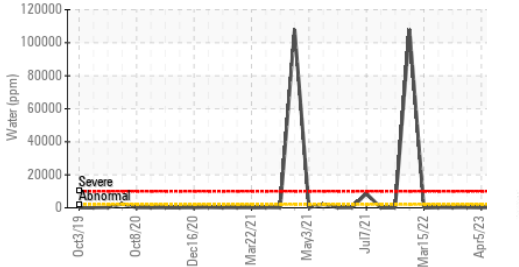


Viscosity @ 40°C

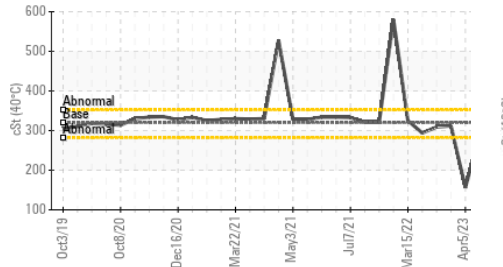

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	320	309	285 ▲ 156.4

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

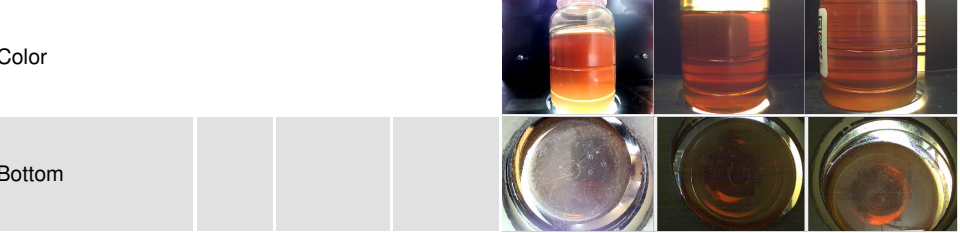


GRAPHS


Ferrous Alloys

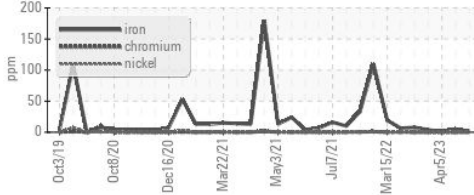


Non-ferrous Metals

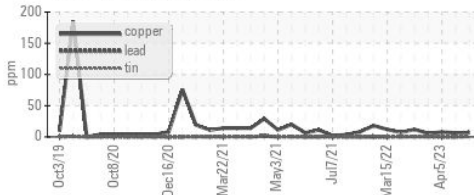


Viscosity @ 40°C

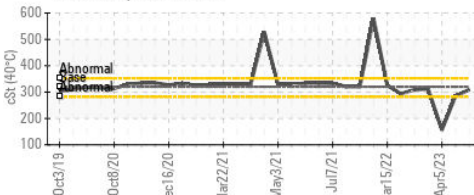

Particle Count

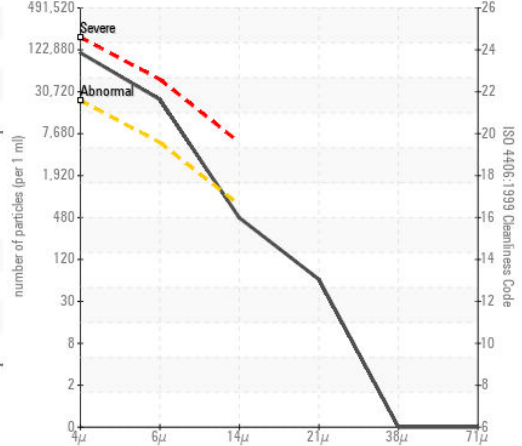

Acid Number

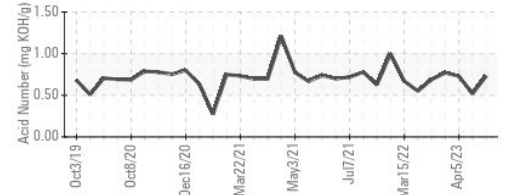

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0847260 **Received** : 07 Nov 2023
Lab Number : 06000485 **Diagnosed** : 09 Nov 2023
Unique Number : 10728845 **Diagnostician** : Don Baldrige

NOVOZYMES
 P.O. BOX 576, 77 PERRY CHAPEL CHURCH ROAD
 FRANKLINTON, NC
 US 27525
 Contact: BRUCE THOMAS
 brct@novozymes.com
 T: (919)494-3146
 F: (919)494-3456

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)