




# PROBLEM SUMMARY


Sample Rating Trend

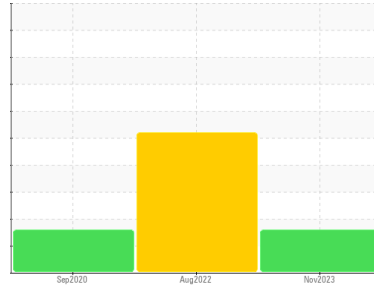

Machine Id  
**KAESER AS 30T 5584054 (S/N 1234)**  
 Component  
**Compressor**  
 Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## COMPONENT CONDITION SUMMARY

▲ Particle Trend

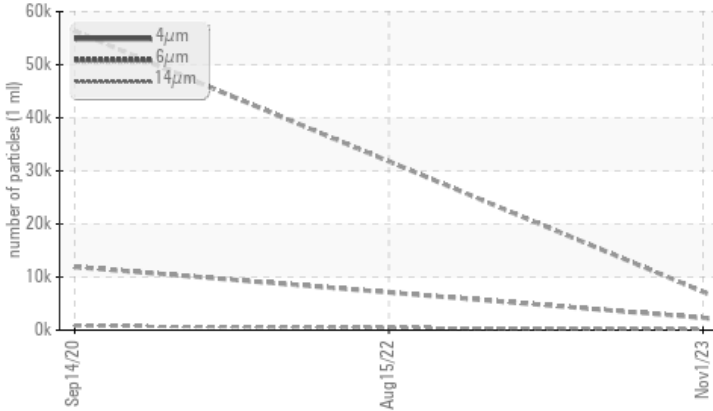

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status	ASTM D7647	Standard	ABNORMAL	ABNORMAL	ABNORMAL
Particles >6µm	ASTM D7647	>1300	▲ 2310	---	▲ 11900
Particles >14µm	ASTM D7647	>80	▲ 162	---	▲ 787
Particles >21µm	ASTM D7647	>20	▲ 36	---	▲ 183
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 20/18/15	---	▲ 21/17

Customer Id: DOLJAN  
 Sample No.: KCPA009764  
 Lab Number: 06001063  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

*There are no recommended actions for this sample.*

## HISTORICAL DIAGNOSIS

### WATER



#### 15 Aug 2022 Diag: Don Baldrige

Oil and filter change at the time of sampling has been noted. We recommend an early resample in 500 hours to monitor this condition. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. There is a moderate amount of visible silt present in the sample. There is a light concentration of water present in the oil. The AN level is acceptable for this fluid.

view report



### ISO



#### 14 Sep 2020 Diag: Jonathan Hester


Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



# OIL ANALYSIS REPORT

Sample Rating Trend

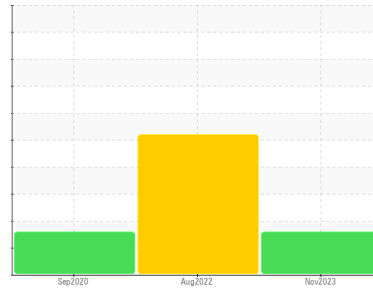

ISO



Machine Id  
**KAESER AS 30T 5584054 (S/N 1234)**

Component

**Compressor**

Fluid

**KAESER SIGMA (OEM) M-460 (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### ▲ Contamination

There is a high amount of particulates present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>KCPA009764</b>	KCP49678	KCP31586
Sample Date	Client Info		<b>01 Nov 2023</b>	15 Aug 2022	14 Sep 2020
Machine Age	hrs	Client Info	<b>8233</b>	6597	4593
Oil Age	hrs	Client Info	<b>0</b>	3000	4000
Oil Changed	Client Info		<b>N/A</b>	Changed	Changed
Sample Status			<b>ABNORMAL</b>	ABNORMAL	ABNORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>0</b>	<1	1
Chromium	ppm	ASTM D5185m >10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m >3	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m >3	<b>0</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m >10	<b>0</b>	0	0
Lead	ppm	ASTM D5185m >10	<b>0</b>	0	0
Copper	ppm	ASTM D5185m >50	<b>2</b>	14	23
Tin	ppm	ASTM D5185m >10	<b>0</b>	<1	0
Antimony	ppm	ASTM D5185m	<b>---</b>	---	0
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	<1	0
Barium	ppm	ASTM D5185m 90	<b>9</b>	0	<1
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	0	<1
Manganese	ppm	ASTM D5185m	<b>0</b>	<1	0
Magnesium	ppm	ASTM D5185m 100	<b>64</b>	20	10
Calcium	ppm	ASTM D5185m 0	<b>0</b>	0	4
Phosphorus	ppm	ASTM D5185m 0	<b>0</b>	<1	7
Zinc	ppm	ASTM D5185m 0	<b>11</b>	20	2
Sulfur	ppm	ASTM D5185m 23500	<b>18172</b>	19144	17646

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>0</b>	1	3
Sodium	ppm	ASTM D5185m	<b>20</b>	2	<1
Potassium	ppm	ASTM D5185m >20	<b>2</b>	0	0
Water	%	ASTM D6304 >0.05	<b>0.016</b>	▲ 0.218	0.010
ppm Water	ppm	ASTM D6304 >500	<b>161.6</b>	▲ 2180	100.8






## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		<b>7240</b>	---	56342
Particles >6µm	ASTM D7647	>1300	▲ <b>2310</b>	---	▲ 11900
Particles >14µm	ASTM D7647	>80	▲ <b>162</b>	---	▲ 787
Particles >21µm	ASTM D7647	>20	▲ <b>36</b>	---	▲ 183
Particles >38µm	ASTM D7647	>4	<b>2</b>	---	▲ 10
Particles >71µm	ASTM D7647	>3	<b>0</b>	---	1
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ <b>20/18/15</b>	---	▲ 21/17

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	<b>0.36</b>	0.31	0.301


# OIL ANALYSIS REPORT

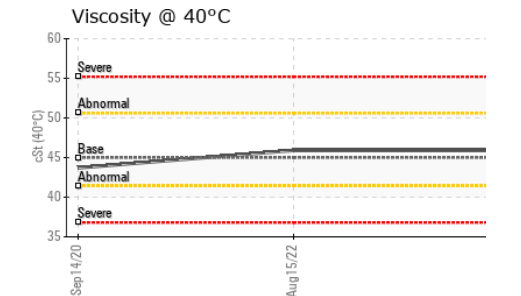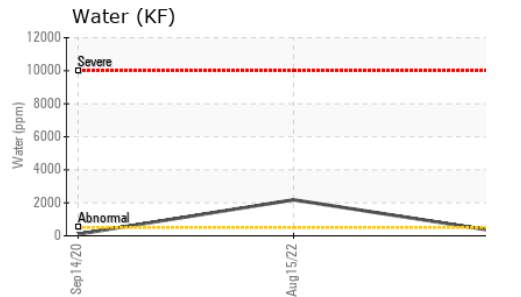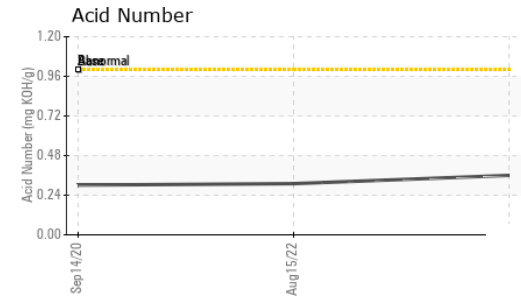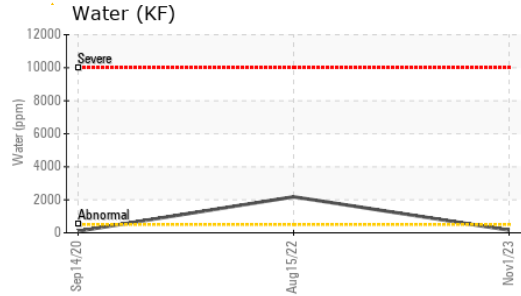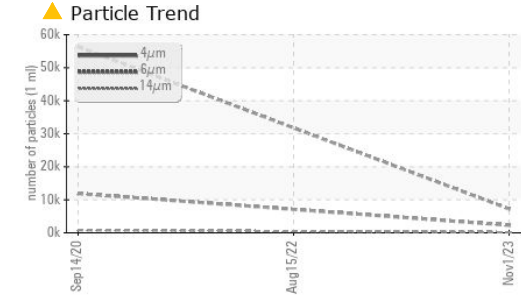






PARAMETER	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	▲ MODER	NONE
Debris	scalar	*Visual	NONE	▲ MODER	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	▲ HAZY	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	▲ 0.2%
Free Water	scalar	*Visual		NEG	▲ 1.0

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	45.9	43.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

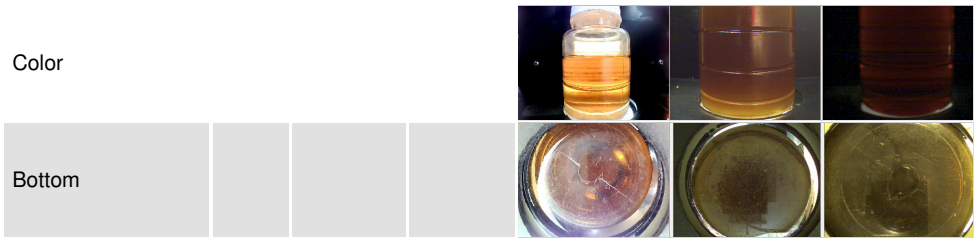

## GRAPHS

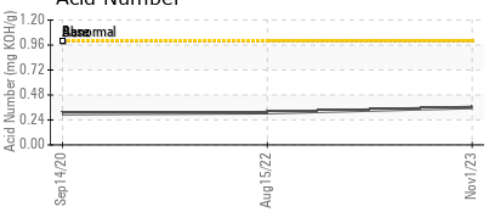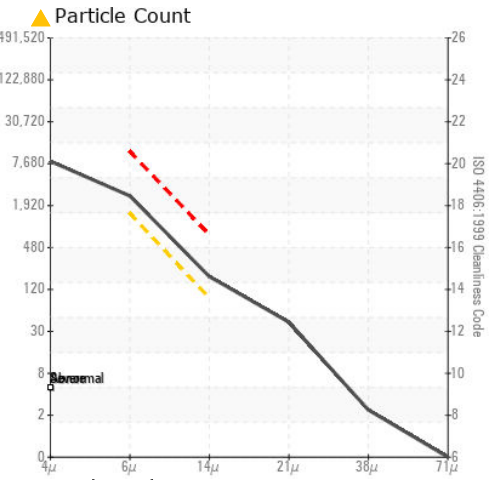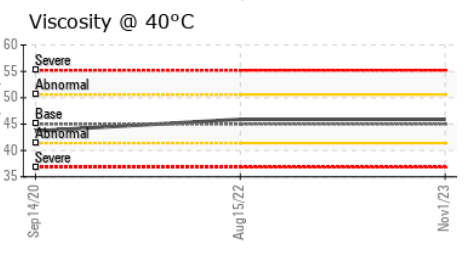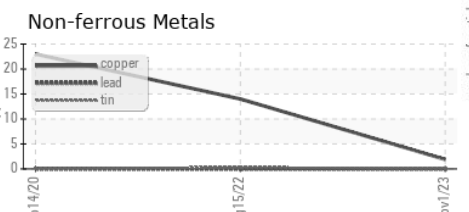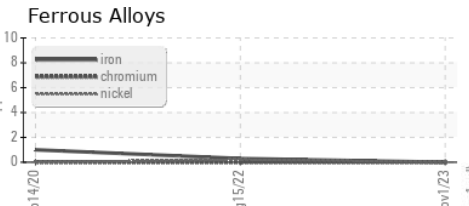

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KCPA009764 **Received** : 07 Nov 2023  
**Lab Number** : 06001063 **Diagnosed** : 09 Nov 2023  
**Unique Number** : 10729423 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**DOLLAR GENERAL**  
 101 INNOVATION DR  
 JANESVILLE, WI  
 US 53546  
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)