

PROBLEM SUMMARY

Sample Rating Trend

WATER

KAESER 8382387 (S/N 1988)

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

COMPONENT CONDITION SUMMARY



RECOMMENDATION

There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS											
Sample Status				ABNORMAL	ABNORMAL						
Water	%	ASTM D6304	>0.05	△ 0.528	0.015						
ppm Water	ppm	ASTM D6304	>500	5280	156.8						
Emulsified Water	scalar	*Visual	>0.05	0.2%	NEG						

Customer Id: LBJLON Sample No.: KC124494 Lab Number: 06001065 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

23 May 2023 Diag: Don Baldridge

ISO



Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

KAESER 8382387 (S/N 1988)

Compressor

KAESER SIGMA (OEM) S-460 (--- QTS)

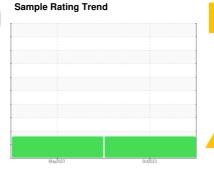



DIAGNOSIS

Recommendation

There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

			May2023	0ct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC124494	KC85519	
Sample Date		Client Info		30 Oct 2023	23 May 2023	
Machine Age	hrs	Client Info		1688	1149	
Oil Age	hrs	Client Info		0	1149	
Oil Changed		Client Info		N/A	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	0	
Copper	ppm	ASTM D5185m	>50	2	4	
Tin	ppm	ASTM D5185m	>10	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
	ррііі		11 11 11			111
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m	90	7	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m	90	47	43	
Calcium	ppm	ASTM D5185m	2	0	0	
Phosphorus	ppm	ASTM D5185m		0	<1	
Zinc	ppm	ASTM D5185m		6	5	
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	
Sodium	ppm	ASTM D5185m		12	8	
Potassium	ppm	ASTM D5185m	>20	5	12	
Water	%	ASTM D6304	>0.05	△ 0.528	0.015	
ppm Water	ppm	ASTM D6304	>500	△ 5280	156.8	
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647			15313	
Particles >6µm		ASTM D7647	>1300		▲ 6098	
Particles >14µm		ASTM D7647	>80		<u>^</u> 292	
Particles >21µm		ASTM D7647			<u>^</u> 22	
Particles >38µm		ASTM D7647	>4		1	
Particles >71µm		ASTM D7647	>3		1	
Oil Cleanliness		ISO 4406 (c)	>/17/13		<u>^</u> 21/20/15	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.31	0.28	
ACIO NUMBER (AIV)	my NOH/y	40 LINI D0043	U. T	0.31	0.20	



OIL ANALYSIS REPORT







Laboratory Sample No. Lab Number **Unique Number**

: KC124494 : 06001065 : 10729425

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Nov 2023 Diagnosed Diagnostician

: 09 Nov 2023 : Don Baldridge

LONGWOOD, FL US 32750 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F:

100 HIGHLINE DR