




PROBLEM SUMMARY

Sample Rating Trend

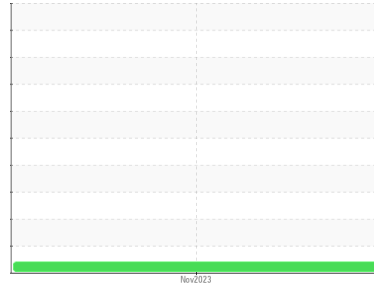

VIS DEBRIS



Machine Id
KD-1 GAS NOX PUMP
 Component
Gearbox
 Fluid
MOBIL SHC 630 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---

Customer Id: NRGDOV
Sample No.: USP249791
Lab Number: 06006376
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.


HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

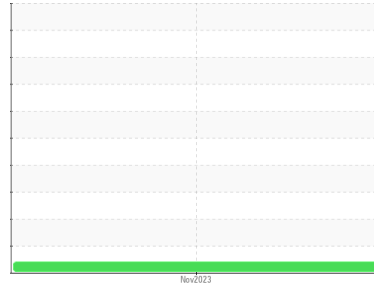

Machine Id
KD-1 GAS NOX PUMP
 Component
Gearbox
 Fluid
MOBIL SHC 630 (--- GAL)

DIAGNOSIS

▲ Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		USP249791	---	---
Sample Date	Client Info		09 Nov 2023	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >200	12	---	---
Chromium	ppm	ASTM D5185m >15	0	---	---
Nickel	ppm	ASTM D5185m >15	0	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >25	0	---	---
Lead	ppm	ASTM D5185m >100	0	---	---
Copper	ppm	ASTM D5185m >200	0	---	---
Tin	ppm	ASTM D5185m >25	0	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	0	---	---
Manganese	ppm	ASTM D5185m	0	---	---
Magnesium	ppm	ASTM D5185m	0	---	---
Calcium	ppm	ASTM D5185m	0	---	---
Phosphorus	ppm	ASTM D5185m	446	---	---
Zinc	ppm	ASTM D5185m	0	---	---
Sulfur	ppm	ASTM D5185m	59	---	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	10	---	---
Sodium	ppm	ASTM D5185m	0	---	---
Potassium	ppm	ASTM D5185m >20	0	---	---
Water	%	ASTM D6304 >0.2	0.003	---	---
ppm Water	ppm	ASTM D6304 >2000	30.2	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.47	---	---



OIL ANALYSIS REPORT

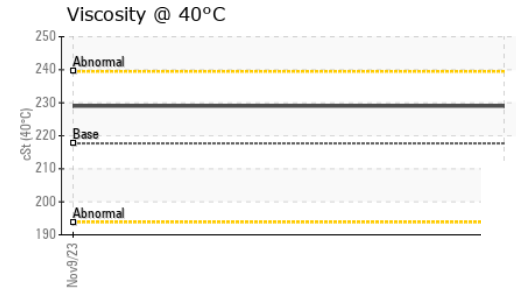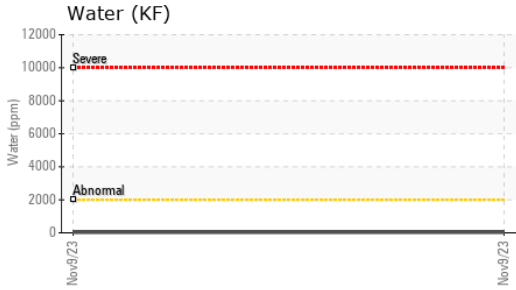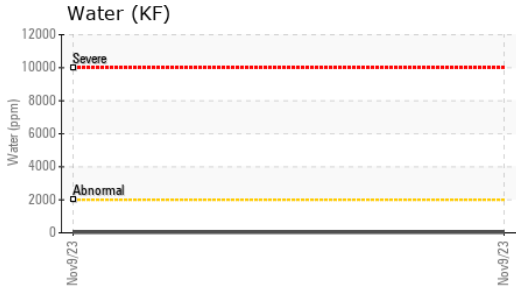





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	217.7	229	---	---

SAMPLE IMAGES

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

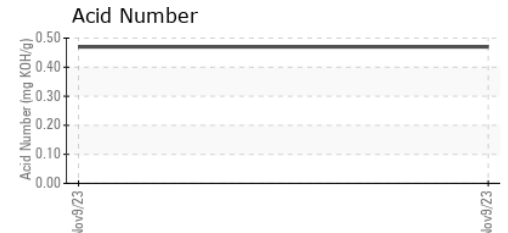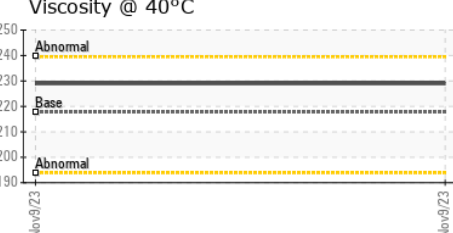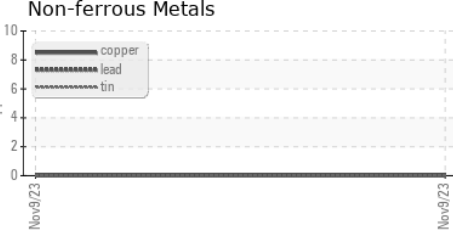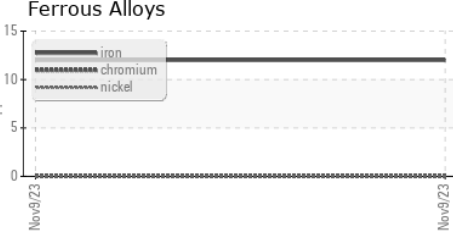

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : USP249791 **Received** : 13 Nov 2023
Lab Number : 06006376 **Diagnosed** : 14 Nov 2023
Unique Number : 10740138 **Diagnostician** : Doug Bogart
Test Package : IND 2

ENERGY CENTER DOVER LLC - DCODOV
 1280 W NORTH ST
 DOVER, DE
 US 19904
 Contact: ERNIE JUST
 ernie.just@clearwayenergy.com
 T: (302)678-4353
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)