




# OIL ANALYSIS REPORT

## Sample Rating Trend

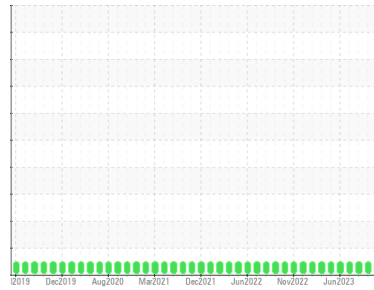

**NORMAL**



Machine Id  
**E 0110A E 0110A**

Component  
**Diesel Engine**

Fluid  
**DIESEL ENGINE OIL SAE 15W40 (--- GAL)**

### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil.

#### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>HLC0002594</b>	HLC0001477	HLC0002643
Sample Date	Client Info			<b>04 Nov 2023</b>	03 Oct 2023	05 Sep 2023
Machine Age	hrs	Client Info		<b>0</b>	0	0
Oil Age	hrs	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>N/A</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel	WC Method		>3.0	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method			<b>NEG</b>	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	<b>2</b>	4	4
Chromium	ppm	ASTM D5185m	>20	<b>0</b>	<1	0
Nickel	ppm	ASTM D5185m	>2	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>&lt;1</b>	0	<1
Lead	ppm	ASTM D5185m	>40	<b>&lt;1</b>	1	<1
Copper	ppm	ASTM D5185m	>330	<b>2</b>	2	2
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	<1
Cadmium	ppm	ASTM D5185m		<b>0</b>	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	250	<b>153</b>	151	173
Barium	ppm	ASTM D5185m	10	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	100	<b>109</b>	117	113
Manganese	ppm	ASTM D5185m		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185m	450	<b>1029</b>	980	1037
Calcium	ppm	ASTM D5185m	3000	<b>480</b>	485	528
Phosphorus	ppm	ASTM D5185m	1150	<b>925</b>	894	897
Zinc	ppm	ASTM D5185m	1350	<b>1095</b>	1086	1094
Sulfur	ppm	ASTM D5185m	4250	<b>2956</b>	3461	3475



CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<b>5</b>	6	6
Sodium	ppm	ASTM D5185m	>158	<b>2</b>	0	1
Potassium	ppm	ASTM D5185m	>20	<b>0</b>	<1	0

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>6	<b>0.1</b>	0.1	0.1
Nitration	Abs/cm	*ASTM D7624	>20	<b>4.7</b>	4.6	4.7
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>16.9</b>	16.4	15.6

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>9.9</b>	9.6	8.9
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	<b>5.93</b>	6.80	5.87







# OIL ANALYSIS REPORT

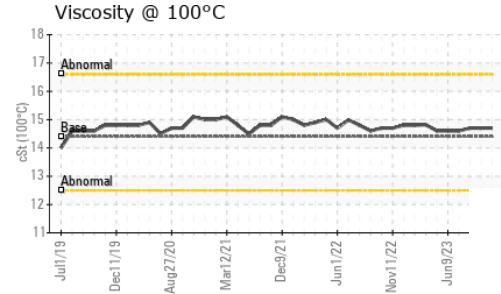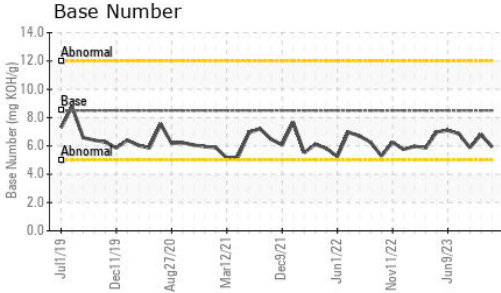

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	14.4	<b>14.7</b>	14.7

## GRAPHS

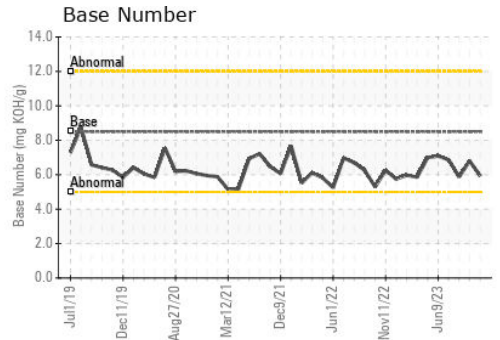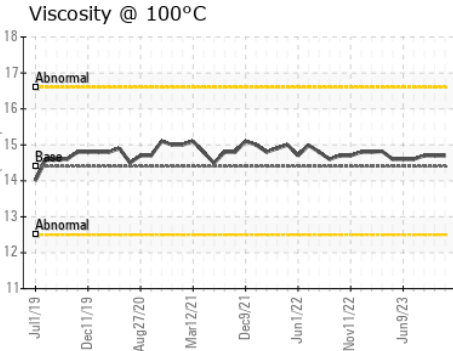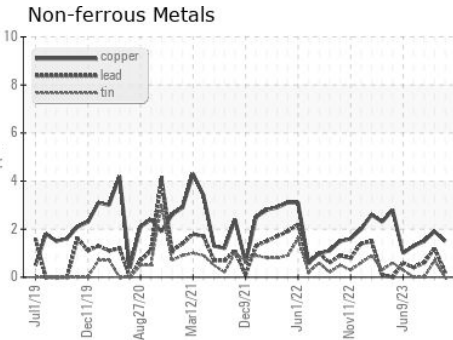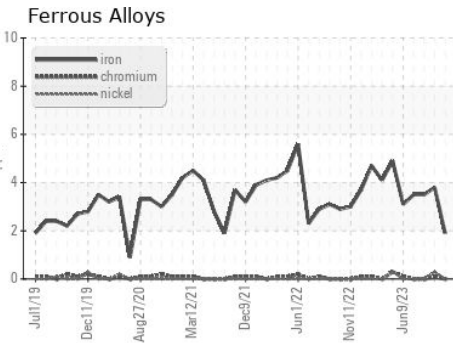

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : HLC0002594 **Received** : 13 Nov 2023  
**Lab Number** : 06006500 **Diagnosed** : 15 Nov 2023  
**Unique Number** : 10740262 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2

**HILCORP EXPLORATION ALASKA - MILNE POINT**  
 1000 MILNE POINT RD  
 PRUDOE BAY, AK  
 US 99734  
 Contact: Evan Reilly  
 evan.reilly@hilcorp.com  
 T: (907)670-3231  
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)