


OIL ANALYSIS REPORT

ULTRA COOLANT [057182]

INGERSOLL RAND VK3458 - ASPEN-EPSILON

Component

Compressor

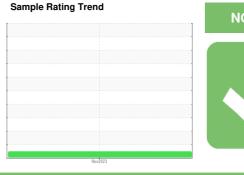



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
	AATION				اد سماما	histow.O
SAMPLE INFORM	TATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06007044		
Sample Date		Client Info		03 Nov 2023		
Machine Age	hrs	Client Info		52020		
Oil Age	hrs	Client Info		7109		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	500	824		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	0	<1		
Calcium	ppm	ASTM D5185m	0	5		
Phosphorus	ppm	ASTM D5185m	20	11		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	200	260		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		33		
Potassium	ppm	ASTM D5185m	>20	4		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.33		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
·17·37\ Rov: 1			0	Location: BACH	EL VON LIATE	EN 110 10110A



OIL ANALYSIS REPORT

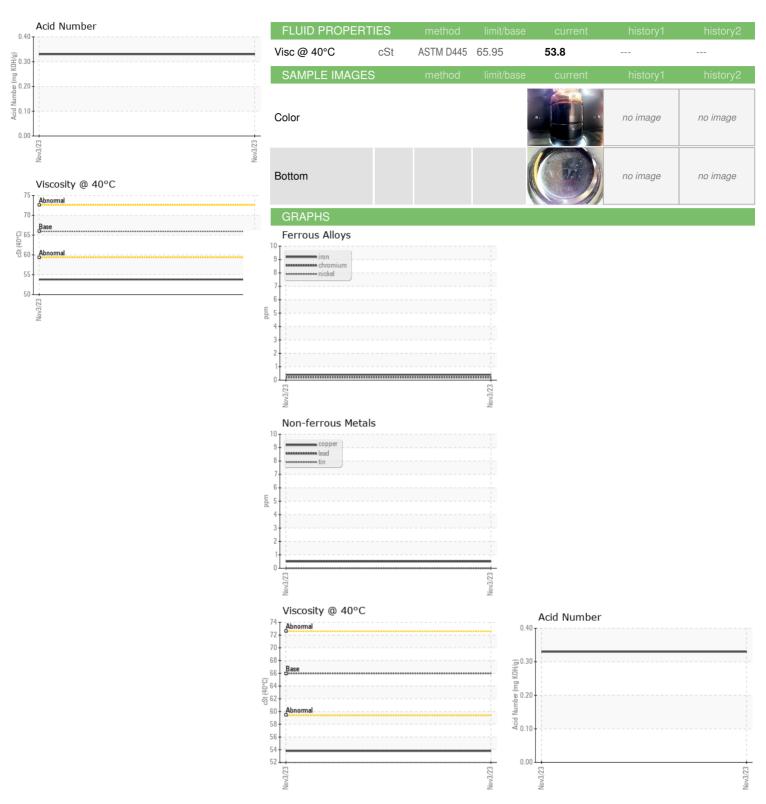





Certificate L2367

Laboratory Sample No. Lab Number

: 06007044 Unique Number : 10740806 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06007044 Received : 14 Nov 2023 Diagnosed

: 15 Nov 2023 Diagnostician : Doug Bogart JOHN HENRY FOSTER COMPANY 4700 LEBOURGET STREET

SAINT LOUIS, MO US 63134

Contact: RACHEL VON HATTEN

rvonhatten@jhf.com

T: (314)593-1267 F: (314)874-0965

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCJOHSAI [WUSCAR] 06007044 (Generated: 11/16/2023 05:17:37) Rev: 1