


OIL ANALYSIS REPORT

KTL-4000 FG [7404] Machine Id KAISHAN 112110803US01 - SMOKEHOUSE

Component

Compressor

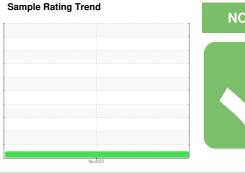



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moar

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
OAMBLE INCOM	4471011					
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06007089		
Sample Date		Client Info		01 Nov 2023		
Machine Age	hrs	Client Info		9987		
Oil Age	hrs	Client Info		1688		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	5	<1		
Calcium	ppm	ASTM D5185m	12	0		
Phosphorus	ppm	ASTM D5185m	12	10		
Zinc	ppm	ASTM D5185m	12	0		
Sulfur	ppm	ASTM D5185m	1000	0		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m	725	0		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.10	0.10		HISTOTYZ
VISUAL	35.48	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual	ZU. 1	NEG		
1100 114101	Journal	Vioudi		.,		



OIL ANALYSIS REPORT

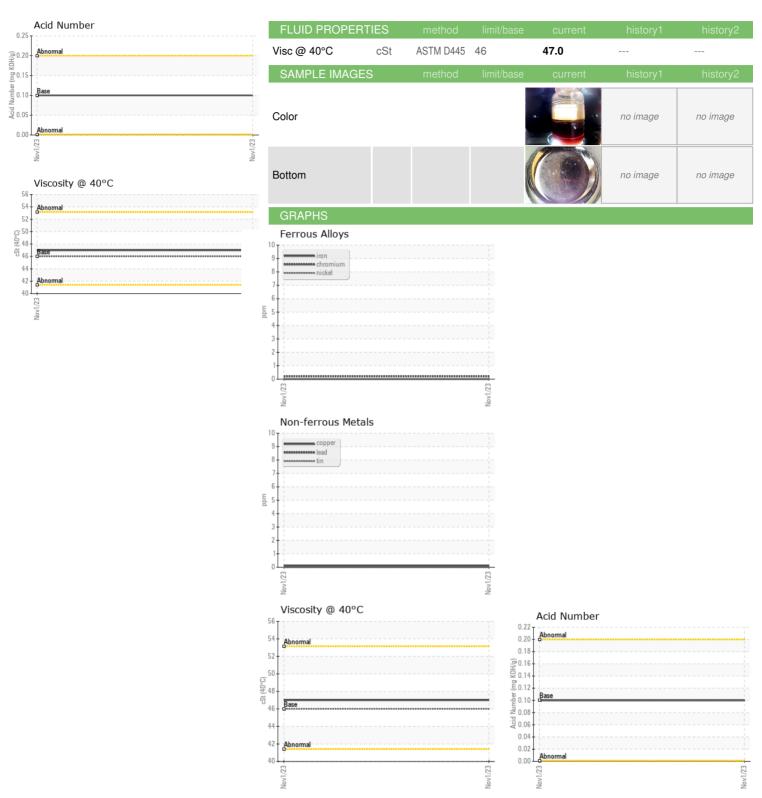





Certificate L2367

Laboratory Sample No. Lab Number

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Unique Number : 10740851

: UCH06007089 : 06007089

Received Diagnosed

: 14 Nov 2023 : 16 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ADVANCED COMPRESSED AIR SOLUTIONS (ACAS) 9421 FM 2920 RD BLDG 23

TOMBALL, TX

US 77375 Contact: JIM SUAREZ

jim@advancedcompressedair.com T:

F: