


OIL ANALYSIS REPORT

KANSAS/44/EG - OTHER SERVICE 57.03W [KANSAS^44^EG - OTHER SERVICE]

Drive Reducer

NOT GIVEN (--- GAL)

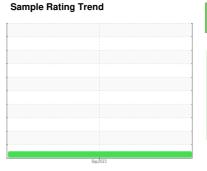



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Sep 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0673514		
Sample Date		Client Info		27 Sep 2023		
Machine Age	hrs	Client Info		1190		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	46		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m		0		
Lead	ppm	ASTM D5185m		0		
Copper	ppm	ASTM D5185m		<1		
Tin	ppm	ASTM D5185m		0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		10		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		8		
Phosphorus	ppm	ASTM D5185m		278		
Zinc	ppm	ASTM D5185m		4		
Sulfur	ppm	ASTM D5185m		1495		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m		46		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPERT	IES	method	limit/base	current	history1	history2





OIL ANALYSIS REPORT

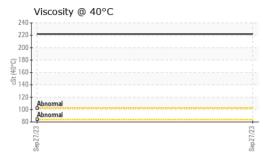


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

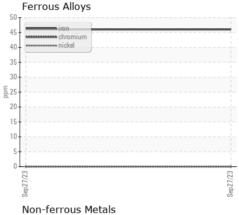

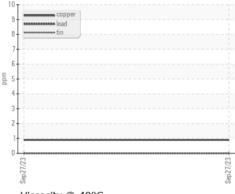

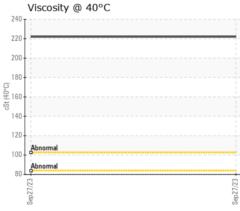





Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10740994 Test Package : CONST

: WC0673514 : 06007232

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 14 Nov 2023 Diagnosed : 16 Nov 2023 Diagnostician : Don Baldridge

SHERWOOD CONSTRUCTION CO INC

3219 WEST MAY ST WICHITA, KS US 67213

Contact: WENDY DUNSON wendy.dunson@sherwood.net

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: SHEWIC [WUSCAR] 06007232 (Generated: 11/17/2023 00:26:33) Rev: 1

Submitted By: WENDY DUNSON

T:

F: