



PROBLEM SUMMARY

Area
URC
 Machine Id
ROV ELECTRIC COMPENSATOR
 Component
Fluid
 Fluid
TEXACO TRANSFORMER OIL (--- GAL)

Sample Rating Trend




ISO



COMPONENT CONDITION SUMMARY

▲ Particle Trend

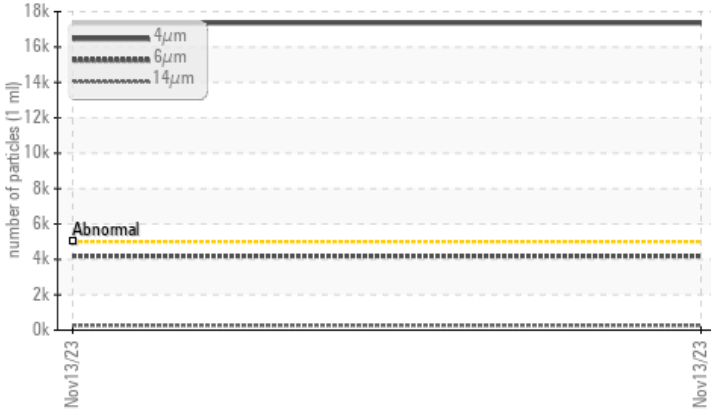


RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	---	---
Particles >4µm	ASTM D7647	>5000	▲ 17357	---	---
Particles >6µm	ASTM D7647	>1300	▲ 4188	---	---
Particles >14µm	ASTM D7647	>160	▲ 267	---	---
Particles >21µm	ASTM D7647	>40	▲ 60	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 21/19/15	---	---

PrtFilter



Customer Id: OCESAN
Sample No.: PH0000924
Lab Number: 06007635
Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS


Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

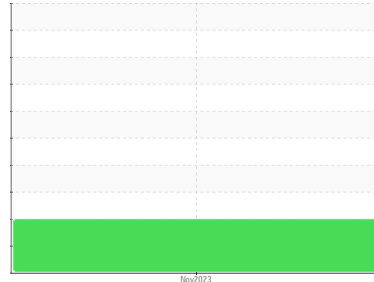

ISO



Area
URC
 Machine Id
ROV ELECTRIC COMPENSATOR
 Component
Fluid
 Fluid
TEXACO TRANSFORMER OIL (--- GAL)

DIAGNOSIS

▲ Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the fluid.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			PH0000924	---	---
Sample Date	Client Info			13 Nov 2023	---	---
Machine Age	hrs	Client Info		0	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			Not Changed	---	---
Sample Status				ABNORMAL	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method			NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m		0	---	---
Chromium	ppm	ASTM D5185m		0	---	---
Nickel	ppm	ASTM D5185m		0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m		0	---	---
Lead	ppm	ASTM D5185m		0	---	---
Copper	ppm	ASTM D5185m		0	---	---
Tin	ppm	ASTM D5185m		0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	---	---
Barium	ppm	ASTM D5185m		0	---	---
Molybdenum	ppm	ASTM D5185m		0	---	---
Manganese	ppm	ASTM D5185m		0	---	---
Magnesium	ppm	ASTM D5185m		0	---	---
Calcium	ppm	ASTM D5185m		<1	---	---
Phosphorus	ppm	ASTM D5185m		8	---	---
Zinc	ppm	ASTM D5185m		5	---	---
Sulfur	ppm	ASTM D5185m		178	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m		35	---	---
Sodium	ppm	ASTM D5185m		<1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000		▲ 17357	---	---
Particles >6µm	ASTM D7647	>1300		▲ 4188	---	---
Particles >14µm	ASTM D7647	>160		▲ 267	---	---
Particles >21µm	ASTM D7647	>40		▲ 60	---	---
Particles >38µm	ASTM D7647	>10		2	---	---
Particles >71µm	ASTM D7647	>3		0	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14		▲ 21/19/15	---	---





FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.053	---	---

Particle Filter (Magn: 200 x)





OIL ANALYSIS REPORT

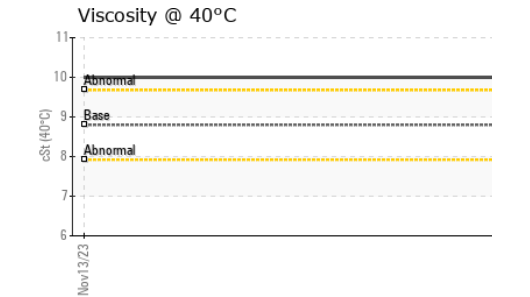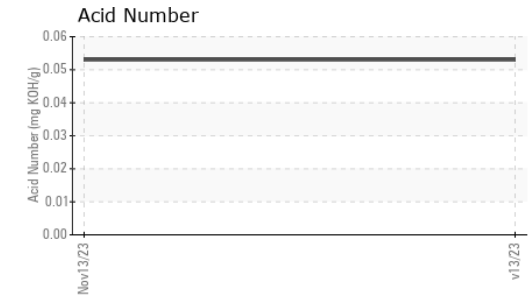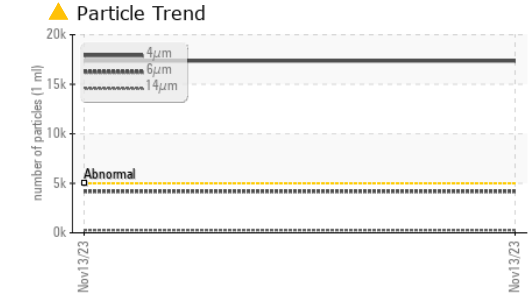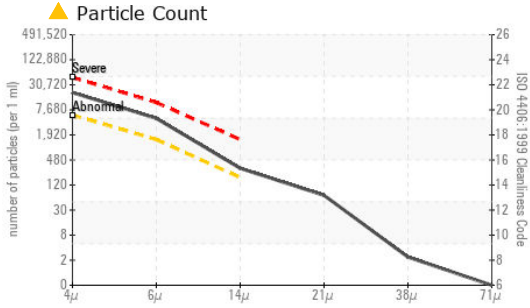



Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PH0000924 **Received** : 14 Nov 2023
Lab Number : **06007635** **Diagnosed** : 04 Dec 2023
Unique Number : 10741397 **Diagnostician** : Doug Bogart
Test Package : PLANT (Additional Tests: PrtFilter)

OCEANEERING INTERNATIONAL INC
 497 BLDG
 SAN DIEGO, CA
 US 92135
 Contact: CALVIN BROWN
 CBROWN4@OCEANEERING.NET
 T: (404)642-8815
 F:

Certificate L2367
 To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual		NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 8.8	10.0	---	---

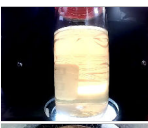SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image
PrtFilter				no image	no image

GRAPHS

