

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS

VIS DEBRIS

Machine Id

KAESER AS 25 6675494 (S/N 1164)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL		
Debris	scalar	*Visual	NONE	▲ MODER	NONE	NONE		

Customer Id: AKIWIN Sample No.: KC06007753 Lab Number: 06007753 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

18 Jul 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



17 Mar 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



08 Dec 2022 Diag: Jonathan Hester

WATER



The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. There is a high amount of particulates present in the oil. There is a light concentration of water present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

KAESER AS 25 6675494 (S/N 1164)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

lu(2018 Jan2020 Ju(2020 Jan2021 Ju(2021 Feb.2022 Sep.2022 Mar2023 Oct202:						
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC06007753	KC05909487	KC102130
Sample Date		Client Info		30 Oct 2023	18 Jul 2023	17 Mar 2023
Machine Age	hrs	Client Info		29405	0	27707
Oil Age	hrs	Client Info		0	0	3768
Oil Changed		Client Info		N/A	N/A	Changed
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	12	4	10
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	<1
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	90	0	37	10
Calcium	ppm	ASTM D5185m	2	0	0	2
Phosphorus	ppm	ASTM D5185m		0	2	4
Zinc	ppm	ASTM D5185m		0	37	26
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	0
Sodium	ppm	ASTM D5185m		7	13	2
Potassium	ppm	ASTM D5185m	>20	0	4	<1
Water	%	ASTM D6304	>0.05	0.022	0.019	0.005
ppm Water	ppm	ASTM D6304	>500	223.8	191.7	58.6
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647			13308	3753
Particles >6µm		ASTM D7647	>1300		▲ 4702	<u>▲</u> 1343
Particles >14μm		ASTM D7647	>80		▲ 437	▲ 186
Particles >21μm		ASTM D7647	>20		4 90	▲ 78
Particles >38μm		ASTM D7647	>4		2	<u>^</u> 6
Particles >71μm		ASTM D7647	>3		0	0
Oil Cleanliness		ISO 4406 (c)	>/17/13		<u>\$\text{\Delta}\$ 21/19/16</u>	▲ 19/18/15
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.27	0.34	0.28



OIL ANALYSIS REPORT

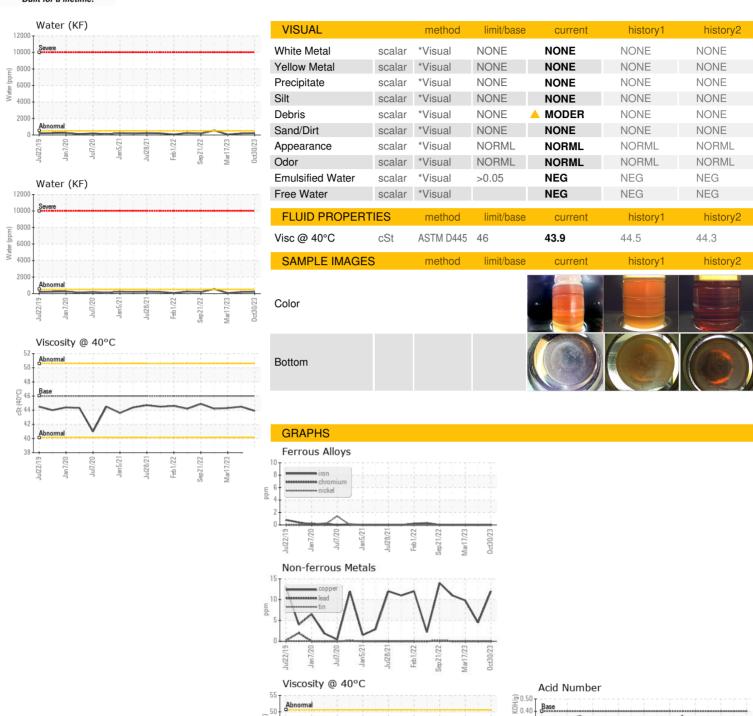





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KC06007753 : 06007753 : 10741515 Test Package : IND 2

50

ś

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 14 Nov 2023 Diagnosed : 16 Nov 2023

Ĕ0.30 흗 0.20

₹ 0.10 00.00 PG

0ct30/23

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AKINS FORD 220 W MAY ST WINDER, GA

US 30680 Contact:

T: F: