



PROBLEM SUMMARY

Sample Rating Trend




WEAR



Machine Id
3
 Component
Hydraulic System
 Fluid
NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Non-ferrous Metals

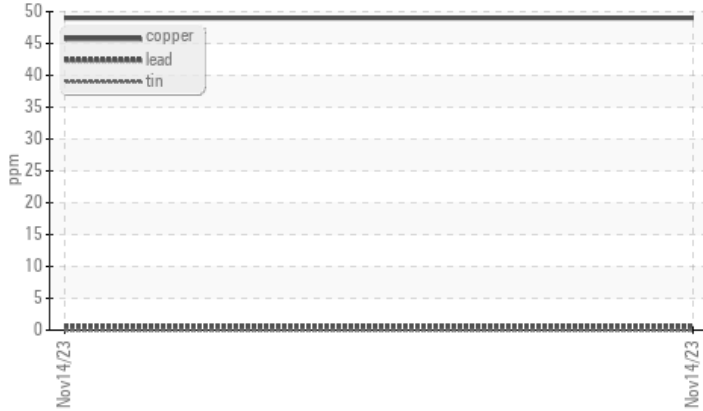

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Copper	ppm	ASTM D5185m	>20	▲ 49	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---

Customer Id: MEILEW
Sample No.: KFS06008292
Lab Number: 06008292
Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



WEAR



Machine Id
3
 Component
Hydraulic System
 Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

▲ Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

▲ Wear

The copper level is abnormal. All other component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		KFS06008292	---	---
Sample Date	Client Info		14 Nov 2023	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			ABNORMAL	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	0	---	---
Chromium	ppm	ASTM D5185m >20	0	---	---
Nickel	ppm	ASTM D5185m >20	0	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >20	0	---	---
Lead	ppm	ASTM D5185m >20	<1	---	---
Copper	ppm	ASTM D5185m >20	▲ 49	---	---
Tin	ppm	ASTM D5185m >20	0	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	0	---	---
Manganese	ppm	ASTM D5185m	<1	---	---
Magnesium	ppm	ASTM D5185m	<1	---	---
Calcium	ppm	ASTM D5185m	41	---	---
Phosphorus	ppm	ASTM D5185m	350	---	---
Zinc	ppm	ASTM D5185m	446	---	---
Sulfur	ppm	ASTM D5185m	907	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<1	---	---
Sodium	ppm	ASTM D5185m	<1	---	---
Potassium	ppm	ASTM D5185m >20	<1	---	---




FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.17	---	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	---	---
Yellow Metal	scalar	*Visual NONE	NONE	---	---
Precipitate	scalar	*Visual NONE	NONE	---	---
Silt	scalar	*Visual NONE	NONE	---	---
Debris	scalar	*Visual NONE	▲ MODER	---	---
Sand/Dirt	scalar	*Visual NONE	NONE	---	---
Appearance	scalar	*Visual NORML	NORML	---	---
Odor	scalar	*Visual NORML	NORML	---	---
Emulsified Water	scalar	*Visual >0.05	NEG	---	---
Free Water	scalar	*Visual	NEG	---	---





OIL ANALYSIS REPORT

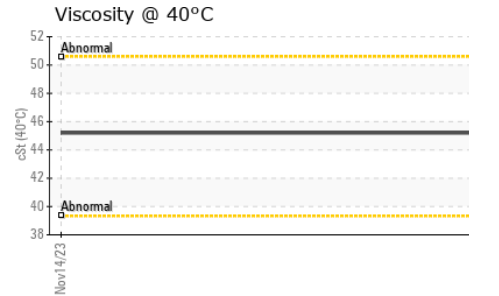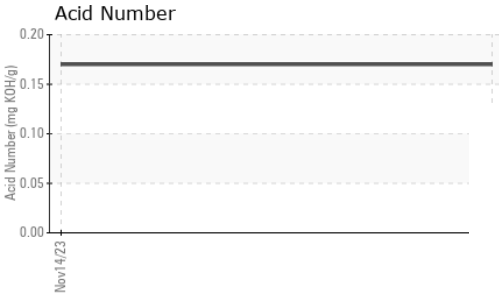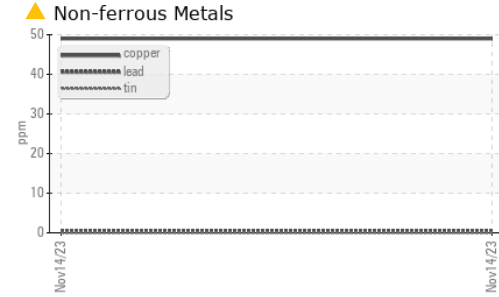

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45.2	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

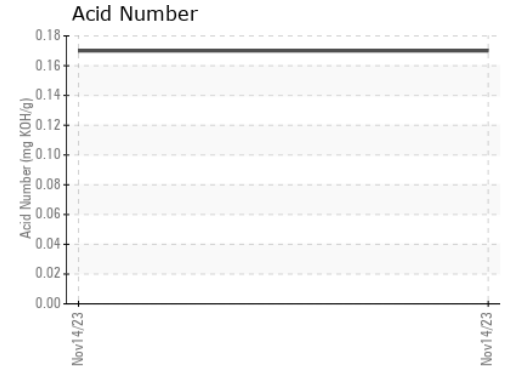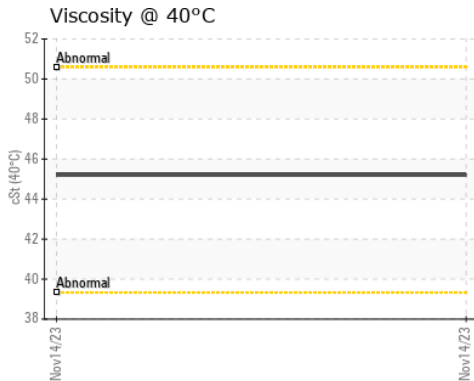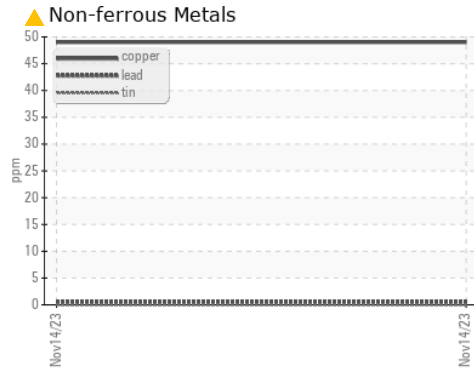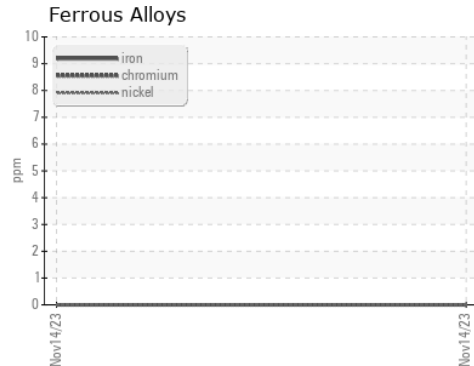

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KFS06008292 **Received** : 15 Nov 2023
Lab Number : **06008292** **Diagnosed** : 17 Nov 2023
Unique Number : 10742054 **Diagnostician** : Don Baldrige
Test Package : PLANT

MEIWA INDUSTRY NA
 1041 VETERANS DR
 LEWISBURG, TN
 US 37091
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: