

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TE	ST RESULTS			
Sample Status		ATTENTION	NORMAL	ATTENTION
Particles >4µm	ASTM D7647 >200	00 🔺 21504	19472	<u> </u>
Oil Cleanliness	ISO 4406 (c) >21/1	9/16 🔺 22/17/12	21/17/11	🔺 22/18/13

Customer Id: TALCLA Sample No.: WC0857833 Lab Number: 06009091 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com ISO

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

09 Nov 2022 Diag: Angela Borella



Resample at the next service interval to monitor.All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

15 Nov 2021 Diag: Angela Borella



Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



view repor






30 Nov 2020 Diag: Wes Davis



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



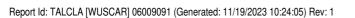



OIL ANALYSIS REPORT

Area D230 [2996160] Machine Id **71AG113 (S/N 1000003190850)** Component

Agitator Gearbox

MOBIL SHC CIBUS 220 (--- GAL)

DIAGNOSIS

A Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

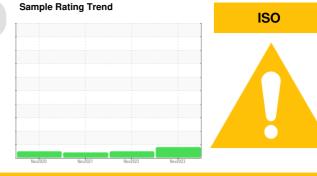

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0857833	WC0744451	WC0490096
Sample Date		Client Info		10 Nov 2023	09 Nov 2022	15 Nov 2021
Machine Age	mths	Client Info		0	0	0
Oil Age	mths	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>150	<1	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	1	0	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>50	0	0	0
Tin	ppm	ASTM D5185m	>10	0	0	0
Antimony	ppm	ASTM D5185m				0
Vanadium	ppm	ASTM D5185m	20	0	0	0
Cadmium		ASTM D5185m		0	0	0
	ppm			-		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	<1
Barium	ppm	ASTM D5185m		6	0	0
Molybdenum	ppm	ASTM D5185m		<1	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		<1	<1	0
Phosphorus	ppm	ASTM D5185m		583	520	509
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		563	722	463
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2	2	2
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	<1	0	0
Water	%	ASTM D6304	>0.1	0.003	0.013	0.003
ppm Water	ppm	ASTM D6304	>1000	39.6	135.6	29.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	A 21504	19472	▲ 32833
Particles >6µm		ASTM D7647	>5000	912	775	1873
Particles >14µm		ASTM D7647	>640	26	19	42
Particles >21µm		ASTM D7647	>160	7	4	6
Particles >38µm		ASTM D7647	>40	1	0	0
Particles >71µm		ASTM D7647	>10	0	0	0
Oil Cleanliness		ISO 4406 (c)	>21/19/16	A 22/17/12	21/17/11	🔺 22/18/13
FLUID DEGRADATION method limit/base current history1 history2						
A sid Number (ANI)	ma KOUV-			0.00	0.04	0.007

Acid Number (AN) mg KOH/g AST

mg KOH/g ASTM D8045


0.28 0.34 0.337

Report Id: TALCLA [WUSCAR] 06009091 (Generated: 11/19/2023 10:24:06) Rev: 1


Contact/Location: KEN TERRY - TALCLA



OIL ANALYSIS REPORT

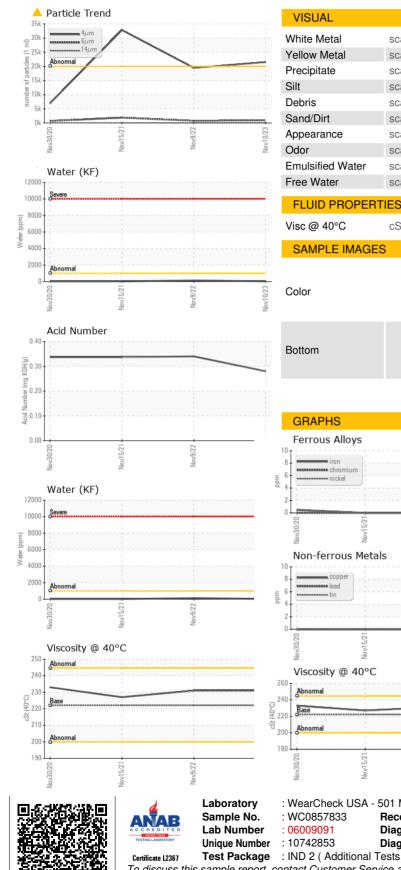

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	222	231	231	227
SAMPLE IMAGES	6	method	limit/base	current	history1	history2
Color						
Dattant						

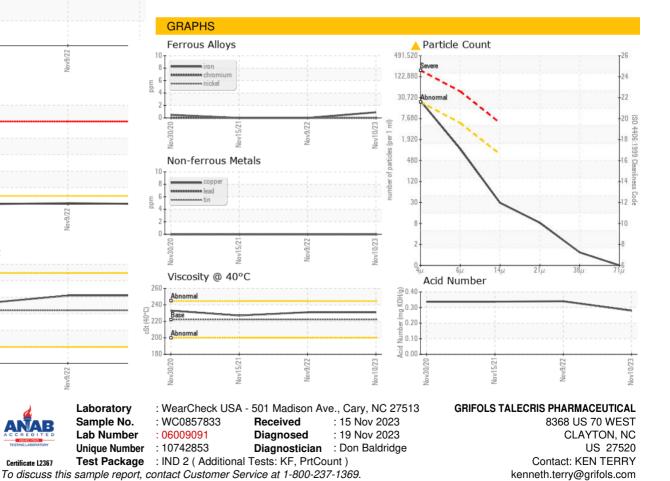

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: KEN TERRY - TALCLA

T: (919)359-4362

F: (919)359-4767