


OIL ANALYSIS REPORT

AIRLUBE 228 [1395127] **ATLAS COPCO API666-952 - SANOH-ARCHBOLD**

Component

Compressor

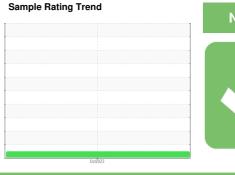



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Oct2023		
CANADI E INICODA	44 TION					
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06009122		
Sample Date		Client Info		19 Oct 2023		
Machine Age	hrs	Client Info		66364		
Oil Age	hrs	Client Info		1891		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	1		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	3		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		ام مالم مما	limit/base		history d	history.O
ADDITIVES		method		current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0		
Barium	ppm	ASTM D5185m	0	6		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0.3	0		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	406	200		
Zinc	ppm	ASTM D5185m	0	5		
Sulfur	ppm	ASTM D5185m	1283	81		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.60		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		



OIL ANALYSIS REPORT

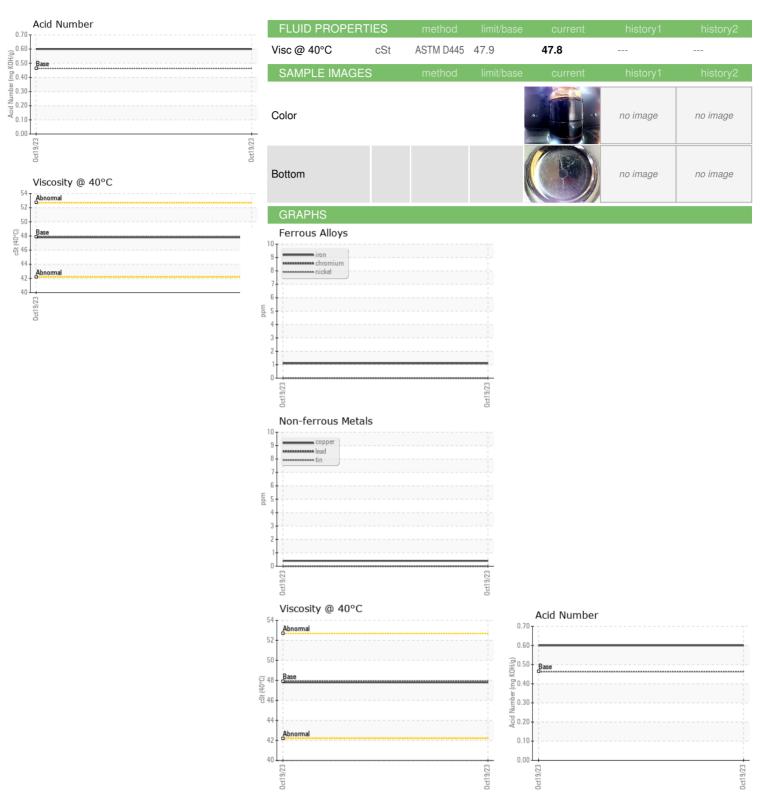





Laboratory Sample No. Lab Number

Unique Number : 10742884

: UCH06009122 : 06009122 Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 15 Nov 2023 Diagnosed : 17 Nov 2023

Diagnostician : Angela Borella

DIRECT AIR - AIR TECHNOLOGIES 400 WRIGHT AVE

MIDDLETOWN, OH US 45044

Contact: APRIL MOORE

april.moore@aircompressors.com

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (513)539-6040