


PROBLEM SUMMARY


PLATE FREEZER PLATE FRZR 1-6

Component **Hydraulic System**

LUBRIPLATE L0867-062 (--- GAL)

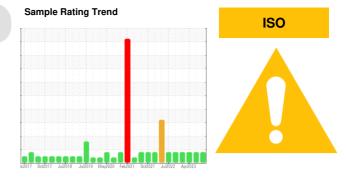

COMPONENT CONDITION SUMMARY

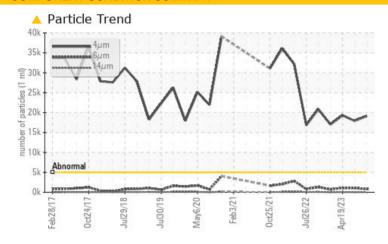

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL			
Particles >4μm	ASTM D7647	>5000	<u> </u>	<u>▲</u> 17921	<u>▲</u> 19281			
Oil Cleanliness	ISO 4406 (c)	>19/17/14	<u> </u>	<u>\$\lambda\$</u> 21/17/13	21/17/13			

Customer Id: CONRUS Sample No.: USP0003670 Lab Number: 06009685 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Aug 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



19 Apr 2023 Diag: Doug Bogart

150



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



25 Jan 2023 Diag: Jonathan Hester

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT

PLATE FREEZER PLATE FRZR 1-6

Hydraulic System

LUBRIPLATE L0867-062 (--- GAL)

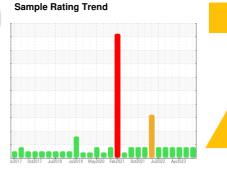



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		62017 Oct201	7 Jul2018 Jul2019 May	2020 Feb2021 Oct2021 Jul2022	Apr2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003670	USP0000574	USP248826
Sample Date		Client Info		15 Nov 2023	19 Aug 2023	19 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	1	1
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	0	0
Lead	ppm	ASTM D5185m	>20	1	0	0
Copper	ppm	ASTM D5185m	>20	13	13	13
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		78	77	77
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		2	3	3
Calcium	ppm	ASTM D5185m		66	73	71
Phosphorus	ppm	ASTM D5185m		204	206	202
Zinc	ppm	ASTM D5185m		10	16	14
Sulfur	ppm	ASTM D5185m		888	992	1016
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	7	1	<1
Sodium	ppm	ASTM D5185m		0	2	1
Potassium	ppm	ASTM D5185m	>20	2	0	0
Water	%	ASTM D6304	>0.05	0.020	0.035	0.035
ppm Water	ppm	ASTM D6304	>500	201.9	356.2	355.1
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>5000	19126	<u>▲</u> 17921	▲ 19281
Particles >6µm		ASTM D7647	>1300	817	1062	1081
Particles >14μm		ASTM D7647	>160	39	41	57
Particles >21µm		ASTM D7647	>40	9	12	19
Particles >38μm		ASTM D7647	>10	1	1	1
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u> </u>	△ 21/17/13	△ 21/17/13
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.78	0.98	0.76



OIL ANALYSIS REPORT



* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: