


PROBLEM SUMMARY

Area **PLATE FREEZER** Machine Id **PLATE FRZR 1-4** Component

Hydraulic System Fluid LUBRIPLATE L0867-062 (--- GAL)

COMPONENT CONDITION SUMMARY

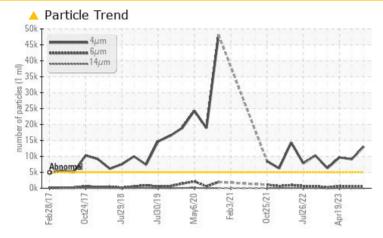

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL	ATTENTION	ATTENTION			
Particles >4µm	ASTM D7647	>5000	<u> </u>	4 9111	9677			
Oil Cleanliness	ISO 4406 (c)	>19/17/14	A 21/17/13	🔺 20/16/13	🔺 20/17/13			


Customer Id: CONRUS Sample No.: USP0003669 Lab Number: 06009686 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 <u>dougb@wearcheckusa.com</u>

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

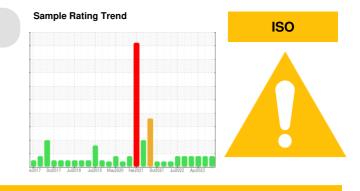

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Aug 2023 Diag: Doug Bogart



Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

19 Apr 2023 Diag: Doug Bogart

Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

25 Jan 2023 Diag: Jonathan Hester

Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





view report



OIL ANALYSIS REPORT

Area **PLATE FREEZER** Machine Id **PLATE FRZR 1-4** Component

Hydraulic System Fluid LUBRIPLATE L0867-062 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

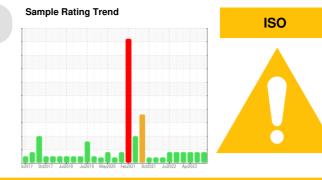



SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003669	USP0000576	USP248824
Sample Date		Client Info		15 Nov 2023	19 Aug 2023	19 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	6	6	6
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	0	<1
Lead	ppm	ASTM D5185m	>20	<1	0	0
Copper	ppm		>20	2	<1	2
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m	-	0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		79	75	77
Barium	ppm	ASTM D5185m		0	<1	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		2	2	2
Calcium	ppm	ASTM D5185m		71	77	77
Phosphorus	ppm	ASTM D5185m		216	222	220
Zinc	ppm	ASTM D5185m		29	40	35
Sulfur	ppm	ASTM D5185m		1032	1063	1109
CONTAMINANTS	i	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	1
Sodium	ppm	ASTM D5185m		0	3	2
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water	%	ASTM D6304	>0.05	0.022	0.074	0.030
ppm Water	ppm	ASTM D6304	>500	223.5	749.7	302.7
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	A 13063	4 9111	9 677
Particles >6µm		ASTM D7647	>1300	656	535	683
Particles >14µm		ASTM D7647	>160	64	47	41
Particles >21µm		ASTM D7647	>40	18	14	10
Particles >38µm		ASTM D7647	>10	0	1	1
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	4 21/17/13	▲ 20/16/13	▲ 20/17/13
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.81	1.06	1.08



OIL ANALYSIS REPORT

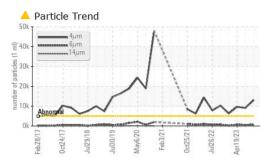

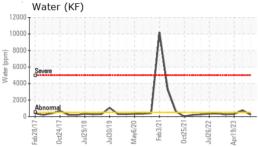

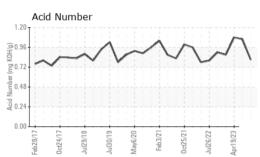

Water (KF)

1000

600 Water (

4000

200

55

50

4 ()+ 40°C) 35 (40°C)

3


25

2


ŝġ

h78/1

eh28

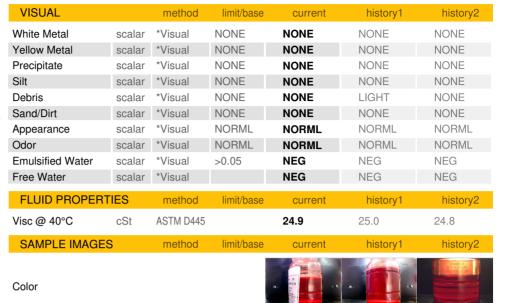

Bottom

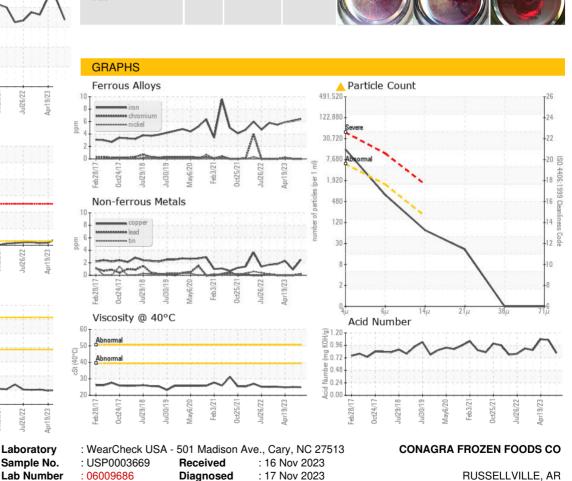

: Doug Bogart

Report Id: CONRUS [WUSCAR] 06009686 (Generated: 11/17/2023 16:20:05) Rev: 1

Certificate L2367

C/240

04217

130/

Viscosity @ 40°C

ul26/22

Apr19/23

Unique Number

Test Package

: 10743448

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

: IND 2

Diagnostician

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: SERVICE MANAGER ? - CONRUS

US

T:

F:

Contact: SERVICE MANAGER