


PROBLEM SUMMARY

Area **PLATE FREEZER** Machine Id **PLATE FRZR 2-5**

Component Hydraulic System Fluid LUBRIPLATE L0867-062 (--- GAL)

COMPONENT CONDITION SUMMARY

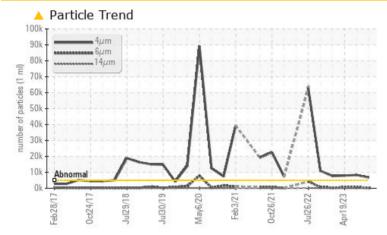

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status			ATTENTION	ATTENTION	ATTENTION		
Particles >4µm	ASTM D7647	>5000	🔺 6696	A 8337	A 7924		
Oil Cleanliness	ISO 4406 (c)	>19/17/14	A 20/15/11	🔺 20/17/12	🔺 20/16/13		


Customer Id: CONRUS Sample No.: USP0003667 Lab Number: 06009688 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 <u>dougb@wearcheckusa.com</u>

To change component or sample information: Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u>

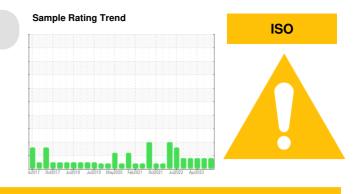

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Aug 2023 Diag: Doug Bogart



Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

19 Apr 2023 Diag: Doug Bogart

Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

25 Jan 2023 Diag: Jonathan Hester

ISO

Resample at the next service interval to monitor.All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.









OIL ANALYSIS REPORT

Area **PLATE FREEZER** Machine Id **PLATE FRZR 2-5** Component

Hydraulic System Fluid LUBRIPLATE L0867-062 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear


All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

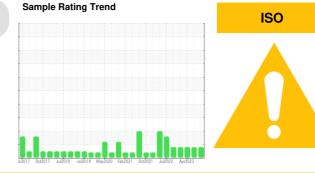



SAMPLE INFORM	/IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003667	USP0000569	USP248831
Sample Date		Client Info		15 Nov 2023	19 Aug 2023	19 Apr 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	9	8	8
Chromium	ppm	ASTM D5185m	>20	7	6	6
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	0	1
Lead	ppm	ASTM D5185m	>20	<1	0	0
Copper	ppm	ASTM D5185m		5	4	4
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		88	71	69
Barium	ppm	ASTM D5185m		0	<1	0
Molybdenum	ppm	ASTM D5185m		<1	0	<1
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		3	2	3
Calcium	ppm	ASTM D5185m		91	88	84
Phosphorus	ppm	ASTM D5185m		238	209	204
Zinc	ppm	ASTM D5185m		30	35	32
Sulfur	ppm	ASTM D5185m		1090	1035	1055
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	1
Sodium	ppm	ASTM D5185m		<1	3	3
Potassium	ppm	ASTM D5185m	>20	1	0	0
Water	%	ASTM D6304	>0.05	0.015	0.033	0.024
ppm Water	ppm	ASTM D6304	>500	152.8	330.9	240.5
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	▲ 6696	▲ 8337	▲ 7924
Particles >6µm		ASTM D7647	>1300	168	721	629
Particles >14µm		ASTM D7647	>160	12	39	52
Particles >21µm		ASTM D7647	>40	4	11	12
Particles >38µm		ASTM D7647	>10	0	1	1
Particles >71µm		ASTM D7647		0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	A 20/15/11	▲ 20/17/12	2 0/16/13
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.71	0.85	0.75




OIL ANALYSIS REPORT

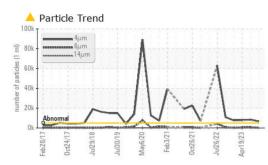

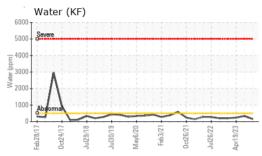


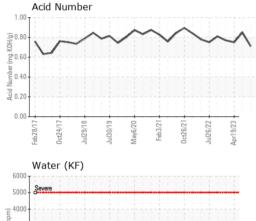

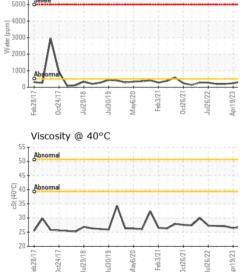

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		27.5	26.8	26.4
SAMPLE IMAGES	5	method	limit/base	current	history1	history2
Color						

Bottom

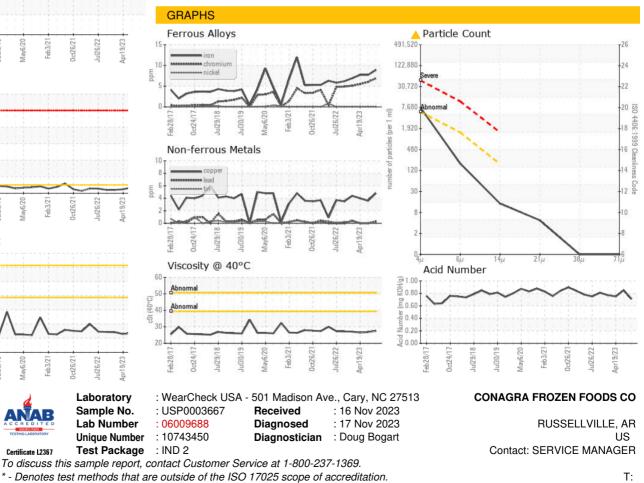

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Certificate L2367

Contact/Location: SERVICE MANAGER ? - CONRUS

F: