




PROBLEM SUMMARY

Area
PLATE FREEZER
Machine Id
PLATE FRZR 1-2


Component
Hydraulic System
Fluid
LUBRIPLATE L0867-062 (--- GAL)

Sample Rating Trend

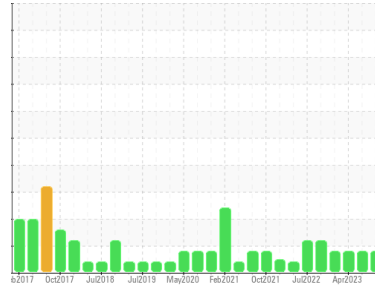

COMPONENT CONDITION SUMMARY

▲ Particle Trend

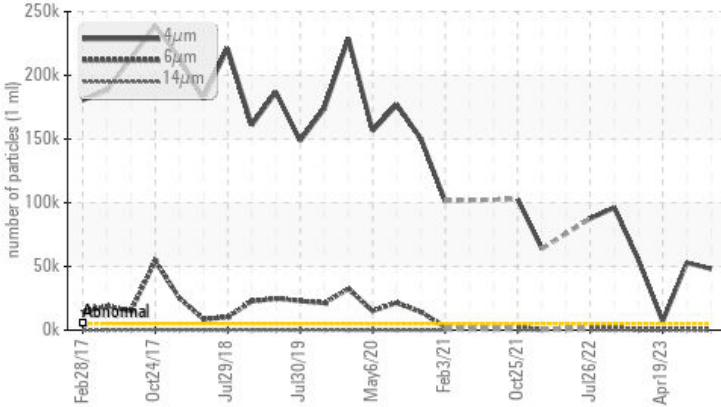

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	ABNORMAL	ATTENTION
Particles >4µm	ASTM D7647 >5000	▲ 48006	▲ 52964	▲ 6833
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 23/16/11	▲ 23/17/13	▲ 20/16/13

Customer Id: CONRUS
Sample No.: USP0003663
Lab Number: 06009692
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

19 Aug 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



19 Apr 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



25 Jan 2023 Diag: Jonathan Hester

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

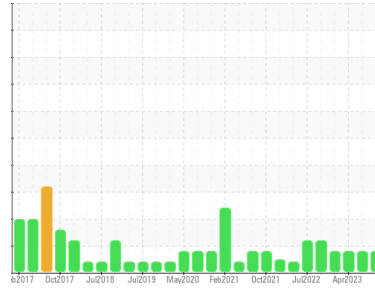

ISO



Area
PLATE FREEZER
Machine Id
PLATE FRZR 1-2

Component
Hydraulic System
Fluid
LUBRIPLATE L0867-062 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 6 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	USP0003663	USP0000568	USP248822
Sample Date	Client Info	15 Nov 2023	19 Aug 2023	19 Apr 2023
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	ABNORMAL	ATTENTION

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >20	6	6	8
Chromium	ppm	ASTM D5185m >20	<1	<1	<1
Nickel	ppm	ASTM D5185m >20	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >20	2	2	<1
Lead	ppm	ASTM D5185m >20	0	0	0
Copper	ppm	ASTM D5185m >20	1	0	3
Tin	ppm	ASTM D5185m >20	0	0	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m	73	67	69
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	<1
Manganese	ppm	ASTM D5185m	0	0	<1
Magnesium	ppm	ASTM D5185m	2	3	4
Calcium	ppm	ASTM D5185m	44	50	106
Phosphorus	ppm	ASTM D5185m	178	182	209
Zinc	ppm	ASTM D5185m	8	18	50
Sulfur	ppm	ASTM D5185m	839	980	1135

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >15	1	1	1
Sodium	ppm	ASTM D5185m	0	2	4
Potassium	ppm	ASTM D5185m >20	<1	0	0
Water	%	ASTM D6304 >0.05	0.017	0.031	0.021
ppm Water	ppm	ASTM D6304 >500	171.1	311.0	212.1






FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >5000	▲ 48006	▲ 52964	▲ 6833
Particles >6µm	ASTM D7647 >1300	336	1110	606
Particles >14µm	ASTM D7647 >160	16	41	49
Particles >21µm	ASTM D7647 >40	4	11	9
Particles >38µm	ASTM D7647 >10	0	0	1
Particles >71µm	ASTM D7647 >3	0	0	0
Oil Cleanliness	ISO 4406 (c) >19/17/14	▲ 23/16/11	▲ 23/17/13	▲ 20/16/13

FLUID DEGRADATION

method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045	0.83	0.85	0.80

OIL ANALYSIS REPORT

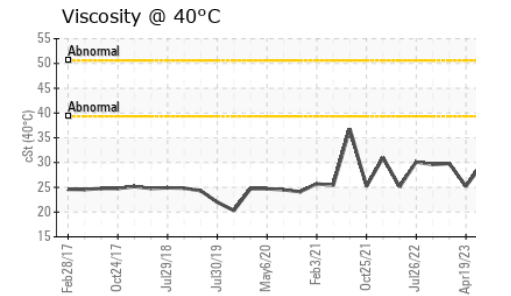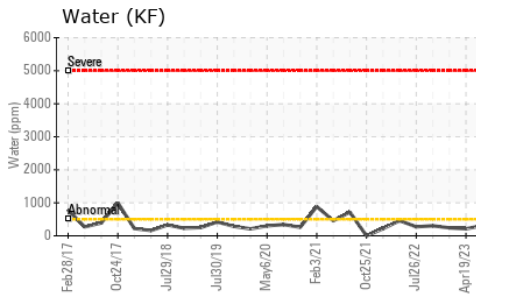
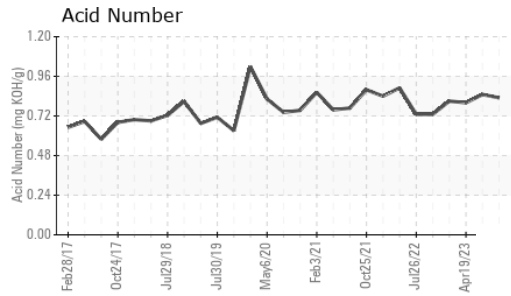
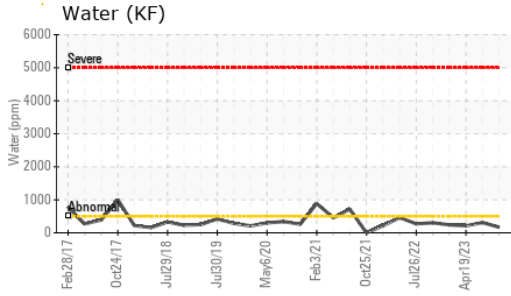
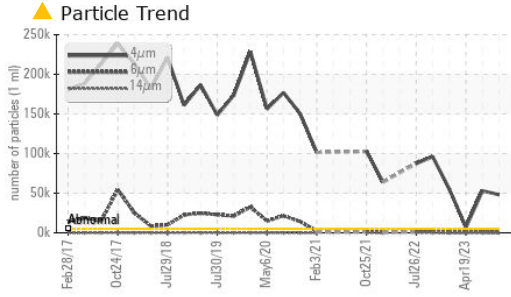


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	29.3	29.7	25.2

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

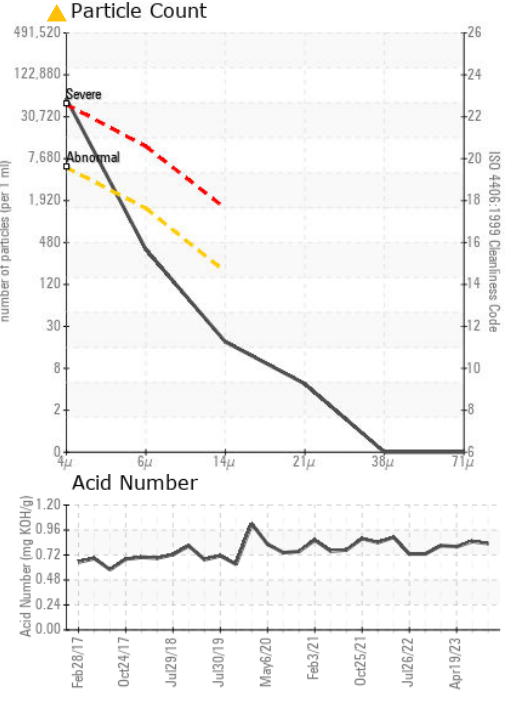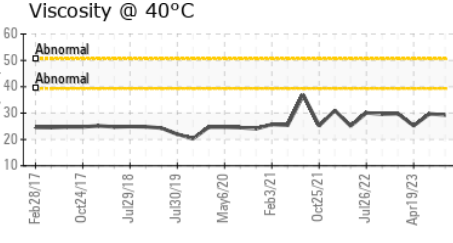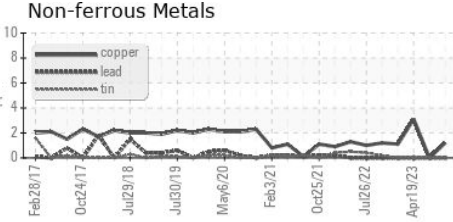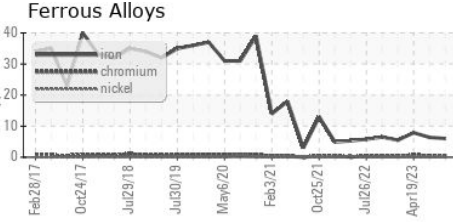

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : USP0003663 **Received** : 16 Nov 2023
Lab Number : 06009692 **Diagnosed** : 17 Nov 2023
Unique Number : 10743454 **Diagnostician** : Doug Bogart
Test Package : IND 2

CONAGRA FROZEN FOODS CO
 RUSSELLVILLE, AR
 US
 Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: