




PROBLEM SUMMARY

Sample Rating Trend

ISO




Area
LOFT
 Machine Id
B59523 - COMP 9 (S/N APIS44642001)
 Component
Compressor
 Fluid
ATLAS COPCO ROTO XTEND (--- GAL)

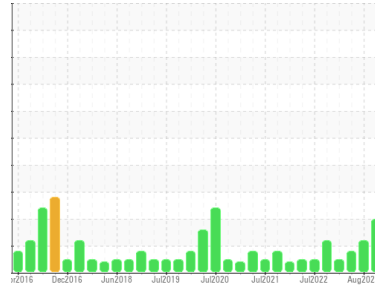

COMPONENT CONDITION SUMMARY

▲ Particle Trend

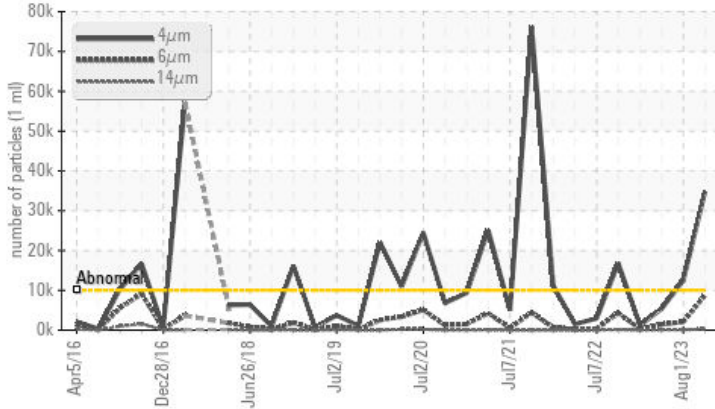

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ATTENTION	ATTENTION
Particles >4µm	ASTM D7647	>10000	▲ 34773	▲ 12480	5375
Particles >6µm	ASTM D7647	>1300	▲ 8692	▲ 2092	▲ 1456
Particles >14µm	ASTM D7647	>160	▲ 280	61	79
Particles >21µm	ASTM D7647	>40	▲ 43	15	21
Oil Cleanliness	ISO 4406 (c)	>20/17/14	▲ 22/20/15	▲ 21/18/13	▲ 20/18/13

Customer Id: HORFREWC
 Sample No.: WC0856084
 Lab Number: 06010748
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.

HISTORICAL DIAGNOSIS

01 Aug 2023 Diag: Doug Bogart

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



25 May 2023 Diag: Don Baldrige

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



30 Jan 2023 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Area
LOFT
 Machine Id
B59523 - COMP 9 (S/N APIS44642001)
 Component
Compressor
 Fluid
ATLAS COPCO ROTO XTEND (--- GAL)

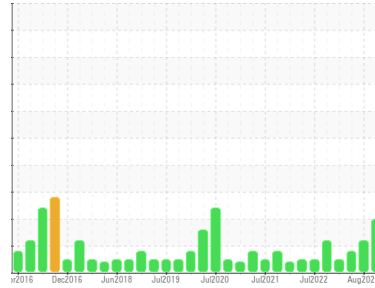

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0856084	WC0826136	WC0775028
Sample Date	Client Info		31 Oct 2023	01 Aug 2023	25 May 2023
Machine Age	hrs	Client Info	59481	59517	57884
Oil Age	hrs	Client Info	6808	6844	5211
Oil Changed	Client Info		Not Chngd	Not Chngd	Not Chngd
Sample Status			ABNORMAL	ATTENTION	ATTENTION

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>50	<1	0	0
Chromium	ppm	ASTM D5185m	>5	<1	0	0
Nickel	ppm	ASTM D5185m		0	<1	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>15	0	0	0
Lead	ppm	ASTM D5185m	>65	0	<1	0
Copper	ppm	ASTM D5185m	>65	1	<1	<1
Tin	ppm	ASTM D5185m	>10	13	0	0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	1	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m		0	<1	<1
Calcium	ppm	ASTM D5185m		0	<1	0
Phosphorus	ppm	ASTM D5185m		0	10	3
Zinc	ppm	ASTM D5185m		0	2	<1
Sulfur	ppm	ASTM D5185m		0	18	13

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m	>35	1	0	0
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	<1	1	1

FLUID CLEANLINESS


	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	▲ 34773	▲ 12480	5375
Particles >6µm	ASTM D7647	>1300	▲ 8692	▲ 2092	▲ 1456
Particles >14µm	ASTM D7647	>160	▲ 280	61	79
Particles >21µm	ASTM D7647	>40	▲ 43	15	21
Particles >38µm	ASTM D7647	>10	2	0	1
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>20/17/14	▲ 22/20/15	▲ 21/18/13	▲ 20/18/13

FLUID DEGRADATION


	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045	0.14	0.07	0.08	0.14

OIL ANALYSIS REPORT


▲ Particle Trend

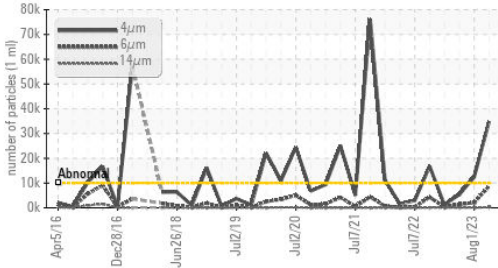


▲ Particle Trend

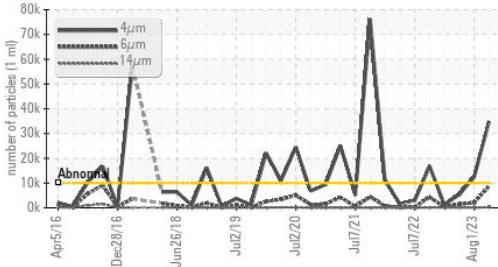

Acid Number

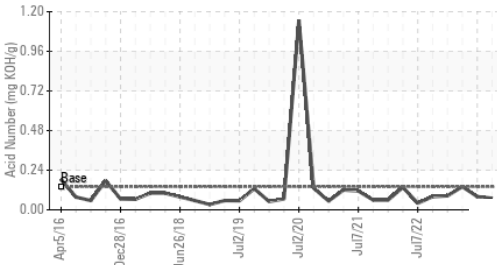


Viscosity @ 40°C

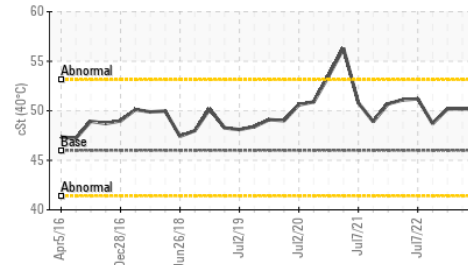

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	50.5	50.2	50.2

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

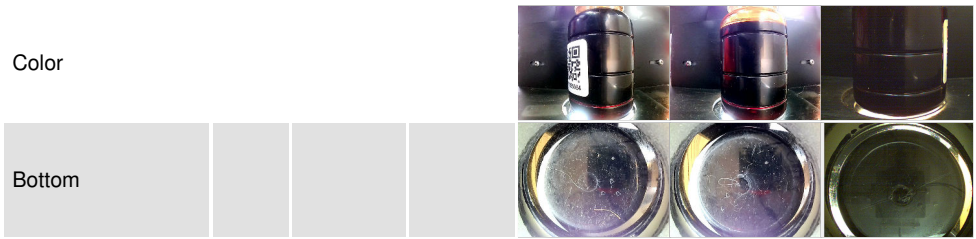


GRAPHS


Ferrous Alloys

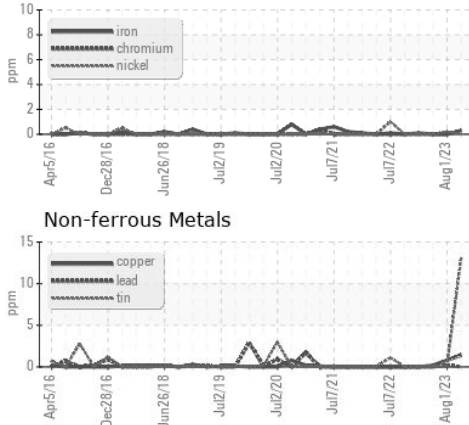


Non-ferrous Metals

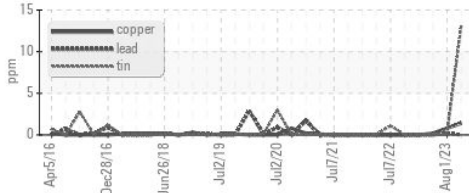


Viscosity @ 40°C

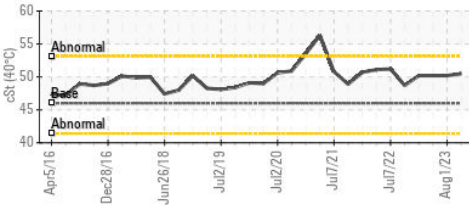

▲ Particle Count

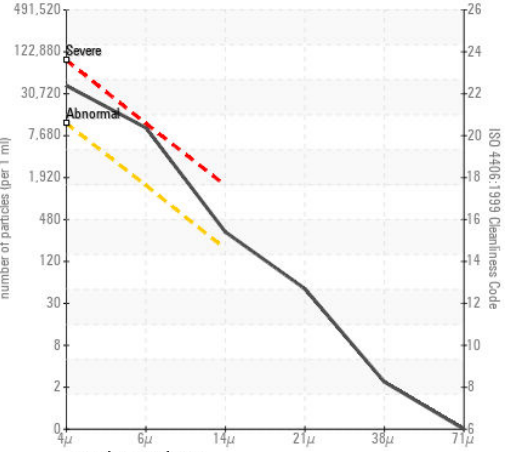

Acid Number

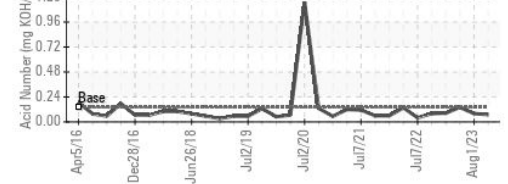

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0856084 **Received** : 17 Nov 2023
Lab Number : 06010748 **Diagnosed** : 20 Nov 2023
Unique Number : 10749892 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: PrtCount)

WHOLE STONE FARMS
 900 S PLATTE AVE
 FREMONT, NE
 US 68025
 Contact: JERRY SORRICK
 jasorrick@wholestonefarms.com
 T: (402)753-3434
 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)