




PROBLEM SUMMARY

Sample Rating Trend

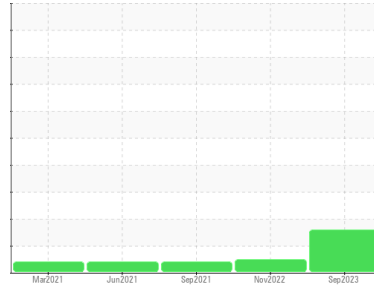

ISO




Machine Id
KAESER 7401857 (S/N 1019)

Component
Compressor

Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

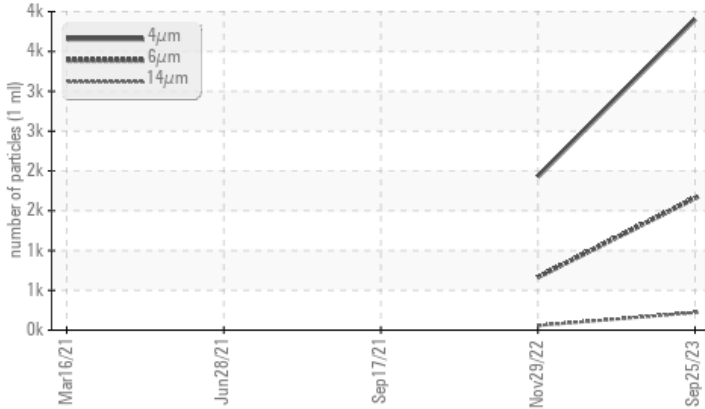

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	ABNORMAL
Particles >6µm	ASTM D7647	>1300	▲ 1659	667	---
Particles >14µm	ASTM D7647	>80	▲ 221	58	---
Particles >21µm	ASTM D7647	>20	▲ 63	8	---
Oil Cleanliness	ISO 4406 (c)	>--/17/13	▲ 19/18/15	18/17/13	---

Customer Id: VALHIG
Sample No.: KC120255
Lab Number: 06010804
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

29 Nov 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



17 Sep 2021 Diag: Don Baldrige

VIS DEBRIS



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



28 Jun 2021 Diag: Doug Bogart

VIS DEBRIS




No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. Please note that this is a corrected copy for laboratory data updates. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



Machine Id
KAESER 7401857 (S/N 1019)
Component
Compressor
Fluid
KAESER SIGMA (OEM) S-460 (--- GAL)

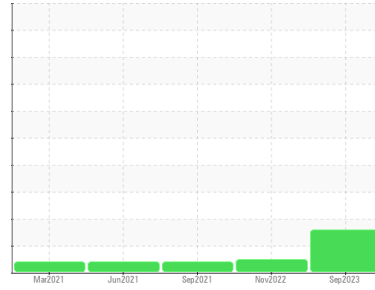

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	KC120255	KC105751	KC99912
Sample Date	Client Info	25 Sep 2023	29 Nov 2022	17 Sep 2021
Machine Age	hrs	7138	3972	2261
Oil Age	hrs	0	4498	1252
Oil Changed	Client Info	N/A	Changed	Not Chngd
Sample Status		ABNORMAL	NORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >50	0	<1	<1
Chromium	ppm	ASTM D5185m >10	0	0	0
Nickel	ppm	ASTM D5185m >3	0	0	0
Titanium	ppm	ASTM D5185m >3	0	0	0
Silver	ppm	ASTM D5185m >2	0	0	<1
Aluminum	ppm	ASTM D5185m >10	<1	0	2
Lead	ppm	ASTM D5185m >10	0	0	3
Copper	ppm	ASTM D5185m >50	5	9	3
Tin	ppm	ASTM D5185m >10	0	0	0
Antimony	ppm	ASTM D5185m	---	---	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m	0	0	<1
Barium	ppm	ASTM D5185m 90	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	0	0	<1
Magnesium	ppm	ASTM D5185m 90	14	9	48
Calcium	ppm	ASTM D5185m 2	0	0	0
Phosphorus	ppm	ASTM D5185m	6	3	2
Zinc	ppm	ASTM D5185m	28	18	0

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >25	0	<1	0
Sodium	ppm	ASTM D5185m	12	2	11
Potassium	ppm	ASTM D5185m >20	3	4	4
Water	%	ASTM D6304 >0.05	0.015	0.005	0.022
ppm Water	ppm	ASTM D6304 >500	156.3	51.3	222.8






FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	3904	1928	---
Particles >6µm	ASTM D7647 >1300	▲ 1659	667	---
Particles >14µm	ASTM D7647 >80	▲ 221	58	---
Particles >21µm	ASTM D7647 >20	▲ 63	8	---
Particles >38µm	ASTM D7647 >4	1	0	---
Particles >71µm	ASTM D7647 >3	0	0	---
Oil Cleanliness	ISO 4406 (c) >--/17/13	▲ 19/18/15	18/17/13	---

FLUID DEGRADATION

method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.4	0.42	0.40	0.370


OIL ANALYSIS REPORT

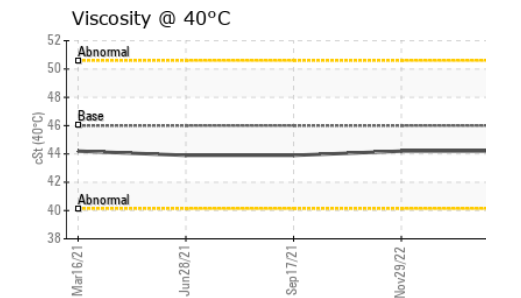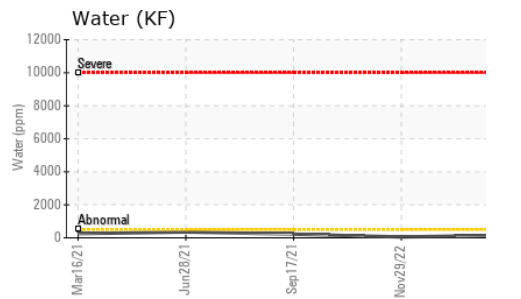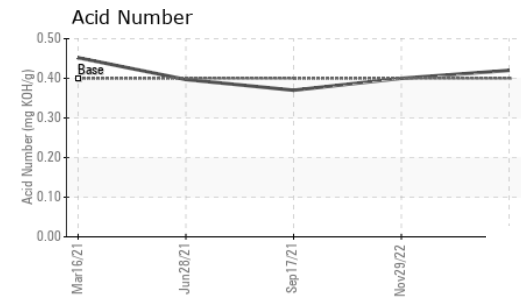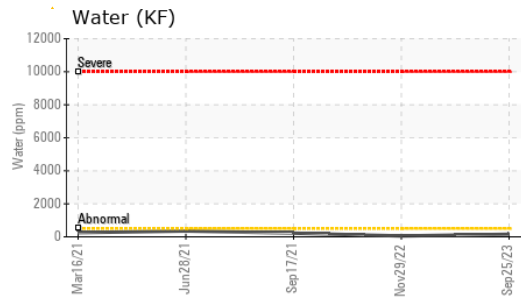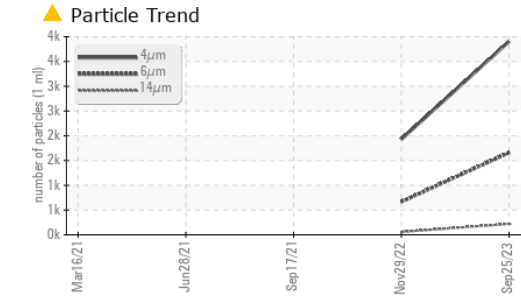






PARAMETER	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	44.2	44.2	43.9

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

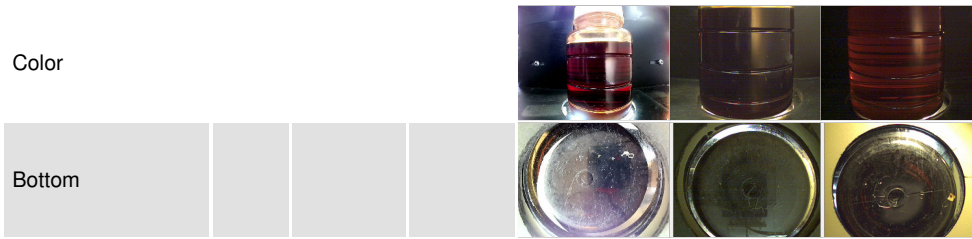

GRAPHS

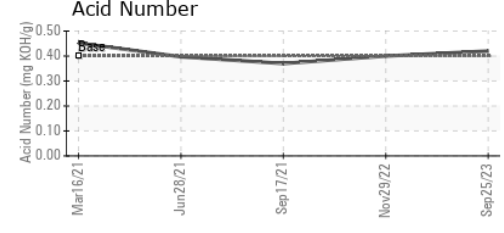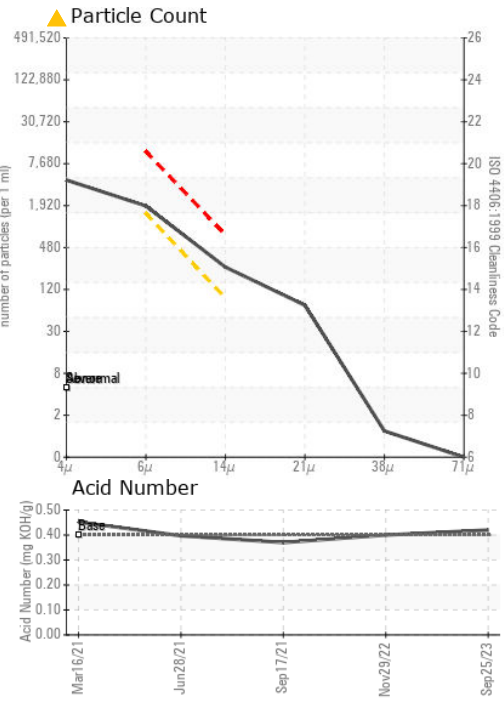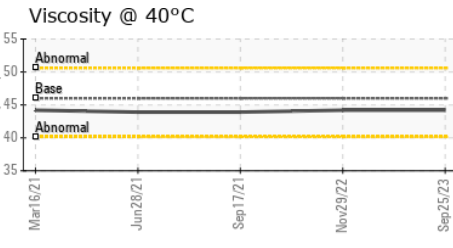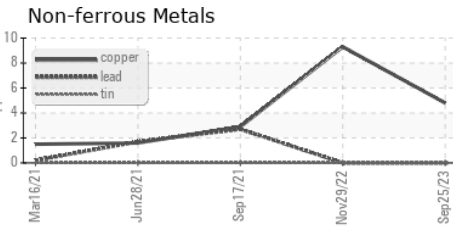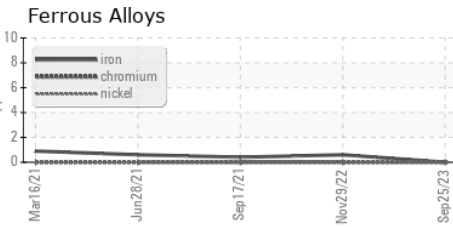

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KC120255 **Received** : 17 Nov 2023
Lab Number : 06010804 **Diagnosed** : 20 Nov 2023
Unique Number : 10749948 **Diagnostician** : Don Baldrige
Test Package : IND 2

VALEO FRONT END MODULE
 12240 OAKLAND PKWY
 HIGHLAND PARK, MI
 US 48203
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: