

PROBLEM SUMMARY

Sample Rating Trend

ISO


Machine Id **6299418 (S/N 1049)**

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

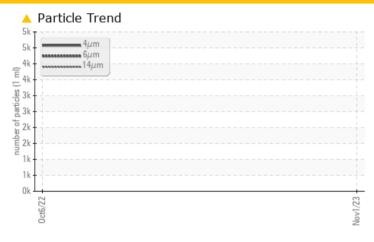

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ABNORMAL					
Particles >6µm	ASTM D7647	>1300	1803						
Particles >14µm	ASTM D7647	>80	220						
Particles >21µm	ASTM D7647	>20	△ 62						
Oil Cleanliness	ISO 4406 (c)	>/17/13	19/18/15						

Customer Id: DECSTE Sample No.: KCPA005146 Lab Number: 06010806 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

06 Oct 2022 Diag: Don Baldridge

WATER



Oil and filter change at the time of sampling has been noted. There is too much water present in this sample to perform a particle count. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. There is a light concentration of water present in the oil. The AN level is acceptable for this fluid.





OIL ANALYSIS REPORT

Sam



ISO



6299418 (S/N 1049)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			0et2022	Nov2023		
CAMPLE INCOR	AATIONI				111	1
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA005146	KCP47025	
Sample Date		Client Info		01 Nov 2023	06 Oct 2022	
Machine Age	yrs	Client Info		0	1025	
Oil Age	yrs	Client Info		0	270	
Oil Changed		Client Info		N/A	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	<1	
Copper	ppm	ASTM D5185m	>50	<1	8	
Tin	ppm	ASTM D5185m	>10	0	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	
Barium	ppm	ASTM D5185m	90	0	0	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m	100	67	47	
Calcium	ppm	ASTM D5185m	0	0	0	
Phosphorus	ppm	ASTM D5185m	0	8	31	
Zinc	ppm	ASTM D5185m	0	11	9	
Sulfur	ppm	ASTM D5185m	23500	18610	22562	
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	nnm	ASTM D5185m	>25	4	3	
Sodium	ppm	ASTM D5185m	>25	14	6	
Potassium	ppm	ASTM D5185m	>20	<1	0	
Water	ppm %	ASTM D5165111		0.019	△ 0.339	
ppm Water	ppm	ASTM D6304 ASTM D6304	>0.05 >500	195.8	△ 3390	
FLUID CLEANLIN		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	minu bass	4799		
Particles >6µm		ASTM D7647	>1300	△ 1803		
Particles >14µm		ASTM D7647	>80	<u>^</u> 220		
Particles >21µm		ASTM D7647	>20	<u>^</u> 62		
Particles >38µm		ASTM D7647	>4	2		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>19/18/15</u>		
FLUID DEGRADA		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.32	0.33	



OIL ANALYSIS REPORT





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCPA005146 : 06010806

: 10749950

Received Diagnosed

: 17 Nov 2023 : 20 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

DECOR STATUETTE 43742 MOUND

STERLING HEIGHTS, MI US 48314

Contact: Service Manager

T: F: