

# **PROBLEM SUMMARY**

#### Sample Rating Trend




# VILTER 7 (S/N REF1091)

**Refrigeration Compressor** 

USPI ALT-68 SC (--- GAL)

#### **COMPONENT CONDITION SUMMARY**

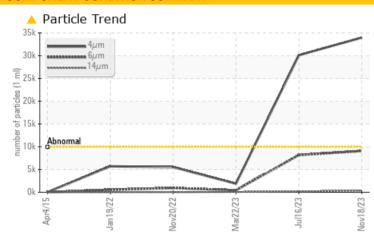

#### RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL	ABNORMAL	NORMAL			
Particles >4µm	ASTM D7647	>10000	<b>△</b> 33974	△ 30111	1886			
Particles >6µm	ASTM D7647	>2500	<b>9072</b>	<u></u> 8178	438			
Particles >14µm	ASTM D7647	>320	<b>△</b> 369	188	66			
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>22/20/16</b>	22/20/15	18/16/13			

Customer Id: CARBEAIL Sample No.: USP0003659 Lab Number: 06010924 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.

#### HISTORICAL DIAGNOSIS

#### 16 Jul 2023 Diag: Doug Bogart





Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 22 Mar 2023 Diag: Doug Bogart

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

# view report

#### 20 Nov 2022 Diag: Doug Bogart

#### NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





# **OIL ANALYSIS REPORT**

Sample Rating Trend

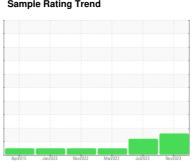

ISO



# **VILTER 7 (S/N REF1091)**

**Refrigeration Compressor** 

USPI ALT-68 SC (--- GAL)

#### **DIAGNOSIS**

#### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

There is a high amount of particulates present in the oil.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2015	Jan 2022 Nov 2022	Mar2023 Jul2023	Nov2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003659	USP255363	USP249472
Sample Date		Client Info		18 Nov 2023	16 Jul 2023	22 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0	0	0
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	0	<1	<1
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>8	0	0	0
Tin	ppm	ASTM D5185m	>4	0	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		2	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		1	1	<1
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	50	1	0	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	<1	0
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	0	<1	<1
Water	%	ASTM D6304	>0.01	0.005	0.002	0.003
ppm Water	ppm	ASTM D6304	>100	57.8	16.8	25.1
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	<b>33974</b>	▲ 30111	1886
Particles >6µm		ASTM D7647	>2500	<u> </u>	<u>▲</u> 8178	438
Particles >14µm		ASTM D7647	>320	<b>▲</b> 369	188	66
Particles >21µm		ASTM D7647	>80	60	21	16
Particles >38µm		ASTM D7647	>20	1	0	0
Particles >71µm		ASTM D7647	>4	0	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<u>22/20/16</u>	<u>22/20/15</u>	18/16/13
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.005	0.013	0.014	0.013



### **OIL ANALYSIS REPORT**

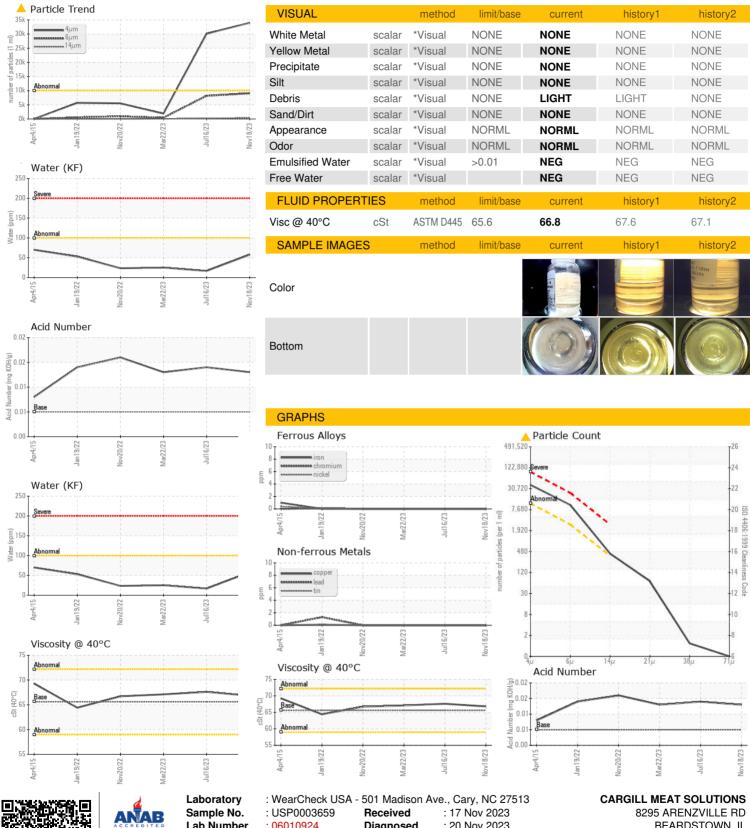



Certificate L2367

Lab Number **Unique Number** 

: 06010924 : 10750068 Test Package : IND 2

Diagnosed Diagnostician

: 20 Nov 2023 : Doug Bogart

BEARDSTOWN, IL US 62618

Contact:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (217)323-3774 F: