


## **PROBLEM SUMMARY**

#### Sample Rating Trend

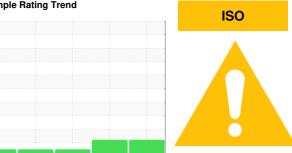


# VILTER 4

Component

**Refrigeration Compressor** 

USPI ALT-68 SC (--- GAL)

### **COMPONENT CONDITION SUMMARY**

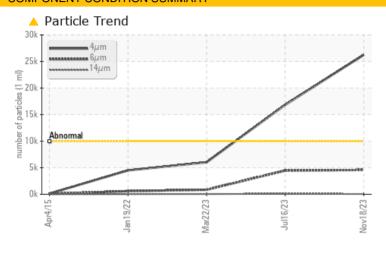

#### RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ATTENTION	NORMAL				
Particles >4µm	ASTM D7647	>10000	<b>26245</b>	<u>▲</u> 16836	6027				
Particles >6µm	ASTM D7647	>2500	<b>4583</b>	<b>4460</b>	856				
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>22/19/13</b>	<u>^</u> 21/19/14	20/17/13				

Customer Id: CARBEAIL Sample No.: USP0003655 Lab Number: 06010928 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

#### HISTORICAL DIAGNOSIS

#### 16 Jul 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 22 Mar 2023 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 19 Jan 2022 Diag: Doug Bogart

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The amount and size of particulates present in the system is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





## **OIL ANALYSIS REPORT**

Sample Rating Trend

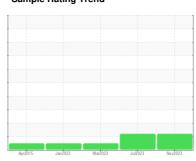



VILTER 4 Component

**Refrigeration Compressor** 

USPI ALT-68 SC (--- GAL)

### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Apr2015	Jan 2022	Mar2023 Jul2023	Nov2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003655	USP255361	USP249470
Sample Date		Client Info		18 Nov 2023	16 Jul 2023	22 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ATTENTION	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0	0	<1
Chromium	ppm	ASTM D5185m	>2	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	0	<1	<1
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m		0	0	0
Tin	ppm	ASTM D5185m	>4	<1	0	0
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		<1	0	0
Calcium	ppm	ASTM D5185m		0	1	0
Phosphorus	ppm	ASTM D5185m		1	0	<1
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	50	0	3	0
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	<1	0
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	0	1	<1
Water	%	ASTM D6304		0.004	0.003	0.004
ppm Water	ppm	ASTM D6304	>100	43.4	32.9	43.0
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	<u>^</u> 26245	<u>16836</u>	6027
Particles >6µm		ASTM D7647	>2500	<b>4583</b>	<u>4460</u>	856
Particles >14µm		ASTM D7647	>320	62	99	46
Particles >21µm		ASTM D7647	>80	9	10	14
Particles >38µm		ASTM D7647	>20	0	0	0
Particles >71µm		ASTM D7647	>4	0	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	<u>22/19/13</u>	<u>^</u> 21/19/14	20/17/13
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2



### **OIL ANALYSIS REPORT**

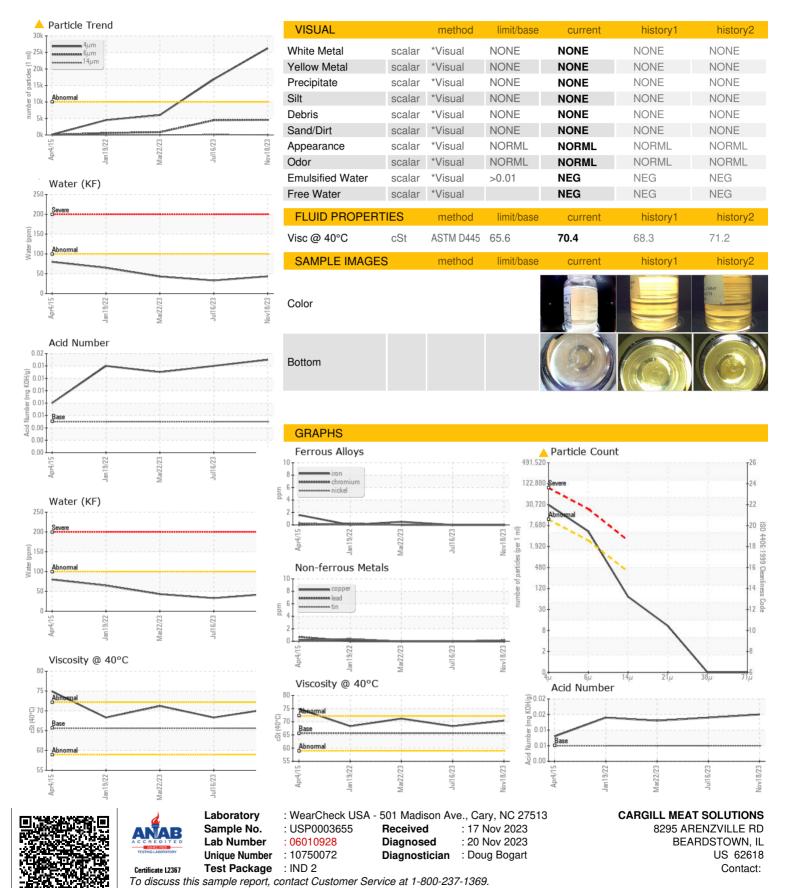

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F:

T: (217)323-3774