




# PROBLEM SUMMARY

Sample Rating Trend

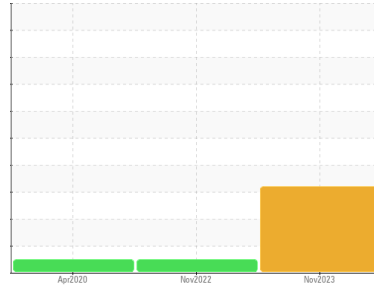

**WATER**




Machine Id  
**KAESER SX 5 6757098 (S/N 1017)**

Component  
**Compressor**


Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## COMPONENT CONDITION SUMMARY

▲ Particle Trend

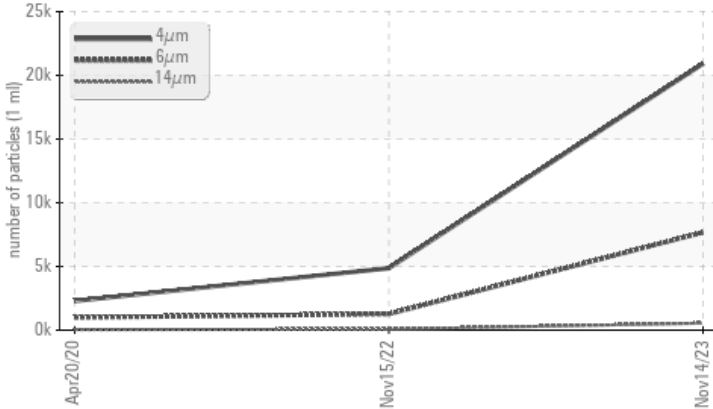

▲ Water (KF)

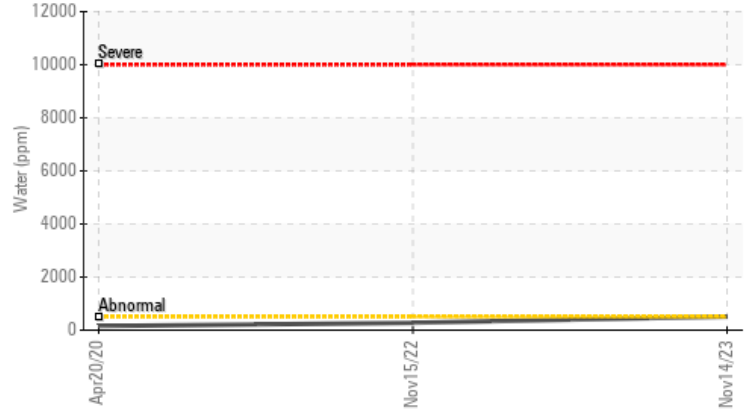

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	NORMAL	NORMAL
Water	%	ASTM D6304	>0.05	▲ 0.050	0.027	0.015
ppm Water	ppm	ASTM D6304	>500	▲ 509.5	276.3	156.1
Particles >6µm		ASTM D7647	>1300	▲ 7677	1268	994
Particles >14µm		ASTM D7647	>80	▲ 550	70	41
Particles >21µm		ASTM D7647	>20	▲ 126	12	4
Oil Cleanliness		ISO 4406 (c)	>17/13	▲ 20/16	17/13	17/13

Customer Id: REBNEW  
 Sample No.: KCPA007688  
 Lab Number: 06013354  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

*There are no recommended actions for this sample.*

## HISTORICAL DIAGNOSIS

### 15 Nov 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



---

### 20 Apr 2020 Diag: Jonathan Hester

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



# OIL ANALYSIS REPORT

Sample Rating Trend

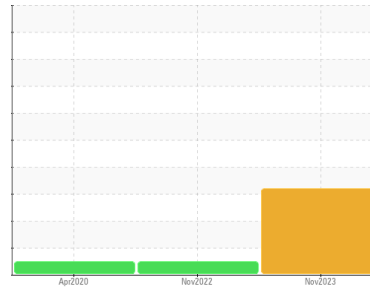

**WATER**



Machine Id  
**KAESER SX 5 6757098 (S/N 1017)**

Component  
**Compressor**

Fluid  
**KAESER SIGMA (OEM) M-460 (--- GAL)**

**DIAGNOSIS**

**Recommendation**

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

**Wear**

All component wear rates are normal.

**Contamination**

There is a high amount of particulates present in the oil. There is a trace of moisture present in the oil.

**Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

**SAMPLE INFORMATION**

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>KCPA007688</b>	KCP47577	KCP26510
Sample Date	Client Info		<b>14 Nov 2023</b>	15 Nov 2022	20 Apr 2020
Machine Age	hrs	Client Info	<b>6473</b>	5251	2073
Oil Age	hrs	Client Info	<b>0</b>	1480	2073
Oil Changed	Client Info		<b>N/A</b>	Changed	Changed
Sample Status			<b>ABNORMAL</b>	NORMAL	NORMAL

**WEAR METALS**

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>0</b>	1	3
Chromium	ppm	ASTM D5185m >10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m >3	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m >3	<b>0</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	<1	0
Aluminum	ppm	ASTM D5185m >10	<b>0</b>	0	0
Lead	ppm	ASTM D5185m >10	<b>0</b>	0	<1
Copper	ppm	ASTM D5185m >50	<b>0</b>	3	2
Tin	ppm	ASTM D5185m >10	<b>&lt;1</b>	<1	<1
Antimony	ppm	ASTM D5185m	<b>---</b>	---	0
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

**ADDITIVES**

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	0	<1
Barium	ppm	ASTM D5185m 90	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185m 100	<b>65</b>	58	67
Calcium	ppm	ASTM D5185m 0	<b>2</b>	0	3
Phosphorus	ppm	ASTM D5185m 0	<b>3</b>	31	2
Zinc	ppm	ASTM D5185m 0	<b>7</b>	2	14
Sulfur	ppm	ASTM D5185m 23500	<b>18438</b>	23406	24729

**CONTAMINANTS**

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>0</b>	<1	<1
Sodium	ppm	ASTM D5185m	<b>16</b>	18	17
Potassium	ppm	ASTM D5185m >20	<b>1</b>	2	2
Water	%	ASTM D6304 >0.05	<b>▲ 0.050</b>	0.027	0.015
ppm Water	ppm	ASTM D6304 >500	<b>▲ 509.5</b>	276.3	156.1






**FLUID CLEANLINESS**

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		<b>20914</b>	4866	2295
Particles >6µm	ASTM D7647	>1300	<b>▲ 7677</b>	1268	994
Particles >14µm	ASTM D7647	>80	<b>▲ 550</b>	70	41
Particles >21µm	ASTM D7647	>20	<b>▲ 126</b>	12	4
Particles >38µm	ASTM D7647	>4	<b>2</b>	1	0
Particles >71µm	ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c)	>17/13	<b>▲ 20/16</b>	17/13	17/13

**FLUID DEGRADATION**

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 1.0	<b>0.30</b>	0.35	0.319


# OIL ANALYSIS REPORT

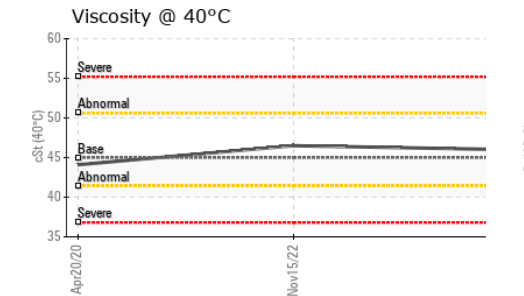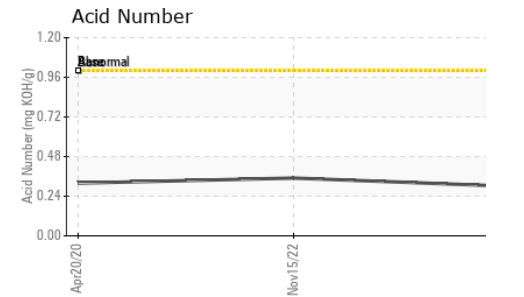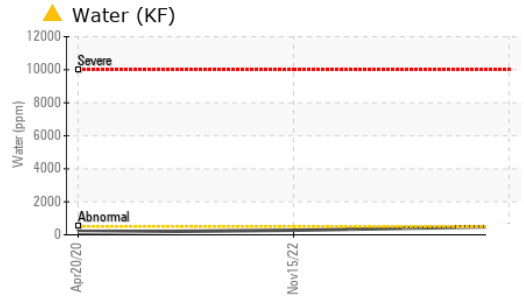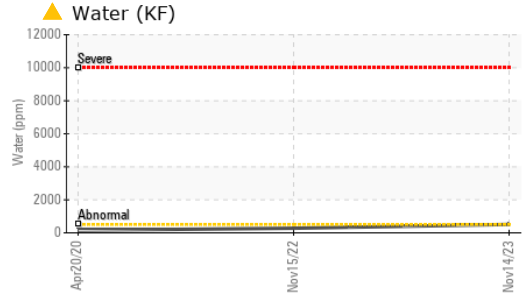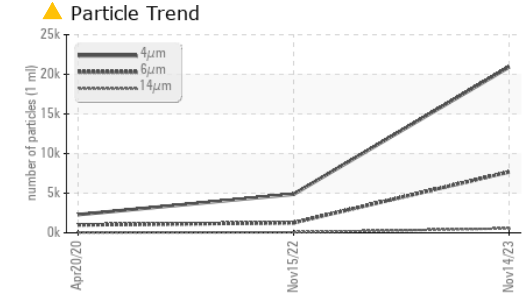






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 45	46.0	46.5	44.1

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

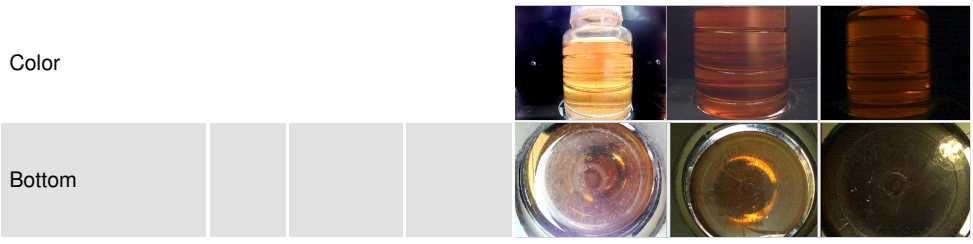

## GRAPHS

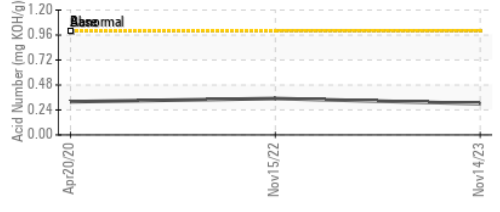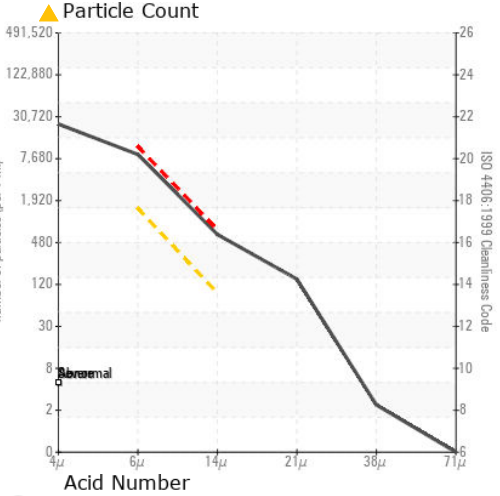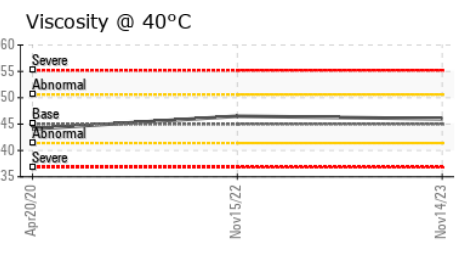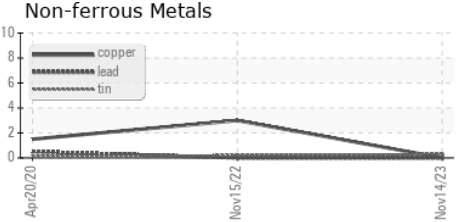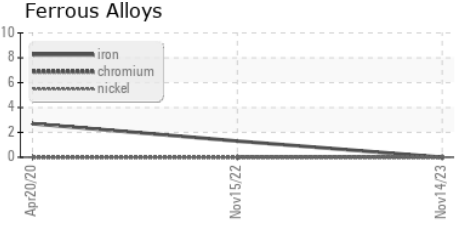

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : KCPA007688 **Received** : 20 Nov 2023  
**Lab Number** : 06013354 **Diagnosed** : 22 Nov 2023  
**Unique Number** : 10752498 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

**REBAR FAB**  
 720 FIRST ST SW  
 NEW BRIGHTON, MN  
 US 55112  
 Contact:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:  
F: