

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS

Machine Id
HEB_MLU4
Component
Lube System
Fluid
NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ABNORMAL	ABNORMAL				
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER				

Customer Id: ENEHEB Sample No.: RP0036155 Lab Number: 06026615 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

21 Jul 2023 Diag: Don Baldridge

VIS DEBRIS



We recommend you service the filters on this component. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend







HEB_MLU4

Lube System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

We suspect abnormal contamination may be due to sampling method. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil. The water content is negligible.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Jul2023	Nov2023		
SAMPLE INFOR	MATION	method	limit/base		hiotomat	history ()
	VIATION		IIIIIVbase	current	history1	history2
Sample Number		Client Info		RP0036155	RP0032763	
Sample Date		Client Info		16 Nov 2023	21 Jul 2023	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	<1	
Chromium	ppm	ASTM D5185m	>20	0	0	
Nickel	ppm	ASTM D5185m	>20	0	0	
Titanium	ppm	ASTM D5185m		0	<1	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>20	<1	<1	
Lead	ppm	ASTM D5185m	>20	0	0	
Copper	ppm	ASTM D5185m	>20	5	6	
Tin	ppm	ASTM D5185m	>20	1	1	
Vanadium	ppm	ASTM D5185m		<1	<1	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		<1	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		75	74	
Calcium	ppm	ASTM D5185m		10	8	
Phosphorus	ppm	ASTM D5185m		7	9	
Zinc	ppm	ASTM D5185m		19	10	
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	8	<1	
Sodium	ppm	ASTM D5185m		4	4	
Potassium	ppm	ASTM D5185m	>20	<1	<1	
Water	%	ASTM D6304	>0.05	0.010	0.018	
ppm Water	ppm	ASTM D6304	>500	101	189.3	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.30	0.29	
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	
Free Water	scalar	*Visual		NEG	on: Stella Mar	nagerENEHEB



OIL ANALYSIS REPORT

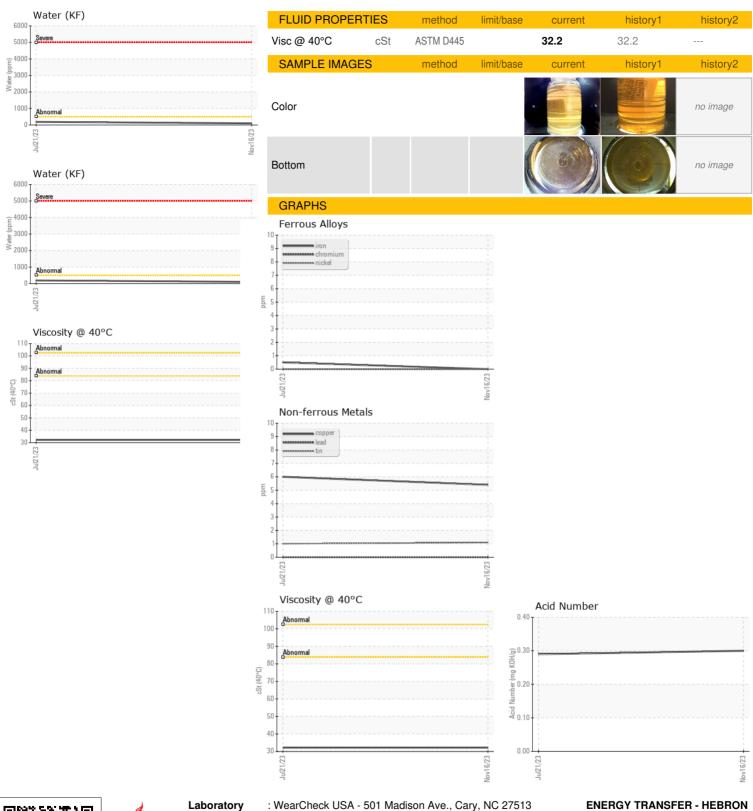



Certificate L2367

Laboratory Sample No. Lab Number Test Package : IND 2

Unique Number : 10776406

: RP0036155 : 06026615

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 06 Dec 2023 : 08 Dec 2023 Diagnosed Diagnostician : Jonathan Hester HEBRON, KY

US 41048 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: