


# **OIL ANALYSIS REPORT**

## Sample Rating Trend





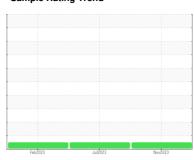

# Machine Id MAY MLU1 Component Lube System Fluid

NOT GIVEN (--- GAL)

#### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

The water content is negligible. There is no indication of any contamination in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Feb2023 Jul2023 Nov2023						
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0037028	RP0032171	RP0032791
Sample Date		Client Info		28 Nov 2023	27 Jul 2023	27 Feb 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	<1	0
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	0	<1
Lead	ppm	ASTM D5185m	>20	0	<1	0
Copper	ppm	ASTM D5185m	>20	4	3	2
Tin	ppm	ASTM D5185m	>20	<1	1	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		<1	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		84	84	90
Calcium	ppm	ASTM D5185m		2	<1	1
Phosphorus	ppm	ASTM D5185m		1	0	4
Zinc	ppm	ASTM D5185m		5	3	0
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	2	2
Sodium	ppm	ASTM D5185m		3	0	<1
Potassium	ppm	ASTM D5185m	>20	0	<1	0
Water	%	ASTM D6304	>0.05	0.012	0.019	0.031
ppm Water	ppm	ASTM D6304	>500	126	192.5	310.7
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.35	0.34	0.31
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	LIGHT	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
					11 11-00 1 1 1 1	EALEDOI


scalar \*Visual

ationEGaig MorganNEGNEROL

NEG



## **OIL ANALYSIS REPORT**

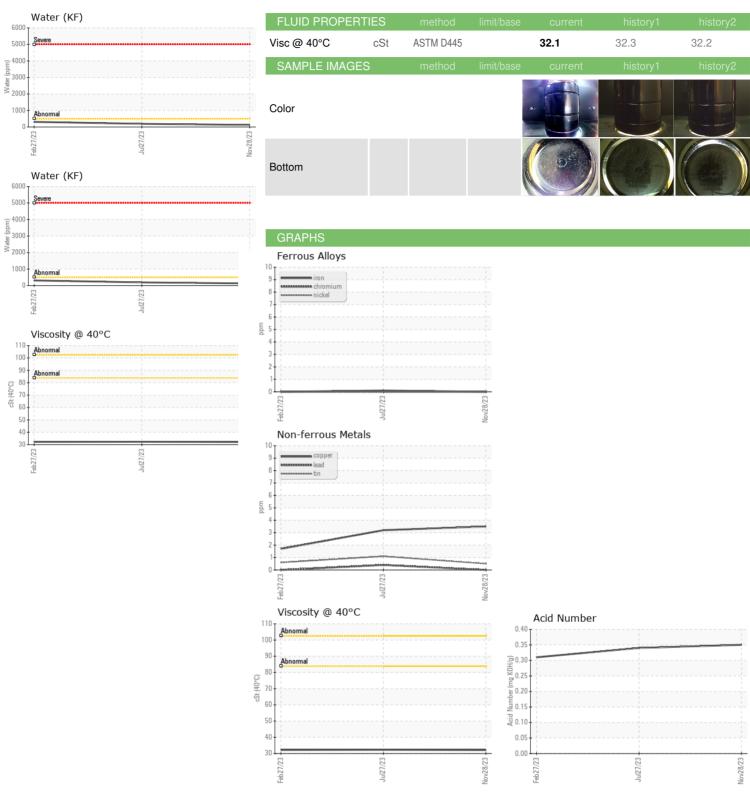





Laboratory Sample No.

Lab Number **Unique Number** 

: RP0037028 : 06026618 : 10776409 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 06 Dec 2023

: 08 Dec 2023 Diagnosed Diagnostician : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**ENERGY TRANSFER - MAYERSVILLE STATION** 

21123 HWY 1 ROLLING FORK, MS

US 39159 Contact: Craig Morgan

craig.morgan@energytransfer.com T: 1(662)816-8346

F: (833)944-0464