




PROBLEM SUMMARY

Sample Rating Trend

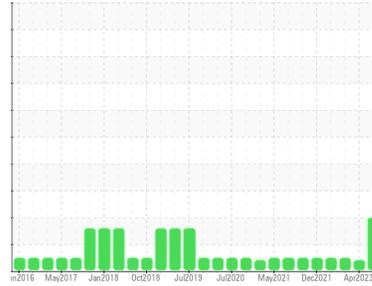

WATER



Machine Id
GARDNER DENVER D047536 - SNIDER TIRE

Component
Compressor

Fluid
GARDNER DENVER AEON 4000 (2 GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We advise that you follow the water drain-off procedure for this component. The filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	ABNORMAL	NORMAL
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER	LIGHT
Free Water	scalar	*Visual		▲ 1.0	NEG	NEG

Customer Id: PALFOU
Sample No.: WC0845207
Lab Number: 06027830
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Water Drain-off	---	---	?	We advise that you follow the water drain-off procedure for this component.
Resample	---	---	?	We recommend an early resample to monitor this condition.

HISTORICAL DIAGNOSIS

26 Apr 2023 Diag: Don Baldrige

VIS DEBRIS



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



21 Jul 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



15 Apr 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

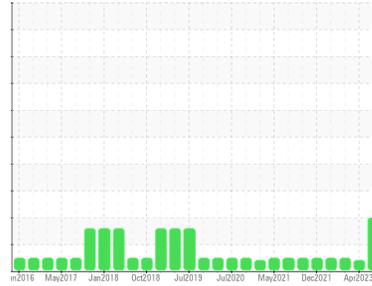

WATER



Machine Id **GARDNER DENVER D047536 - SNIDER TIRE**

Component
Compressor
Fluid
GARDNER DENVER AEON 4000 (2 GAL)

DIAGNOSIS

▲ Recommendation

We advise that you follow the water drain-off procedure for this component. The filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil. Free water present.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0845207	WC0795261	WC0705715
Sample Date	Client Info		08 Nov 2023	26 Apr 2023	21 Jul 2022
Machine Age	hrs	Client Info	46700	44770	11486
Oil Age	hrs	Client Info	2000	0	1
Oil Changed	Client Info		Not Changed	Changed	Not Changed
Sample Status			ABNORMAL	ABNORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	0	<1	<1
Chromium	ppm	ASTM D5185m >10	0	0	0
Nickel	ppm	ASTM D5185m	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >25	0	<1	1
Lead	ppm	ASTM D5185m >25	0	0	0
Copper	ppm	ASTM D5185m >50	<1	<1	<1
Tin	ppm	ASTM D5185m >15	0	0	<1
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0
Barium	ppm	ASTM D5185m 20	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	0
Magnesium	ppm	ASTM D5185m	0	0	0
Calcium	ppm	ASTM D5185m 20	0	0	0
Phosphorus	ppm	ASTM D5185m 320	3	4	6
Zinc	ppm	ASTM D5185m 20	0	0	6
Sulfur	ppm	ASTM D5185m 1400	3448	3944	3330

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	10	16	9
Sodium	ppm	ASTM D5185m	2	<1	0
Potassium	ppm	ASTM D5185m >20	0	0	0
Water	%	ASTM D6304 >0.1	0.043	---	---
ppm Water	ppm	ASTM D6304 >1000	430	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.06	---	0.029	0.05




OIL ANALYSIS REPORT

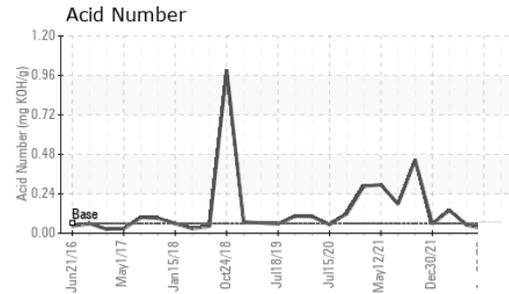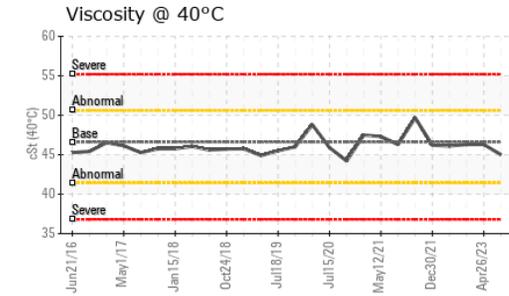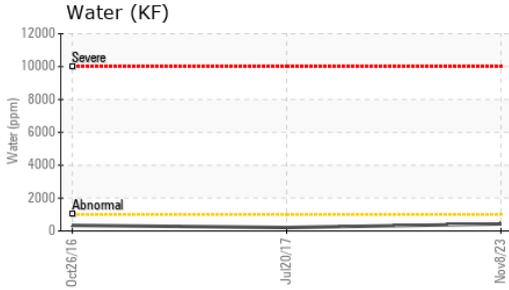





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	▲ MODER	▲ MODER	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	0.2%	NEG
Free Water	scalar	*Visual		▲ 1.0	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	46.6	45.0	46.3

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

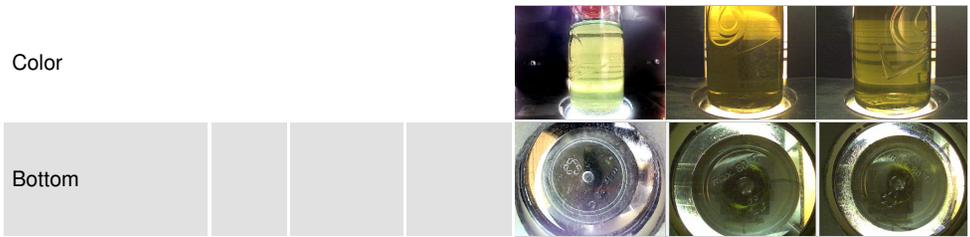

GRAPHS

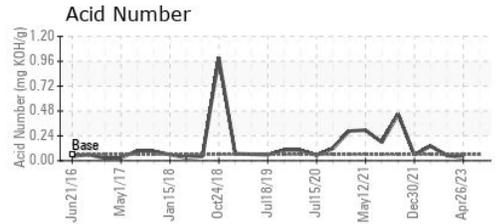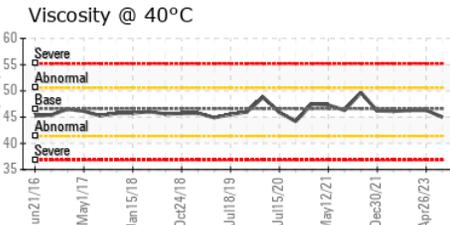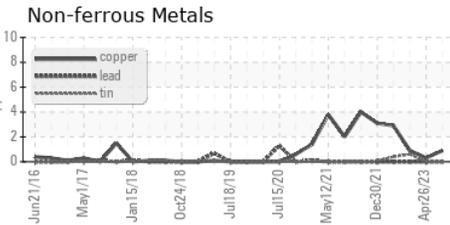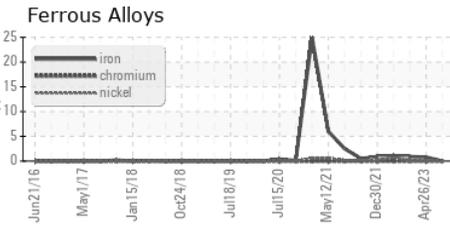

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
 Sample No. : WC0845207
 Lab Number : 06027830
 Unique Number : 10777621
 Test Package : IND 2 (Additional Tests: KF)

ELEVATED INDUSTRIAL SOLUTIONS - EIS
 302 HUGHES ST
 FOUNTAIN INN, SC
 US 29644
 Contact: DARRIN WARD
 dward@elevatedindustrial.com
 T:
 F: (864)862-7653

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)