




# PROBLEM SUMMARY

Sample Rating Trend

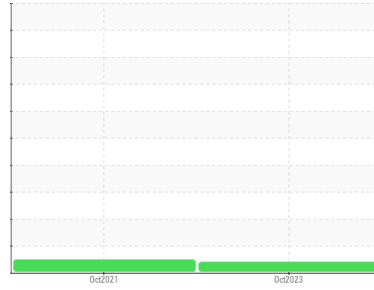

**VIS DEBRIS**



Machine Id  
**KAESER 5339184 - PRECISION GRANITE AND MAR (S/N 1088)**  
 Component  
**Compressor**  
 Fluid  
**NOT GIVEN (--- GAL)**

## COMPONENT CONDITION SUMMARY

No relevant graphs to display

## RECOMMENDATION

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status				<b>ABNORMAL</b>	NORMAL	---
Debris	scalar	*Visual	NONE	<b>▲ MODER</b>	LIGHT	---

**Customer Id:** PALFOU  
**Sample No.:** WC0845124  
**Lab Number:** 06027846  
**Test Package:** IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	Oil and filter change at the time of sampling has been noted.
Change Filter	---	---	?	Oil and filter change at the time of sampling has been noted.

## HISTORICAL DIAGNOSIS

**06 Oct 2021 Diag: Angela Borella**

NORMAL



Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report






# OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

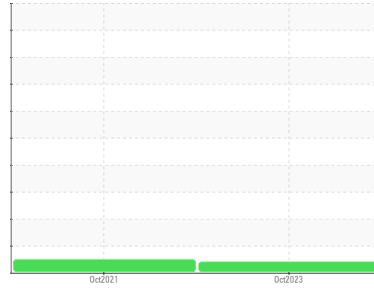

Machine Id  
**KAESER 5339184 - PRECISION GRANITE AND MAR (S/N 1088)**

Component  
**Compressor**  
Fluid  
**NOT GIVEN (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### ▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0845124</b>	WC0622164	---
Sample Date	Client Info		<b>11 Oct 2023</b>	06 Oct 2021	---
Machine Age	hrs	Client Info	<b>18038</b>	13117	---
Oil Age	hrs	Client Info	<b>2000</b>	4379	---
Oil Changed	Client Info		<b>Changed</b>	Changed	---
Sample Status			<b>ABNORMAL</b>	NORMAL	---

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.05	<b>NEG</b>	NEG	---

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>0</b>	<1	---
Chromium	ppm	ASTM D5185m >10	<b>0</b>	0	---
Nickel	ppm	ASTM D5185m >3	<b>0</b>	0	---
Titanium	ppm	ASTM D5185m >3	<b>0</b>	0	---
Silver	ppm	ASTM D5185m >2	<b>0</b>	<1	---
Aluminum	ppm	ASTM D5185m >10	<b>0</b>	2	---
Lead	ppm	ASTM D5185m >10	<b>0</b>	<1	---
Copper	ppm	ASTM D5185m >50	<b>9</b>	8	---
Tin	ppm	ASTM D5185m >10	<b>0</b>	0	---
Antimony	ppm	ASTM D5185m	<b>---</b>	0	---
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	---
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	---

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	<b>0</b>	<1	---
Barium	ppm	ASTM D5185m	<b>0</b>	0	---
Molybdenum	ppm	ASTM D5185m	<b>0</b>	0	---
Manganese	ppm	ASTM D5185m	<b>&lt;1</b>	<1	---
Magnesium	ppm	ASTM D5185m	<b>35</b>	37	---
Calcium	ppm	ASTM D5185m	<b>0</b>	0	---
Phosphorus	ppm	ASTM D5185m	<b>3</b>	3	---
Zinc	ppm	ASTM D5185m	<b>80</b>	72	---
Sulfur	ppm	ASTM D5185m	<b>18105</b>	17823	---

## CONTAMINANTS



	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>0</b>	0	---
Sodium	ppm	ASTM D5185m	<b>20</b>	19	---
Potassium	ppm	ASTM D5185m >20	<b>3</b>	3	---

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	<b>0.25</b>	0.278	---



# OIL ANALYSIS REPORT

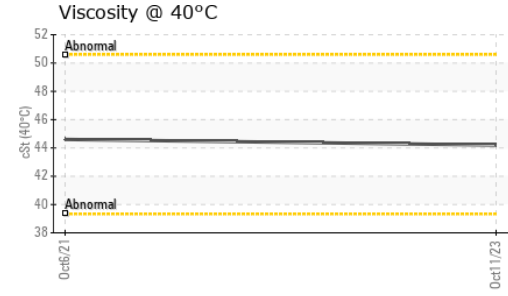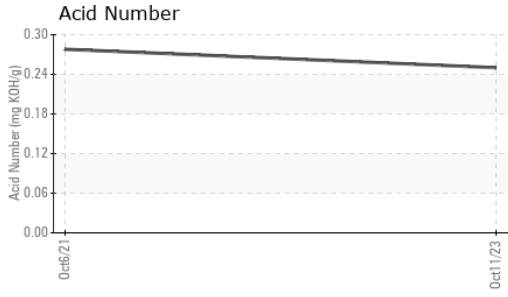





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	44.2	44.6	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color						no image
Bottom						no image

## GRAPHS

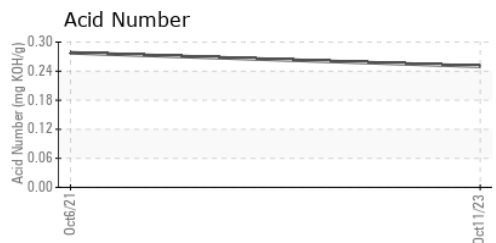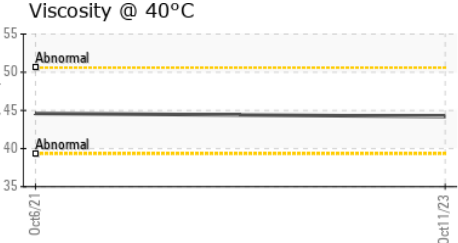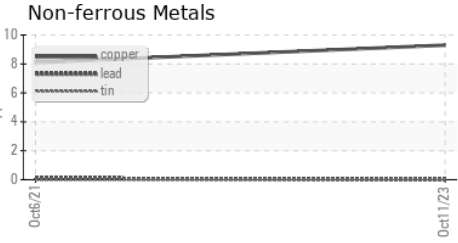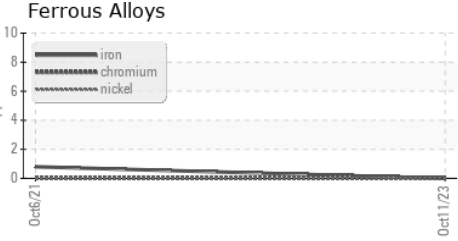

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : WC0845124      **Received** : 07 Dec 2023  
**Lab Number** : 06027846      **Diagnosed** : 09 Dec 2023  
**Unique Number** : 10777637      **Diagnostician** : Don Baldrige  
**Test Package** : IND 2

**ELEVATED INDUSTRIAL SOLUTIONS - EIS**  
 302 HUGHES ST  
 FOUNTAIN INN, SC  
 US 29644  
 Contact: DARRIN WARD  
 dward@elevatedindustrial.com  
 T:  
 F: (864)862-7653

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)