


PROBLEM SUMMARY


MELT SHOP - CRANES **UPPER HYD UNIT E-CRANE**

Hydraulic System

AW HYDRAULIC OIL ISO 46 (--- GAL)

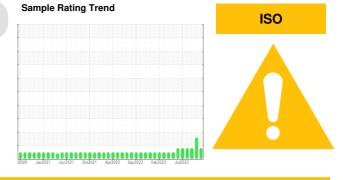

COMPONENT CONDITION SUMMARY

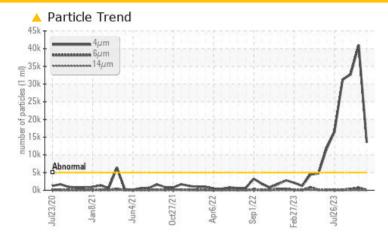

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL	SEVERE	ABNORMAL					
Particles >4µm	ASTM D7647	>5000	<u> </u>	4 0970	▲ 32696					
Oil Cleanliness	ISO 4406 (c)	>19/17/14	2 1/13/9	23/17/10	22/16/11					

Customer Id: OUTCALAL **Sample No.:** RP0038066 Lab Number: 06028669 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Resample			?	We recommend an early resample to monitor this condition.
Alert			?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.
Information Required			?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

HISTORICAL DIAGNOSIS

07 Nov 2023 Diag: Wes Davis

ISO

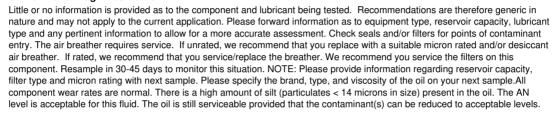



ISO

20 Oct 2023 Diag: Wes Davis

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The water content is negligible. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.





27 Sep 2023 Diag: Wes Davis

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.





OIL ANALYSIS REPORT

SAMPLE INFORMATION

Sample Rating Trend

ISO



MELT SHOP - CRANES UPPER HYD UNIT E-CRANE

Hydraulic System

AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We recommend you service the filters on this component. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear


All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The water content is negligible.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

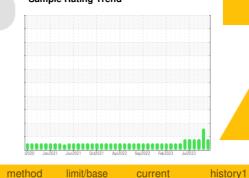

Sample Number		Client Info		RP0038066	RP0035324	RP0038385
Sample Date		Client Info		06 Dec 2023	07 Nov 2023	20 Oct 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	SEVERE	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	3	2	4
Chromium	ppm	ASTM D5185m	>20	2	1	2
Nickel	ppm	ASTM D5185m	>20	0	0	<1
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	0	0
Lead	ppm	ASTM D5185m	>20	0	0	0
Copper	ppm	ASTM D5185m	>20	2	1	1
Tin	ppm	ASTM D5185m	>20	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	0
Barium	ppm	ASTM D5185m	5	0	0	0
Molybdenum	ppm	ASTM D5185m	5	0	<1	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m	25	<1	0	4
Calcium	ppm	ASTM D5185m	200	50	35	51
Phosphorus	ppm	ASTM D5185m	300	332	278	323
Zinc	ppm	ASTM D5185m	370	420	403	420
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	2
Sodium	ppm	ASTM D5185m		2	1	1
Potassium	ppm	ASTM D5185m	>20	<1	<1	1
Water	%	ASTM D6304	>0.05	0.003	0.003	0.006
ppm Water	ppm	ASTM D6304	>500	32	36.3	64.1
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<u> </u>	4 0970	▲ 32696
Particles >6µm		ASTM D7647	>1300	57	730	342
Particles >14µm		ASTM D7647	>160	3	8	16
Particles >21µm		ASTM D7647	>40	0	2	4
Particles >38µm		ASTM D7647	>10	0	1	1
Particles >71μm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u> </u>	23/17/10	<u>22/16/11</u>
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.57	0.37	0.39	0.44



OIL ANALYSIS REPORT







Laboratory Sample No. Lab Number

Unique Number

: 06028669 : 10778460 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 07 Dec 2023 : RP0038066 Received : 09 Dec 2023 Diagnosed

Diagnostician : Wes Davis

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

OUTOKUMPU STAINLESS USA

HWY 43 N CALVERT, AL US 36513

Contact: MARIO JOHNSON Mario.johnson@outokumpu.com

T: (251)321-4105

F: x: