




# PROBLEM SUMMARY

Sample Rating Trend

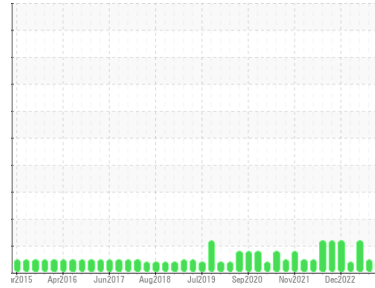

VIS DEBRIS



Area  
**ENGINE ROOM 2**  
 Machine Id  
**ER2 SC101 (S/N TDSH193L3287D)**  
 Component  
**Refrigeration Compressor**  
 Fluid  
**USPI 1009-68 SC (40 GAL)**

## COMPONENT CONDITION SUMMARY

No relevant graphs to display

## RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. NOT RUNNING

## PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	NORMAL	ATTENTION
Debris	scalar *Visual	▲ MODER	NONE	LIGHT

Customer Id: CONTROUSP  
 Sample No.: USP0004004  
 Lab Number: 06029436  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Doug Bogart +1 (800)237-1369 x4016  
[dougb@wearcheckusa.com](mailto:dougb@wearcheckusa.com)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

## HISTORICAL DIAGNOSIS

### 31 Aug 2023 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



### 14 Jun 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



### 14 Mar 2023 Diag: Doug Bogart

VIS DEBRIS



We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





# OIL ANALYSIS REPORT

Sample Rating Trend

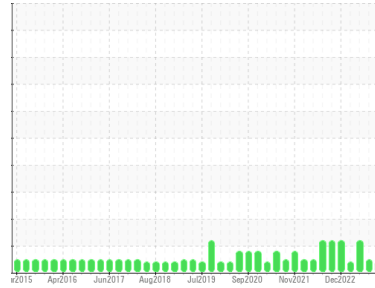

VIS DEBRIS



Area  
**ENGINE ROOM 2**  
Machine Id  
**ER2 SC101 (S/N TDSH193L3287D)**  
Component  
**Refrigeration Compressor**  
Fluid  
**USPI 1009-68 SC (40 GAL)**

## DIAGNOSIS

### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. NOT RUNNING

### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>USP0004004</b>	USP0000201	USP242680
Sample Date	Client Info		<b>22 Nov 2023</b>	31 Aug 2023	14 Jun 2023
Machine Age	hrs	Client Info	<b>2002</b>	1982	1970
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>ABNORMAL</b>	NORMAL	ATTENTION

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	<b>0</b>	0	<1
Chromium	ppm	ASTM D5185m >2	<b>&lt;1</b>	0	0
Nickel	ppm	ASTM D5185m	<b>0</b>	0	<1
Titanium	ppm	ASTM D5185m	<b>0</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m >3	<b>&lt;1</b>	0	0
Lead	ppm	ASTM D5185m >2	<b>0</b>	0	0
Copper	ppm	ASTM D5185m >8	<b>0</b>	0	0
Tin	ppm	ASTM D5185m >4	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	<b>0</b>	0	0
Barium	ppm	ASTM D5185m	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m	<b>0</b>	0	0
Calcium	ppm	ASTM D5185m	<b>0</b>	0	1
Phosphorus	ppm	ASTM D5185m	<b>0</b>	0	0
Zinc	ppm	ASTM D5185m	<b>0</b>	2	2
Sulfur	ppm	ASTM D5185m 50	<b>0</b>	19	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<b>&lt;1</b>	0	0
Sodium	ppm	ASTM D5185m	<b>0</b>	0	0
Potassium	ppm	ASTM D5185m >20	<b>&lt;1</b>	0	0
Water	%	ASTM D6304 >0.01	<b>0.003</b>	0.003	0.004
ppm Water	ppm	ASTM D6304 >100	<b>36</b>	30.4	42.5

## FLUID CLEANLINESS




	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	---	6886	▲ 15360
Particles >6µm	ASTM D7647	>2500	---	1817	▲ 3662
Particles >14µm	ASTM D7647	>320	---	65	100
Particles >21µm	ASTM D7647	>80	---	11	14
Particles >38µm	ASTM D7647	>20	---	1	0
Particles >71µm	ASTM D7647	>4	---	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/15	---	20/18/13	▲ 21/19/14

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974 0.005	<b>0.016</b>	0.013	0.012




# OIL ANALYSIS REPORT

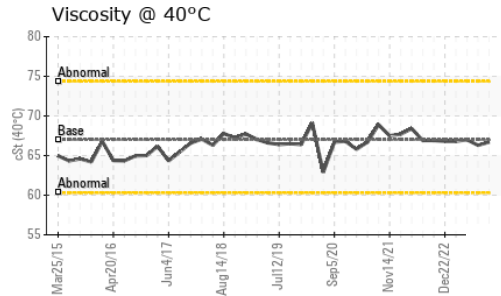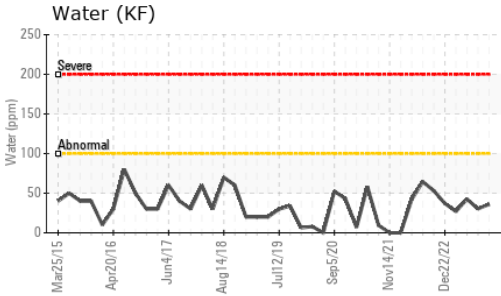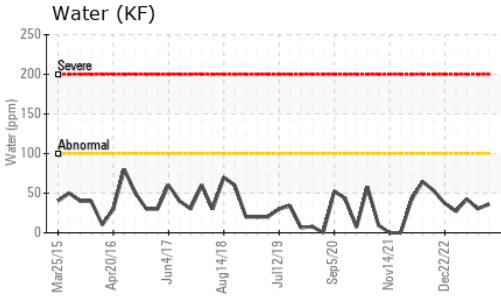





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	▲ MODER	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.01	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 67	66.7	66.3	67.0

### SAMPLE IMAGES

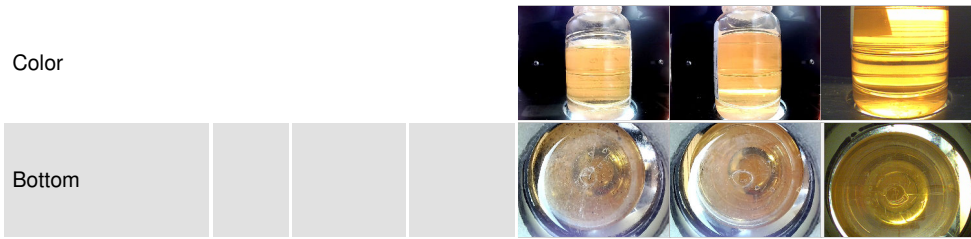

### GRAPHS

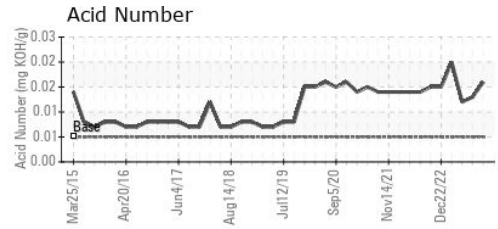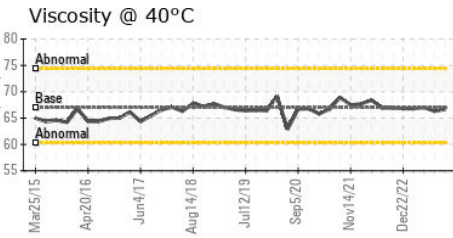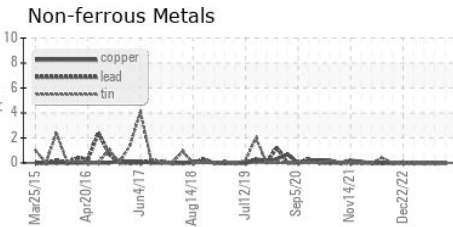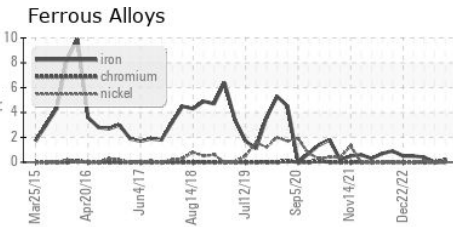

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : USP0004004 **Received** : 08 Dec 2023  
**Lab Number** : 06029436 **Diagnosed** : 11 Dec 2023  
**Unique Number** : 10779227 **Diagnostician** : Doug Bogart  
**Test Package** : IND 2

**CONAGRA FOODS**  
 801 DYE MILL ROAD  
 TROY, OH  
 US 45373  
 Contact: MIKE WEAVER  
 mike.weaver@conagrafoods.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)