

# **OIL ANALYSIS REPORT**

# Area [W128302] **CUMMINS DSFAE-58L3827 - HILTON GARDEN INN**

Component

**Diesel Engine** 

**DIESEL ENGINE OIL SAE 15W40 (--- GAL)** 





Recommendation Resample at the next service interval to monitor.

Metal levels are typical for a new component breaking in.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

				Dec2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0797258		
Sample Date		Client Info		05 Dec 2023		
Machine Age	hrs	Client Info		168		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATIC	N	method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	<1		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>2	0		
Titanium	ppm	ASTM D5185m	>2	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	250	99		
Barium	ppm	ASTM D5185m	10	0		
Molybdenum	ppm	ASTM D5185m	100	71		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	450	153		
Calcium	ppm	ASTM D5185m	3000	1922		
Phosphorus	ppm	ASTM D5185m	1150	879		
Zinc	ppm	ASTM D5185m	1350	1255		
Sulfur	ppm	ASTM D5185m	4250	4618		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6		
Sodium	ppm	ASTM D5185m	>158	0		
Potassium	ppm	ASTM D5185m	>20	3		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>6	0		
Nitration	Abs/cm	*ASTM D7624	>20	6.8		
Sulfation	Abs/.1mm	*ASTM D7415	>30	16.6		
FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	12.1		
Base Number (BN)	mg KOH/g	ASTM D2896	8.5	7.7		



## **OIL ANALYSIS REPORT**

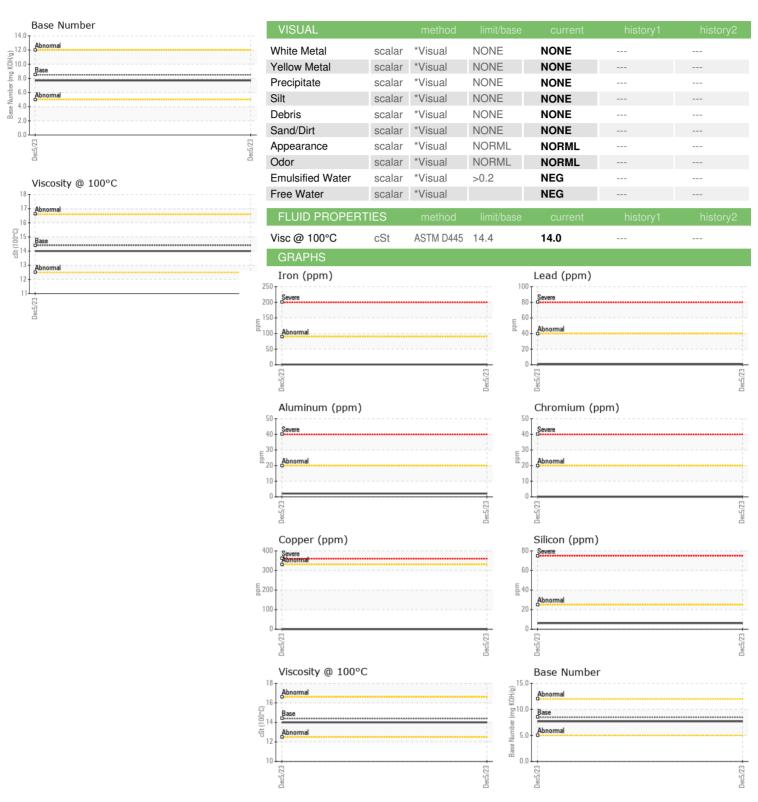





Laboratory Sample No. Lab Number

**Unique Number** 

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0797258 : 06030152 : 10779943

Diagnosed

Diagnostician : Wes Davis Test Package : MOB 1 (Additional Tests: TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

**NATIONAL POWER CORP** 

4541 PRESLYN DR RALEIGH, NC US 27616

Contact: BRANDON RICE brandon.rice@natpow.com

T: F: (919)790-9714

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Received

: 11 Dec 2023

: 12 Dec 2023