
## **FUEL REPORT**

## Sample Rating Trend





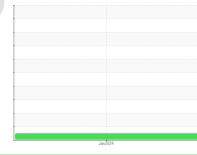

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0812894		
Sample Date		Client Info		03 Jan 2024		
Machine Age	hrs	Client Info		0		
Sample Status				NORMAL		
PHYSICAL PROP	ERTIES	method	limit/base	current	history1	history2
ASTM Color	scalar	*ASTM D1500		L4.0		
Visc @ 40°C	cSt	ASTM D445		2.45		
SULFUR CONTER	NT	method	limit/base	current	history1	history2
Sulfur	ppm	ASTM D5185m		1		
Sulfur (UVF)	ppm	ASTM D5453		7		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	<1.0	0		
Sodium	ppm	ASTM D5185m	<0.1	1		
Potassium	ppm	ASTM D5185m	<0.1	0		
Water	%	ASTM D6304	<0.05	0.013		
ppm Water	ppm	ASTM D6304	<500	130		
% Gasoline	%	*In-House	<0.50	0.0		
% Biodiesel	%	*In-House	<20.0	2.9		
HEAVY METALS		method	limit/base	current	history1	history2
Aluminum	ppm	ASTM D5185m	<0.1	0		
Nickel	ppm	ASTM D5185m	<0.1	0		
Lead	ppm	ASTM D5185m	<0.1	0		
Vanadium	ppm	ASTM D5185m	<0.1	0		
Iron	ppm	ASTM D5185m	<0.1	0		
Calcium	ppm	ASTM D5185m	<0.1	1		
Magnesium	ppm	ASTM D5185m	<0.1	0		
Phosphorus	ppm	ASTM D5185m	<0.1	<1		
Zinc	ppm	ASTM D5185m	<0.1	0		
SAMPLE IMAGES	\$	method	limit/base	current	history1	history2
Color					no image	no image

Area [133681] Machine Id 157670 Component Diesel Fuel Fluid {not provided} (--- GAL)

#### DIAGNOSIS

#### Recommendation

All laboratory tests indicate that this sample meets specifications for No.2 ultra-low-sulfur diesel fuel.

#### Corrosion

All metal levels are normal indicating no corrosion in the system.

### Contaminants

There is no bacteria or fungus (yeast and/or mold) indicated in the sample. The water content is negligible. There is no indication of any contamination in the fuel.

#### **Fuel Condition**

Sulfur value derived by ASTM D5453 method for ULSD validation. Sulfur level is acceptable for ULSD specification.


Bottom

no image

no image



# **FUEL REPORT**

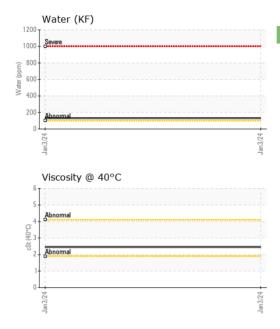

NATIONAL POWER CORP : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Laboratory Sample No. : WC0812894 Recieved : 08 Jan 2024 4541 PRESLYN DR Lab Number : 06054479 Diagnosed : 11 Jan 2024 RALEIGH, NC Unique Number : 10820428 Diagnostician : Doug Bogart US 27616 Test Package : DF-5 (Additional Tests: Screen) Contact: BRANDON RICE Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. brandon.rice@natpow.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (919)790-9714

Contact/Location: BRANDON RICE - NATRAL

Pensky-Martens Flash Point (°C)

10

ç 0

-7

-10

Jan3/24

T:

Jan3/24