


# **OIL ANALYSIS REPORT**

# SMART OIL 6000 **HERTZ VD001331 - MM PACKAGAING**

Component

Compressor

SMARTOIL 6000 (--- GAL)

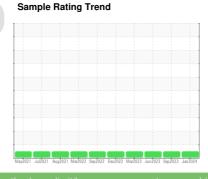



### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UHK06055970	UHK05957748	UHK05902413
Sample Date		Client Info		03 Jan 2024	05 Sep 2023	13 Jun 2023
Machine Age	hrs	Client Info		22709	21920	19906
Oil Age	hrs	Client Info		7113	6000	6000
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	N	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	<1	0
Lead	ppm	ASTM D5185m	>25	0	0	0
Copper	ppm	ASTM D5185m	>50	0	0	0
Tin	ppm	ASTM D5185m	>15	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m	20	0	0	0
Phosphorus	ppm	ASTM D5185m		334	368	428
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m		370	434	634
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1	<1	<1
Sodium	ppm	ASTM D5185m		0	0	1
Potassium	ppm	ASTM D5185m	>20	0	1	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.34	0.34	0.27



cSt (40°C)

45

## **OIL ANALYSIS REPORT**

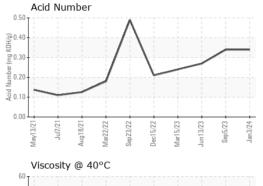

VISUAL		method				history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG

FLUID PROPERTIES		method				history	
Visc @ 40°C	cSt	ASTM D445	46	55.9	50.3	50.0	


SAMPLE IMAGES


Color


**Bottom** 






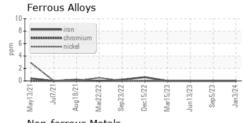

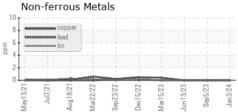

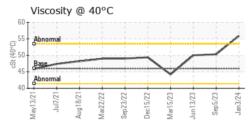

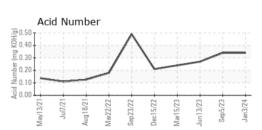





Certificate L2367

Laboratory Sample No. Lab Number Unique Number Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UHK06055970 : 06055970

: 10821919

Recieved : 09 Jan 2024 Diagnosed : 10 Jan 2024 Diagnostician : Don Baldridge HERTZ KOMPRESSOREN USA INC

3320 SERVICE ST CHARLOTTE, NC US 28206

F: (704)579-5997

Contact: WARRANTY

warranty@hertz-kompressoren.us T: (704)579-5900

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)