


OIL ANALYSIS REPORT

Area [604063047 SDR] 2 SLATE CONV PRI (S/N 20058864)

Component Gearbox

GEAR OIL ISO 460 (--- GAL)

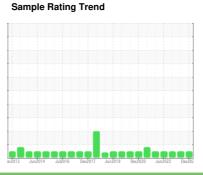



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0854519	WC0605493	WC0562054
Sample Date		Client Info		23 Dec 2023	16 Jun 2023	11 Dec 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Changed	Not Changd	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	25	34	33
Chromium	ppm	ASTM D5185m	>15	0	<1	<1
Nickel	ppm	ASTM D5185m	>15	0	0	2
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	2	0
Lead	ppm	ASTM D5185m	>100	0	0	0
Copper	ppm	ASTM D5185m	>200	1	1	0
Tin	ppm	ASTM D5185m	>25	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	2	2	4
Barium	ppm	ASTM D5185m	15	<1	2	0
Molybdenum	ppm	ASTM D5185m	15	0	0	0
Manganese	ppm	ASTM D5185m		0	<1	<1
Magnesium	ppm	ASTM D5185m	50	0	<1	<1
Calcium	ppm	ASTM D5185m	50	33	4	1
Phosphorus	ppm	ASTM D5185m	350	132	145	96
Zinc	ppm	ASTM D5185m	100	0	3	<1
Sulfur	ppm	ASTM D5185m	12500	1871	2117	1578
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	1	2	1
Sodium	ppm	ASTM D5185m		<1	0	2
Potassium	ppm	ASTM D5185m	>20	2	2	1
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.85	0.53	0.60	0.42



OIL ANALYSIS REPORT

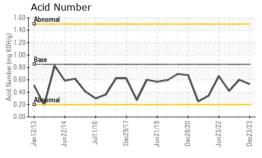

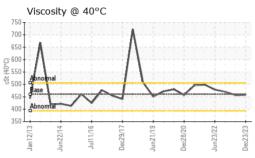


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	LIGHT
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPERT	IFS	method	limit/hase	current	history1	history2


Visc @ 40°C	cSt	ASTM D445	460	458	457	470


SAMPLE IMAGES


Color


Bottom



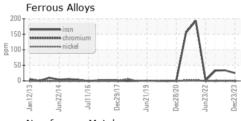



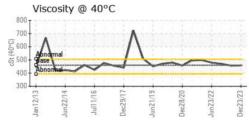

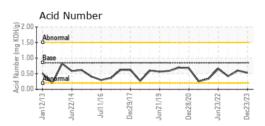





Laboratory Sample No. Lab Number Unique Number : 10835822

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0854519 : 06064440

Recieved

Diagnosed

: 18 Jan 2024 : 21 Jan 2024 Diagnostician : Don Baldridge

US 60707 Contact: TONY FIORE tony.fiore@effem.com T: (773)745-2279

MARS CHOCOLATE

CHICAGO, IL

2019 NORTH OAK PARK

Test Package : IND 2 Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: MARSCHI [WUSCAR] 06064440 (Generated: 01/21/2024 11:12:09) Rev: 1

Contact/Location: TONY FIORE - MARSCHI