


PROBLEM SUMMARY

ACAS 115 [7824] ATLAS COPCO ITJ436169

Component

Compressor

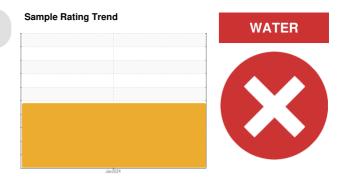

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We advise that you follow the water drain-off procedure for this component. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC T	EST RE	SULTS		
Sample Status			SEVERE	
Free Water	scalar	*Visual	5.0	

Customer Id: UCADVTOM **Sample No.:** UCH06074890 Lab Number: 06074890 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED AC	ECOMMENDED ACTIONS					
Action	Status	Date	Done By	Description		
Water Drain-off			?	We advise that you follow the water drain-off procedure for this component.		

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

ACAS 115 [7824] Machine Id ATLAS COPCO ITJ436169

Component

Compressor

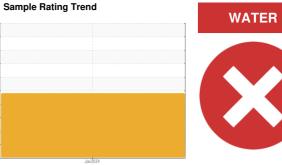

DIAGNOSIS

Recommendation

We advise that you follow the water drain-off procedure for this component. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Excessive free water present. Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jan 2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06074890		
Sample Date		Client Info		11 Jan 2024		
Machine Age	hrs	Client Info		821		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		2		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		89		
Zinc	ppm	ASTM D5185m		6		
Sulfur	ppm	ASTM D5185m		193		
CONTAMINANTS	8	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	8		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.1	0.022		
ppm Water	ppm	ASTM D6304	>1000	220		
pp	ррпп	710 1111 2000 1				
FLUID DEGRAD	• •	method	limit/base	current	history1	history2
•					history1	history2



OIL ANALYSIS REPORT

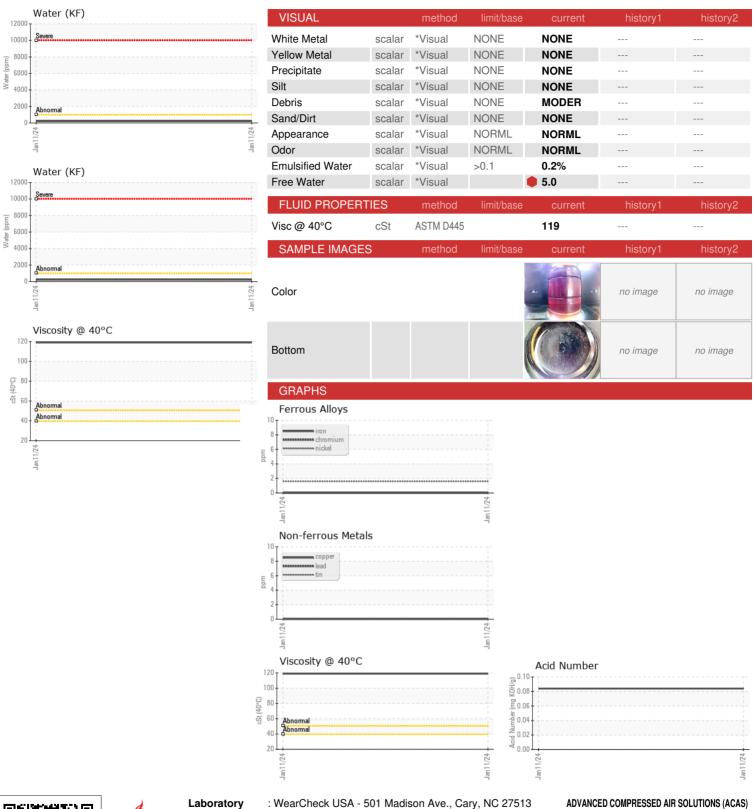





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: UCH06074890 : 06074890 : 10856981

: 30 Jan 2024 Recieved Diagnosed

: 01 Feb 2024 Diagnostician Test Package : IND 2 (Additional Tests: KF)

: Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ADVANCED COMPRESSED AIR SOLUTIONS (ACAS)

9421 FM 2920 RD BLDG 23 TOMBALL, TX

US 77375

Contact: JIM SUAREZ jim@advancedcompressedair.com

T:

F: