




Area  
**[F02939]**  
 Machine Id  
**VOLVO L90H 627137**  
 Component  
**Bottom Diesel Fuel**  
 Fluid  
**{not provided} (--- GAL)**

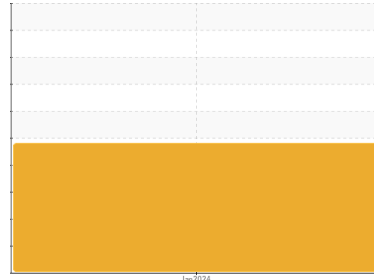

**DIAGNOSIS**

**Recommendation**

We advise that you follow the water drain-off procedure for this component.

**Corrosion**

All metal levels are normal indicating no corrosion in the cooling system.

**Contaminants**

Excessive free water present. Water appears to be from DEF.

**Fuel Condition**

The condition of the fuel is acceptable for the time in service.

**SAMPLE INFORMATION** method limit/base current history1 history2

Sample Number	Client Info	<b>VCP426819</b>	---	---
Sample Date	Client Info	<b>29 Jan 2024</b>	---	---
Machine Age	hrs	Client Info	<b>196</b>	---
Sample Status			<b>SEVERE</b>	---

**PHYSICAL PROPERTIES** method limit/base current history1 history2

Visc @ 40°C	cSt	ASTM D445	<b>2.36</b>	---	---
-------------	-----	-----------	-------------	-----	-----

**SULFUR CONTENT** method limit/base current history1 history2

Sulfur	ppm	ASTM D5185m	<b>0</b>	---	---
--------	-----	-------------	----------	-----	-----

**CONTAMINANTS** method limit/base current history1 history2

Silicon	ppm	ASTM D5185m	<1.0	<b>0</b>	---	---
Sodium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Potassium	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---
Water	%	ASTM D6304	<0.05	<b>0.010</b>	---	---
ppm Water	ppm	ASTM D6304	<500	<b>104</b>	---	---

**HEAVY METALS** method limit/base current history1 history2





Aluminum	ppm	ASTM D5185m	<0.1	<b>2</b>	---	---
Nickel	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Lead	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Vanadium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Iron	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Calcium	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Magnesium	ppm	ASTM D5185m	<0.1	<b>&lt;1</b>	---	---
Phosphorus	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---
Zinc	ppm	ASTM D5185m	<0.1	<b>0</b>	---	---

**SAMPLE IMAGES** method limit/base current history1 history2

Color					no image	no image
Bottom					no image	no image

**FUEL REPORT**

**GRAPHS**

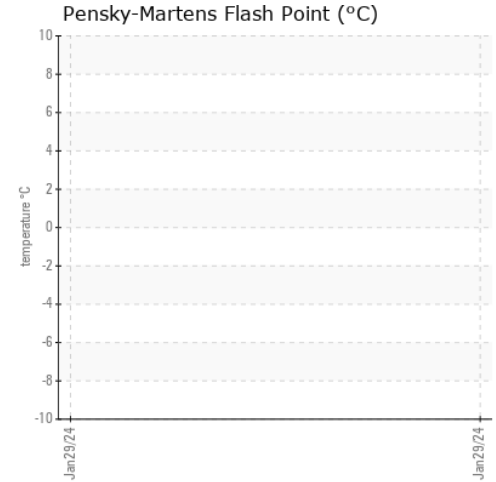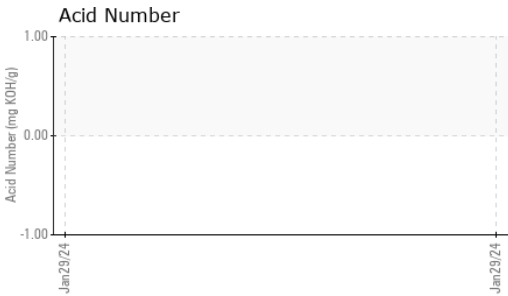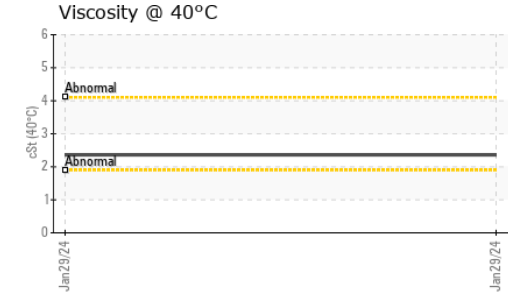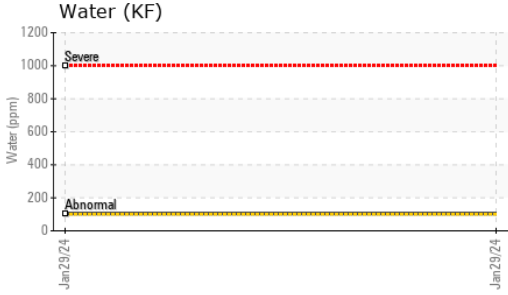

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : VCP426819 **Received** : 31 Jan 2024  
**Lab Number** : **06076247** **Diagnosed** : 06 Feb 2024  
**Unique Number** : 10858338 **Diagnostician** : Jonathan Hester  
**Test Package** : MOB 1 ( Additional Tests: Bacteria, KF )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**CHADWICK-BAROSS INC**  
 31 JAMES P. MURPHY INDUSTRIAL HWY  
 WEST WARWICK, RI  
 US 02893  
 Contact: NORMAN VINCENT  
 norman.vincent@chadwick-baross.com  
 T: (401)328-6967  
 F: