




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Area
[978962]
 Machine Id
K9 COMPRESSOR 4
 Component
Compressor
 Fluid
{not provided} (--- GAL)

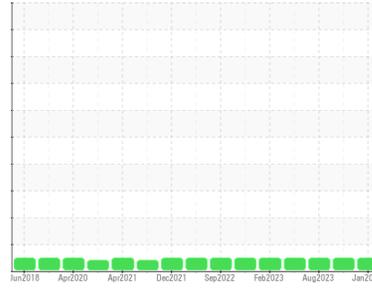

DIAGNOSIS

Recommendation
 Resample at the next service interval to monitor.

Wear
 All component wear rates are normal.

Contamination
 There is no indication of any contamination in the oil.

Fluid Condition
 The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0897107	WC0852644	WC0816139
Sample Date	Client Info	25 Jan 2024	03 Nov 2023	15 Aug 2023
Machine Age	hrs Client Info	0	0	64598
Oil Age	hrs Client Info	0	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.1	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >50	0	0	<1
Chromium	ppm ASTM D5185m >10	0	0	0
Nickel	ppm ASTM D5185m	<1	0	<1
Titanium	ppm ASTM D5185m	0	0	0
Silver	ppm ASTM D5185m	<1	0	0
Aluminum	ppm ASTM D5185m >25	<1	<1	0
Lead	ppm ASTM D5185m >25	2	0	<1
Copper	ppm ASTM D5185m >50	2	0	<1
Tin	ppm ASTM D5185m >15	1	0	<1
Vanadium	ppm ASTM D5185m	<1	0	0
Cadmium	ppm ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m	0	0	0
Barium	ppm ASTM D5185m	0	2	0
Molybdenum	ppm ASTM D5185m	<1	0	0
Manganese	ppm ASTM D5185m	2	0	0
Magnesium	ppm ASTM D5185m	<1	2	<1
Calcium	ppm ASTM D5185m	1	3	<1
Phosphorus	ppm ASTM D5185m	136	205	167
Zinc	ppm ASTM D5185m	32	75	29
Sulfur	ppm ASTM D5185m	39	7	32

CONTAMINANTS



method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >25	<1	0	0
Sodium	ppm ASTM D5185m	2	0	0
Potassium	ppm ASTM D5185m >20	4	0	<1

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D8045	0.44	0.64	0.44



OIL ANALYSIS REPORT

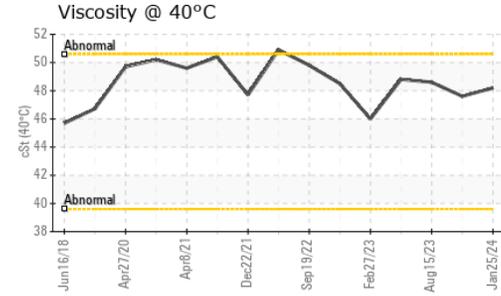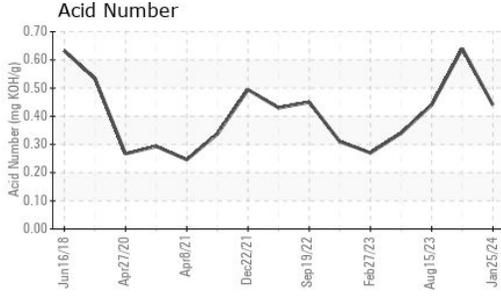






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	48.2	47.6	48.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------



GRAPHS

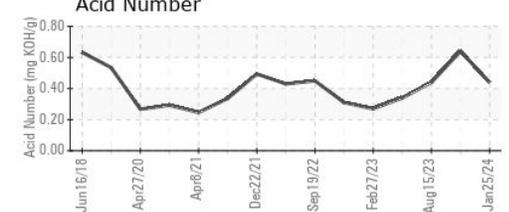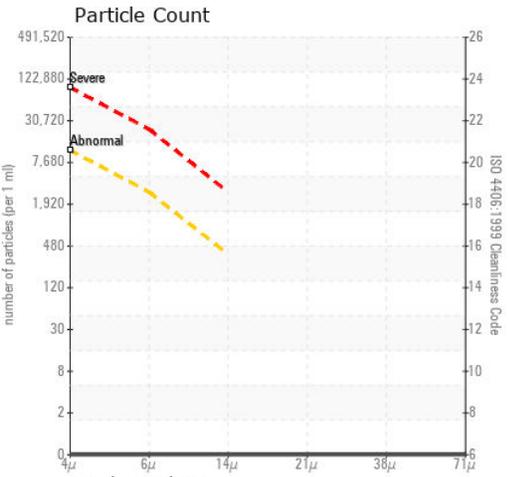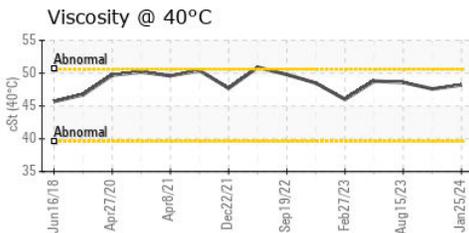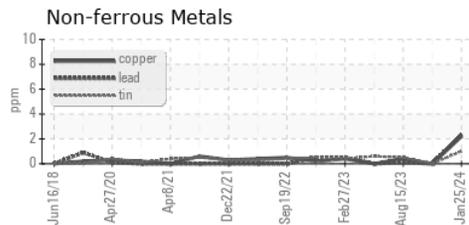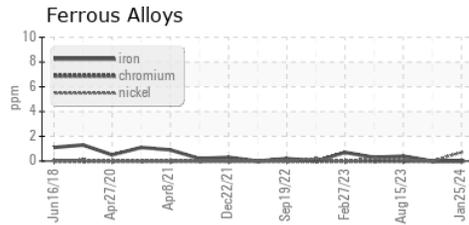

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
 Sample No. : WC0897107 Recieved : 01 Feb 2024
 Lab Number : 06077653 Diagnosed : 05 Feb 2024
 Unique Number : 10859744 Diagnostician : Jonathan Hester
 Test Package : IND 2 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

BALDWIN FILTERS INC
 4400 HIGHWAY 30 EAST
 KEARNEY, NE
 US 68847-0724
 Contact: JAY FAHRENBRUCH
 jay.fahrenbruch@parker.com

T:
 F: (800)828-4453