


OIL ANALYSIS REPORT

AIRLUBE 228 [1402767] Machine Id ATLAS COPCO AIF072-803 - FRAM 4

Component

Compressor

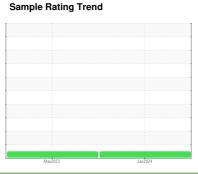



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06098518	UCH05910132	
Sample Date		Client Info		10 Jan 2024	24 May 2023	
Machine Age	hrs	Client Info		129623	124952	
Oil Age	hrs	Client Info		6671	2101	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	3	
Chromium	ppm	ASTM D5185m	>5	0	0	
Nickel	ppm	ASTM D5185m		<1	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>15	10	10	
Lead	ppm	ASTM D5185m	>65	0	<1	
Copper	ppm	ASTM D5185m	>65	<1	0	
Tin	ppm	ASTM D5185m	>10	<1	0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0	0	
Barium	ppm	ASTM D5185m	0	0	<1	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m	0.3	<1	0	
Magnesium	ppm	ASTM D5185m	0	<1	0	
Calcium	ppm	ASTM D5185m	0	<1	0	
Phosphorus	ppm	ASTM D5185m	406	105	122	
Zinc	ppm	ASTM D5185m	0	0	<1	
Sulfur	ppm	ASTM D5185m	1283	13	8	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0	0	
Sodium	ppm	ASTM D5185m		1	0	
Potassium	ppm	ASTM D5185m	>20	<1	1	
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.76	0.46	



OIL ANALYSIS REPORT

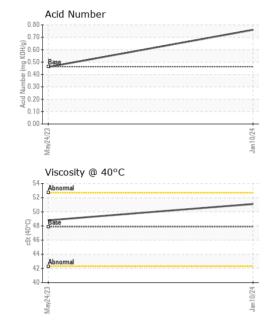


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	LIGHT	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
FLUID PROPERT	TES	method	limit/base	current	history1	history2

I LOID I HOI LITT	ILO					
Visc @ 40°C	cSt	ASTM D445	47.9	51.1	48.8	


SAMPLE IMAGES	method			history2
		1		


Color


Bottom

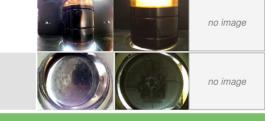


GRAPHS

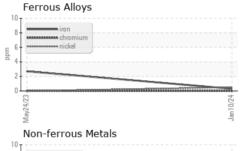

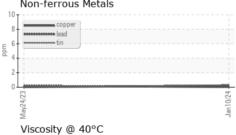

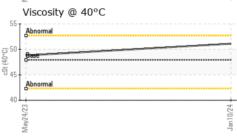

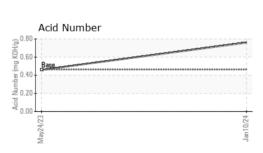





Certificate L2367

Laboratory Sample No.

: UCH06098518 Lab Number : 06098518 Unique Number : 10896748 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 23 Feb 2024

Tested : 26 Feb 2024 Diagnosed : 26 Feb 2024 - Don Baldridge **AIR TECHNOLOGIES INC (MID)**

400 WRIGHT AVE MIDDLETOWN, OH US 45044

Contact: Josh Oaks josh.oaks@aircompressors.com

F: (513)539-6040

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)